



**VEHICLE FACTORS GROUP CHAIRMAN'S
FACTUAL REPORT**

Vehicle Attachment 5 - 2005 Ford – NHTSA Recall History

Oxnard, CA

HWY15MH006

(4 pages)

2005 FORD F-450 SD

Recalls	Investigations	Complaints	Service Bulletins
5	0	37	114

RECALLS: Displaying 1 - 5 out of 5

— RECALL Subject : STEERING COLUMN MULTIFUNCTION SWITCH/FMVSS 108

Report Receipt Date: JUL 13, 2011
NHTSA Campaign Number: 11V352000
Component(s): EXTERIOR LIGHTING

[All Products Associated with this Recall](#) ▼

[Details](#) ▲

[13 Associated Documents](#) 📄

Manufacturer: FORD MOTOR COMPANY

SUMMARY:

FORD IS RECALLING CERTAIN MODEL YEAR 2011 RANGER TRUCKS BUILT FROM JANUARY 25, 2011, THROUGH APRIL 25, 2011 AT THE TWIN CITIES ASSEMBLY PLANT, AND SERVICE PARTS DISTRIBUTED TO DEALERS FOR CERTAIN 2004 THROUGH 2011 MODEL YEAR RANGER TRUCKS, 2002 THROUGH 2005 MODEL YEAR EXCURSION VEHICLES, AND 2002 THROUGH 2007 MODEL YEAR F-250, F-350, F-450, AND F-550 TRUCKS FOR FAILING TO COMPLY WITH THE REQUIREMENTS OF FEDERAL MOTOR VEHICLE SAFETY STANDARD NO. 108, "LAMPS, REFLECTIVE DEVICES, AND ASSOCIATED EQUIPMENT." THE MULTI-FUNCTION SWITCH WAS SHIPPED WITH A SUBCOMPONENT (SLIDER) THAT MAY EXPERIENCE DEFORMATION. A MULTI-FUNCTION SWITCH WITH A DEFORMED SLIDER MAY MALFUNCTION CAUSING THE TURN SIGNAL, TAIL LIGHTS, HAZARD WARNING SIGNAL FLASHERS AND/OR BRAKE LIGHTS NOT TO ACTIVATE.

CONSEQUENCE:

NON-FUNCTIONING LIGHTS COULD INCREASE THE RISK OF A CRASH.

REMEDY:

DEALERS WILL REPLACE THE SWITCHES FREE OF CHARGE. THE SAFETY RECALL BEGAN ON AUGUST 15, 2011. OWNERS MAY CONTACT FORD MOTOR COMPANY CUSTOMER RELATIONSHIP CENTER AT 1-866-436-7332.

NOTES:

FORD'S SAFETY RECALL NO. 11C18. OWNERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO [HTTP://WWW.SAFERCAR.GOV](http://www.safercar.gov).

Name	Description	Size(KB)
RCAK-11V352-1708.pdf	Recall Acknowledgement	29
RCDNN-11V352-7934.pdf	Defect Notice(Part 573)	411
RCMN-11V352-2515.pdf	Manufacturer Notices(to Dealers,etc)	98
RCOVL-11V352-0124.pdf	Owner Notification Letter(Part 577) Re-notification	165
RCQPR-11V352-0112.pdf	Quarterly Performance Report	64
RCQPR-11V352-0212.pdf	Quarterly Performance Report	200
RCQPR-11V352-0311.pdf	Quarterly Performance Report	69
RCQPR-11V352-0312.pdf	Quarterly Performance Report	2523
RCQPR-11V352-0411.pdf	Quarterly Performance Report	62
RCQPR-11V352-0412.pdf	Quarterly Performance Report	240
RCRIT-11V352-8735.pdf	Remedy Instructions and TSB	64
RCRN-11V352-4757.pdf	Renotification Notice	596
RCRN-11V352-6205P.pdf	Renotification Notice	549

— RECALL Subject : 90 DEGREE 7-WAY RIGHT ANGLE ADAPTORS/TOW ASSEMBLIE

Report Receipt Date: AUG 28, 2007
NHTSA Campaign Number: 07E066000
Component(s): EQUIPMENT

[All Products Associated with this Recall](#) ▼

Manufacturer: CEQUENT ELECTRICAL PRODUCTS

SUMMARY:

CERTAIN CEQUENT 90 DEGREE 7-WAY RIGHT ANGLE ADAPTORS SOLD BY DISTRIBUTORS IN TOW PACKAGES FOR AFTERMARKET SALES TO TOW 5TH WHEEL RV TRAVEL TRAILERS. DUE TO INCORRECT WIRING OF THE HARNESS, THE TRAILER LIGHTS MAY NOT OPERATE PROPERLY.

CONSEQUENCE:

IF THE TRAILER LIGHTS ARE NOT WORKING PROPERLY, A VEHICLE CRASH CAN OCCUR.

REMEDY:

ALL OF THE DEFECTIVE TOW PACKAGES ARE STILL AT THE DISTRIBUTOR LEVEL AND HAVE NOT BEEN SOLD TO ANY CONSUMERS.

NOTES:

THIS RECALL ONLY PERTAINS TO AFTERMARKET CEQUENT TOW PACKAGES AND HAS NO RELATION TO ANY ORIGINAL EQUIPMENT INSTALLED ON DAIMLERCHRYSLER, GMC, OR FORD VEHICLES. CUSTOMERS MAY CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY: 1-800-424-9153); OR GO TO HTTP://WWW.SAFERCAR.GOV.

— **RECALL Subject : ENGINE STALLING , 1 INVESTIGATION(S)**

Report Receipt Date: JUN 10, 2005

NHTSA Campaign Number: 05V270000

Component(s): ELECTRICAL SYSTEM

All Products Associated with this Recall ▼

Manufacturer: FORD MOTOR COMPANY

SUMMARY:

CERTAIN PICKUP TRUCKS, SPORT UTILITY VEHICLES AND VANS EQUIPPED WITH 6.0L DIESEL ENGINES MAY EXPERIENCE STALLING WITHOUT WARNING WHILE DRIVING AND MAY OR MAY NOT RESTART.

CONSEQUENCE:

SHOULD THE ENGINE STALL, A VEHICLE CRASH COULD OCCUR.

REMEDY:

DEALERS WILL UPGRADE THE FUEL INJECTION CONTROL MODULE (FICM) WIRE HARNESS OR REPLACED, AND/OR HAVE A NEW INJECTION CONTROL PRESSURE (ICP) SENSOR CONNECTOR INSTALLED FREE OF CHARGE. THE RECALL BEGAN ON JULY 22, 2005. OWNERS MAY CONTACT FORD AT 1-800-392-3673.

NOTES:

FORD RECALL NO. 05S34. CUSTOMERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO HTTP://WWW.SAFERCAR.GOV.

Name	Description	Size(KB)
RCAK-05V270-5632.PDF	Recall Acknowledgement	95
RCDNN-05V270-1253.PDF	Defect and Noncompliance Notice(Part 573)	170
RCONL-05V270-9637.PDF	Owner Notification Letter(Part 577)	473
RCQPR-05V270-1087.PDF	Quarterly Performance Report	49
RCQPR-05V270-1233.PDF	Quarterly Performance Report	99
RCQPR-05V270-4772.PDF	Quarterly Performance Report	95
RCQPR-05V270-6286.PDF	Quarterly Performance Report	117
RCQPR-05V270-6322.PDF	Quarterly Performance Report	101
RCQPR-05V270-8582.PDF	Quarterly Performance Report	126
RCRIT-05V270-2396.PDF	Remedy Instructions and TSB	1913
RCRIT-05V270-2995.PDF	Remedy Instructions and TSB - Supplement 1	1801
RCRIT-05V270-4948.PDF	Remedy Instructions and TSB - Supplement 2	1986
RCRIT-05V270-9111.PDF	Remedy Instructions and TSB	1481

1 Associated Investigation(s) ▼

— **RECALL Subject : FUEL JUMPER LINE**

Report Receipt Date: JUN 09, 2005

NHTSA Campaign Number: 05V266000

Component(s): FUEL SYSTEM, GASOLINE

All Products Associated with this Recall ▼

Manufacturer: FORD MOTOR COMPANY

SUMMARY:

ON CERTAIN PICKUP TRUCKS AND CHASSIS CAB VEHICLES EQUIPPED WITH 5.4L OR 6.8L GASOLINE ENGINES, THE FUEL JUMPER LINE MAY HAVE AN INCORRECT END FORM.

CONSEQUENCE:

THE FUEL LINE MAY SEPARATE AT THE CONNECTION TO THE MAIN FUEL BUNDLE. IF THE FUEL LINE SEPARATES, AN OPERATOR MAY NOTICE A GASOLINE ODOR AND/OR FUEL ON THE GROUND, LOSS OF POWER, AND THE ENGINE WILL EVENTUALLY STALL. FUEL LEAKAGE IN THE PRESENCE OF AN IGNITION SOURCE COULD RESULT IN A FIRE.

REMEDY:

DEALERS WILL INSTALL AN EXTERNAL RETENTION CLIP AT THE FUEL JUMPER LINE TO THE MAIN FUEL BUNDLE CONNECTION. THE RECALL BEGAN ON JUNE 20, 2005. OWNERS MAY CONTACT FORD AT 1-800-392-3673.

NOTES:

FORD RECALL NO. 05S33. CUSTOMERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO HTTP://WWW.SAFERCAR.GOV.

— **RECALL Subject : STEERING GEAR**

Report Receipt Date: APR 06, 2005
NHTSA Campaign Number: 05V135000
Component(s): STEERING

[All Products Associated with this Recall](#) ▼

[Details](#) ▲

[11 Associated Documents](#) 

Manufacturer: FORD MOTOR COMPANY

SUMMARY:

ON CERTAIN CHASSIS CAB TRUCKS, THE STEERING GEAR MAY HAVE SOME GEARS WITH A GEAR PISTON THAT WAS ASSEMBLED WITH AN INCORRECT RE-CIRCULATING BALL TUBE RETAINER. AN INCORRECT RETAINER MAY RESULT IN AN IMPROPERLY RETAINED RE-CIRCULATING BALL TUBE, WHICH MAY NOT KEEP THE RE-CIRCULATING BALLS IN PLACE DURING STEERING GEAR ACTUATION.

CONSEQUENCE:

IF THE RE-CIRCULATING BALLS BECOME DISLODGED A VEHICLE OPERATOR MAY NOTICE NOISE AND INCREASED STEERING EFFORTS THAT MAY EVENTUALLY PROGRESS TO IMPAIRED STEERING OR POTENTIAL LOSS OF STEERING WHICH COULD RESULT IN A CRASH.

REMEDY:

DEALERS WILL INSPECT THE STEERING GEAR FOR A SPECIFIC DATE CODE AND REPLACE IF NECESSARY FREE OF CHARGE. THE RECALL BEGAN ON APRIL 4, 2005. OWNERS MAY CONTACT AT 1-800-392-3673.

NOTES:

FORD RECALL NO. 05S30. CUSTOMERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO HTTP://WWW.SAFERCAR.GOV.

Name	Description	Size(KB)
RCAK-05V135-8469.PDF	Recall Acknowledgement	70
RCDNN-05V135-1288.PDF	Defect and Noncompliance Notice(Part 573)	213
RCMN-05V135-1451.PDF	Manufacturer Notices(to Dealers,etc)	64
RCOVL-05V135-5136.PDF	Owner Notification Letter(Part 577)	123
RCQPR-05V135-2286.PDF	Quarterly Performance Report	106
RCQPR-05V135-5826.PDF	Quarterly Performance Report	135
RCQPR-05V135-8187.PDF	Quarterly Performance Report	92
RCQPR-05V135-8897.PDF	Quarterly Performance Report	46
RCQPR-05V135-9066.PDF	Quarterly Performance Report	89
RCQPR-05V135-9462.PDF	Quarterly Performance Report	103
RCRIT-05V135-7731.PDF	Remedy Instructions and TSB	844

1200 New Jersey Avenue, SE, West Building Washington DC 20590 USA 1.888.327.4236 TTY 1.800.424.9153