

JPS Aviation, LLC 5410 Operations Road, Monroe, LA 71203 Phone (800) 223-3895; (318) 387-0222; (318) 325-7558; FAX (318) 387-0289

				Work On	der:	13394	ŀ		Opened: Closed:	11/01/2013 5/31/2014
Sold To: RAY MAR Carmi, IL 6										
Aircreft Number:	N653T	Т	ype:	H36			S/N: D	-4998	}	
Total Time		Hobbs Time:			Tach	Time:	5,527.6	LG	Cycles:	
Discrepancy: 1				ويترك المراجعة إيراج معشورة						
Problem: PRELIMINARY INSPEC Action Taken: LEFT HAND MAIN FUEI		IAS FUEL STAIN	IS ON	AND ARO	UND IT	. COMPL	IED WITH	I PREI	IMINARY I	NSPECTION.
· · · · · · · · · · · · · · · · · · ·			••••				Total For	This Dia	crepancy.	N/C
Discrepancy: 2										
Action Taken: DRAINED LEFT AND R orginal time entered wa Charges This fi	is on 11/11/2013					··· ···				
				·			Total For	This Di	crepancy: 1	6
Discrepancy: 3										
Problem: ENGINE RAN ON JET I	UEL.									
Action Taken: REMOVED ENGINE SE SUPPORT, RE-INSTAL SHAPE OR DAMAGED SUPPLIED BY ENGINE SETTING. Charges This I	LED ENGINE WI SERVICED ENG REPAIR SHOP.	ITH ADELL CLAN	APS A	ND CORR	ECT HA	ARDWAR RAL OIL .	E THAT V AND 1 PI	NERE	in Un-Air ' Oil Addi'	worthy rive,
Part Number	Description	C	redit	Quantity	Units	List	Price D	isc	Unit Price	Extender
A DESCRIPTION OF THE OWNER OWN	Shim				Each					
100 MINERAL OIL	MINERAL OIL				QUART					
2A37C223-C	Propeller			1.00	Each	:				
	S/N: 070557				Fast					
AN3-12	BOLT		+		Each Each					
AN3-4A	BOLT			the second s	Each					
AN737TW28 AN819-2D (S/S MS20819-20	SLEEVE		┝╼╍╍┥		Each					
	and a subscription of the second s		·		Each					
ANO0.10 (MS35769.11)	WASHER			1.00	Zau)					
AN900-10 (MS35769-11) CR3213-4-3	RIVET				Each					

JPS Aviation, LLC 5410 Operations Road, Monroe, LA 71203

REPLACED METERI 1000306618 FOR H0 Part Number 111417-4S0280 111417-4S0280 111F417-4S0380 111F417-4S0112 111F417-4S0114 111F417-4S0144 Discrepancy: 7 Problem: FLUSH FUEL SYSTI Action Talenty	NKS AND AUX TANKS, FL	E AND FUEL P ACED. Credit	UMP DRAIN LINE. R Quantity Units 1.00 Each 1.00 Each 1.00 Each 1.00 Each 1.00 Each 1.00 Each	List Price Disc Total For This	Unit Price Discrepancy: \$	
Action Taken: REPLACED HOSES REPLACED METERI 1000306618 FOR HO Part Number 111417-480280 111417-480380 111F417-480384 111F417-480384 111F417-680144 Discrepancy: 7 Problem: FLUSH FUEL SYSTI Action Taken: DRAINED MAIN TAN CONTAMINATION.	ED FUEL PRESSURE LIN OSES THAT WERE REPL Description Hose Hose Hose Hose Hose Hose Hose Hose	E AND FUEL P ACED. Credit	UMP DRAIN LINE. R Quantity Units 1.00 Each 1.00 Each 1.00 Each 1.00 Each 1.00 Each 1.00 Each	List Price Disc	Unit Price Discrepancy: \$	
Action Taken: REPLACED HOSES REPLACED METERI 1000306618 FOR HO Part Number 111417-450280 111417-450380 111F417-450112 111F417-450144 Discrepancy: 7 Problem:	ED FUEL PRESSURE LIN OSES THAT WERE REPL Description Hose Hose Hose Hose Hose	E AND FUEL P ACED.	Quantity Units 1.00 Each 1.00 Each 1.00 Each 1.00 Each 1.00 Each 1.00 Each 1.00 Each	List Price Disc	Unit Price	
Action Taken: REPLACED HOSES REPLACED METERI 1000306618 FOR HO Part Number 111417-450280 111417-450360 111F417-450112 111F417-450384 111F417-650144	ED FUEL PRESSURE LIN OSES THAT WERE REPL Description Hose Hose Hose Hose	E AND FUEL P ACED.	Quantity Units 1.00 Each 1.00 Each 1.00 Each 1.00 Each 1.00 Each 1.00 Each 1.00 Each	List Price Disc	Unit Price	
Action Taken: REPLACED HOSES REPLACED METERI 1000306618 FOR HO Part Number 111417-480280 111417-480380 111F417-480112 111F417-480384	ED FUEL PRESSURE LIN OSES THAT WERE REPL Description Hose Hose Hose Hose	E AND FUEL P ACED.	Quantity Units 1.00 Each 1.00 Each 1.00 Each 1.00 Each 1.00 Each 1.00 Each 1.00 Each	List Price Disc	Unit Price	
Action Taken: REPLACED HOSES REPLACED METERI 1000306618 FOR HO Part Number 111417-480280 111417-480360 111F417-480112 111F417-480384	ED FUEL PRESSURE LIN OSES THAT WERE REPL Description Hose Hose Hose Hose	E AND FUEL P ACED.	Quantity Units 1.00 Each 1.00 Each 1.00 Each 1.00 Each 1.00 Each 1.00 Each 1.00 Each	List Price Disc	Unit Price	
Action Taken: REPLACED HOSES REPLACED METERS 1000306618 FOR HO Part Number 111417-450280 111417-450360 111F417-450112 111F417-450114	ED FUEL PRESSURE LIN OSES THAT WERE REPL Description Hose Hose Hose Hose	E AND FUEL P ACED.	Quantity Units 1.00 Each 1.00 Each 1.00 Each 1.00 Each 1.00 Each	EPLACED ENGINE F		
Action Taken: REPLACED HOSES REPLACED METER 1000306618 FOR HO Part Number 111417-450280 111417-450360 111F417-4\$0112	ED FUEL PRESSURE LIN OSES THAT WERE REPL Description Hose Hose	E AND FUEL P ACED.	Quantity Units 1.00 Each 1.00 Each 1.00 Each	EPLACED ENGINE F		
Action Taken: REPLACED HOSES REPLACED METERS 1000306618 FOR HO Part Number 111417-450280	ED FUEL PRESSURE LIN OSES THAT WERE REPL Description Hose Hose	E AND FUEL P ACED.	Quantity Units 1.00 Each 1.00 Each	EPLACED ENGINE F		
Action Taken: REPLACED HOSES REPLACED METERS 1000306618 FOR HO Part Number	ED FUEL PRESSURE LIN OSES THAT WERE REPL Description	E AND FUEL P ACED.	Quantity Units 1.00 Each	EPLACED ENGINE F		
Action Taken: REPLACED HOSES REPLACED METERS 1000306618 FOR HO	ED FUEL PRESSURE LIN OSES THAT WERE REPL	E AND FUEL P ACED.	UMP DRAIN LINE. R	EPLACED ENGINE F		
Action Taken: REPLACED HOSES REPLACED METERS	ED FUEL PRESSURE LIN	E AND FUEL P	MAGED METAL DRA UMP DRAIN LINE. R	AIN LINES AND FUE EPLACED ENGINE +	L PRESSURE LIN 105E5 SEE AVIA	ies. Ll W/O
Problem:	NE HOSES.					
Discrepancy: 6					and the second secon	
	g			Total For This	Discrepancy: \$	N/C
Action Taken: REMOVED IMPROPE	ER HARDWARE AND REF		CORRECT HARDW/	ARE ON ENGINE INS	TALLATION.	
	RE WAS WRONG TYPE A	NU UK MISSIN	IG ITARD VYARE, VVQ			
Bue blanks					APS.	
Discrepancy: 5						
				Total For This I	Discrepancy: \$	N/C
Action Taken: STARTER WAS RE-P	AIRED DURING ENGINE	INSPECTION.				
STARTER BATTERY	LUG IG GINIFFED.					
Problem:						
Discrepancy: 4						
				Total For This 1	Ascrepancy: 15	
QS100MZ4H (20024H)	CLAMP 2"		1.00 EACH	W	Nite aleman an announce 1 de	
MS35489-9 (5/S 434-129) MS35489-9 (5/S 434-129)	GROMMET		1.00 EACH			
MS35489-6	GROMMET		1.00 EACH			
MS35489-5	GROMMET		1.00 EACH			
MS28778-5	ORING		1.00 EACH			
MS25171-1S	COVER		2.00 EACH			
M821919WDG2	CLAMP		3.00 EACH			
MS21045-3 (MS20365-1032	NUT		4.00 Each			
ABLANT & AFRANAT JAAA	I' NUT	; [4.00 Each			
MS21045-3 (MS20365-1032	NUT		4.00 Each			
MS21045-3 (MS20365-1032 MS21045-3 (MS20365-1032	HUI INOLIVALIVAL		1.00 Each			
MS21042L08 MS21045-3 (MS20365-1032 MS21045-3 (MS20365-1032	NUT (MS21042-08)	: 1	2.00 Each ;			
A\$21042L08 A\$21042L08 A\$21045-3 (M\$20365-1032 A\$21045-3 (M\$20365-1032	NUT (MS21042-08)		water water and a second se			
M111 MS20365-720C MS21042L08 MS21042L08 MS21045-3 (MS20365-1032 MS21045-3 (MS20365-1032 MS21045-3 (MS20365-1032	The second s		1.00 Each 4.00 Each			

JPS Aviation, LLC 5410 Operations Road, Monroe, LA 71203

Discrepancy: 8							and a second		
Problem:					*** **********************************				
	RUT HAS LEAKED ALL FL	.UID OUT,							
Action Taken:									
REMOVED LEFT HAN	D MAIN GEAR STRUT AN	D DISSEMBL	ED, CLEAI	NED IN:	SPECTED, REI	NOVED	AND REPLACE	ed o'rings,	
	328775-011, M83461-1-32								
RETRACT TEST ON G	BSEMBLY BACK IN AIRCH EAR. OP'S CHECK GOOL	ላሉ FI, Gracka ካ		THNGS	ON LEFT HAP	IU MAII	SIRUI, PER	ORMED	
T T I T T T T T T T T T T T T T T T T T			• •						
Charges This									
Part Number	Description	Credit	Quantity		List Price	Disc	Unit Price	Extended	
M83461-1-224	PACKING			Each					
M83461/1-328	O'RING		THE REAL PROPERTY OF THE PARTY	Each					
MS28775-011 MS28776R2-20	O-RING			Each					
WI020//012-20	ORING		1.00	Each		Cos This	Discrepancy: \$		
						POT (IIIS	Discrepancy: a		
Discrepancy: 9									
Problem:	ALIPER WAS LEAKING.								
Action Taken:									
	D BRAKE CALIPER, CLE/		MRLED AV	IO REP	LACED O'RING	S, P/N	M83401/1-222.	BLEED	
	SERVICED RESERVOIR.								
Charges This									
Part Number	Description	Credit	Quantity		List Price	Disc	Unit Price	Extended	
M83461/1-222 (S/S 101-345	O'RING		1,00	Each					
					Total	For This	Discrepancy: \$		
Miscellaneous Charge	19:	and the second							
							hop Supplies: \$		
				a	n n) na managana synar naidi i biyati é		structure Fee: \$		
						Ge	neral Freight: \$		
Summary:				T-1-1 0	Pa ri .				
Total Parts: Total Freight	\$ t: \$			Total (Jii: Supplies:		\$		
Infrastructur					abor -		9 5		
Totals:	<u>vi v.</u>			1 9 1911					
			Qui	Total:					
			1 10 10 10 10 10 10 10 10 10 10 10 10 10			0 I X 00	-		
			Sales-LA 4.0%: Sales-Lci 5.99%:						
			COMPANY AND	al Cha					
					iemaining:	• ••• <i>•</i>			
				oliir i	Hell Manchild.	- 144			
Work Orders are due u	pon receipt. Credit Card (payments req	uire an ado	litional	3% Service Cha	nge. N	o returns on ele	ctrical	
parts. No parts exchan	ges. Customer returning	parts must p	ay a 20% re	estockin	g charge.				
and is approved for ret	aircraft engine, propeller o	r appliance il	ndentmed a	Dove 19	anwortny with	respect	to the work per	bermed	
	MINI W BGIYKM.								
FAA Repair Station - M	aintánance #3MIR878B								
-544	the sources								
Signed.	and the second								
1-7	_11/								
Date: 6 A	-/ 4							1	
N	<u></u>							·····	
Printed: 6/02/2014		Work Order	: 13394				Page: 3 c	of 4	