



VEHICLE FACTORS ATTACHMENT

Vehicle Examination Photographs

Williamsburg, VA

HWY23MH004

(7 pages)



Photo1. The front of the Eldorado Bus.



Photo 2. The damage sustained to the rear of the bus.



Photo 3. The instrument cluster for the bus.



Photo 4. The windshield wipers setting for the bus.



Photo 5. The partially blocked prescreen fuel filter from the bus.



Photo 6. The damage sustained to the right side of the truck-tractor.



Photo 7. The severed power cable to the vehicle control modules.



Photo 8. The damage sustained to the left side of the truck-tractor.



Photo 9. The arrows are pointing to some paint transfer from the bus.

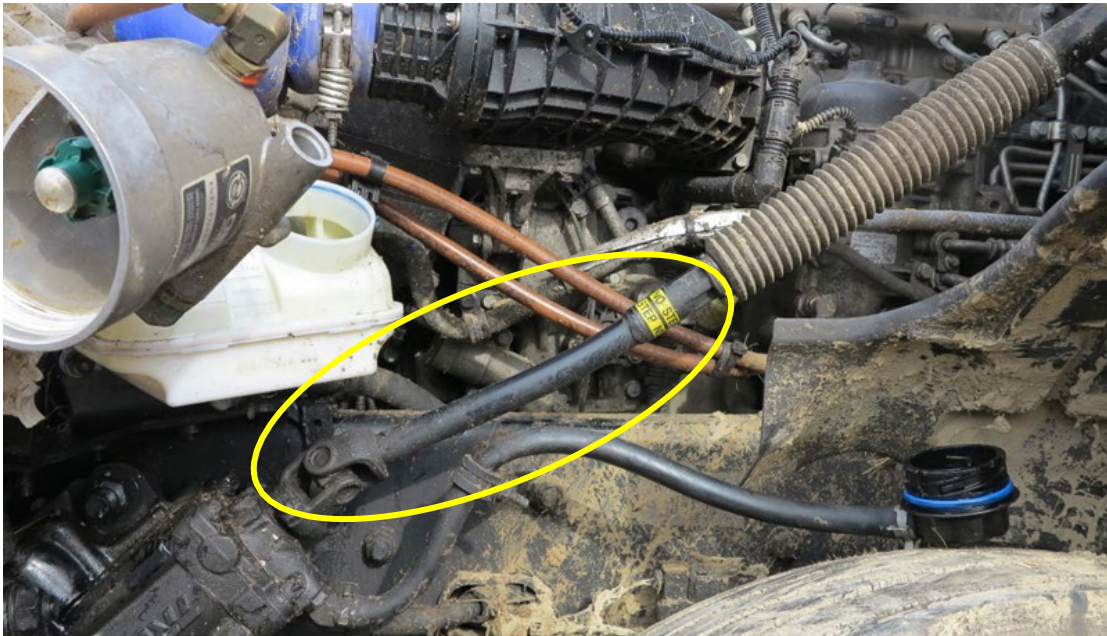


Photo 10. The bent lower steering arm.



Photo 11. The center gauge cluster of the truck-tractor.



Photo 12. The windshield wipers setting for the truck-tractor.



Photo 13. The transmission gear selector for the truck.