

Total Time	Tach or g	Description of Work Performed	Certificate Number & Signature of Technician Performing Work	Page 28
		Balance Forward		
		N8149R -	TACH TIME 3604.6	10/28/2022
		PERFORMED ROUTINE 50 HR INSPECTION IAW PIPER WARRIOR INSPECTION SHEET CHANGED OIL WITH 8 QTS PHILLIPS X C 20 W 50 INSTALLED NEW OIL FILTER AA481110-2		
		ROBERT GAINOR [REDACTED] A&P - [REDACTED]		
		N8149R	Tach 3655.70	01/04/23
		Routine 100 hr. inspection accomplished IAW FAR part 43 appendix D. Compression check shows #4 cylinder 44/80. Replaced #4 cylinder with an overhauled assembly from Columbia Aircraft Services Inc. Yellow tag attached. Compression check as follows #1) 71/80, #2) 76/80, #3) 78/80, #4) 74/80. Oil and filter changed, serviced with 8 quarts of Phillips x/c 20w/50 and installed a AA48110-2 oil filter. Cleaned, gapped and rotated spark plugs. Run-up on ground satisfactory, no defect or leaks noted. I certify that this engine has been inspected I.A.W. a 100 hr. Inspection and was determined to be in an airworthy condition. Robert Gainor A&P [REDACTED]		
Totals - Carry Forward				

**SERVICEABLE TAG**


PART No. AE 85099  
 MFG'S NAME Cycom Inc

SERIAL No. 29526-1-3  
 QUANTITY 1

The aircraft and/or component identified above was inspected in accordance with current Federal Aviation Administration Regulations and was found airworthy for return to service.

#85-2  
 Overhauled/Repaired

Pertinent details of the repair are on file at this agency under work order No. 8526  
 Date 7/10/22  
 Signed [REDACTED]  
 for Columbia Aircraft Services, Inc.  
 Bloomington, IN  
 FAA R.S. # JM2R930K

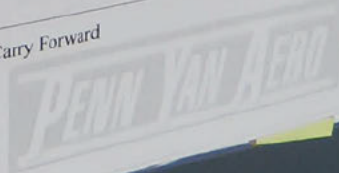

APPLICABLE AIRWORTHINESS

PROPELLER