



**VEHICLE FACTORS GROUP PHOTOGRAPHS**

**Belton, SC**

**HWY20FH001**

**(6 pages)**




Photograph 1 – View of the 2009 Goshen Coach medium-size bus drivers' compartment depicting driver controls and deployed airbag.




Photograph 2 – Front view of the 2015 Chevrolet Equinox depicting collision damage.



Photograph 3 - Right side view of the 2015 Chevrolet Equinox.

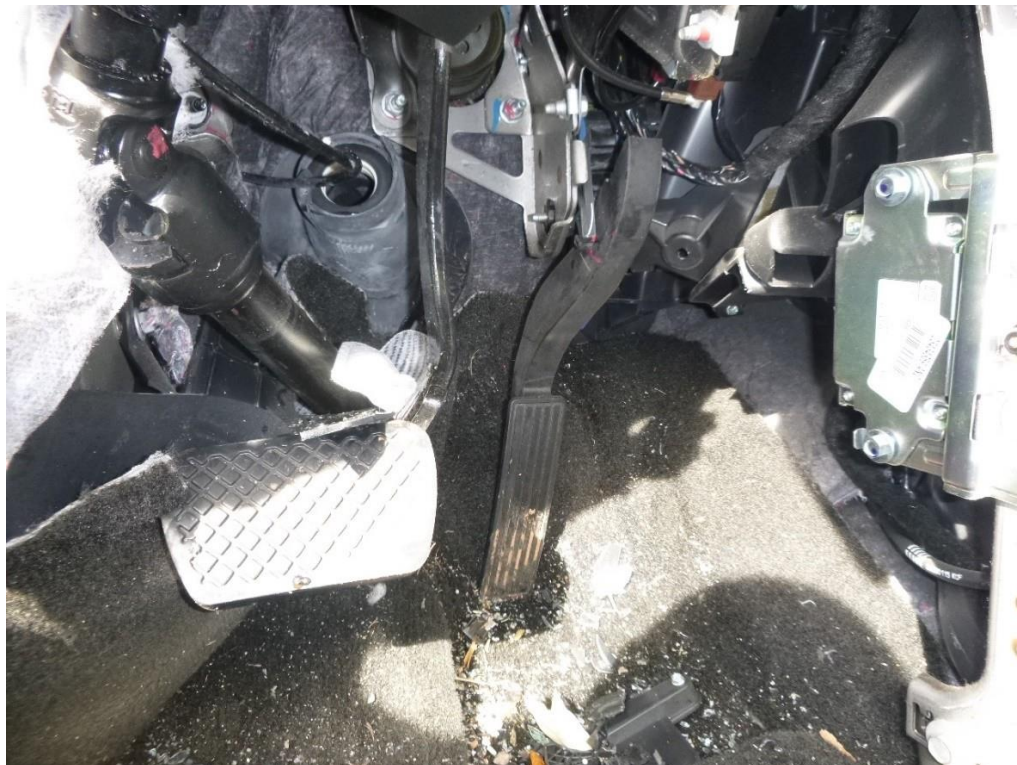


Photograph 4 - Depicting Drivers' foot well area and accelerator pedal and mounting bracket of the 2015 Chevrolet Equinox.

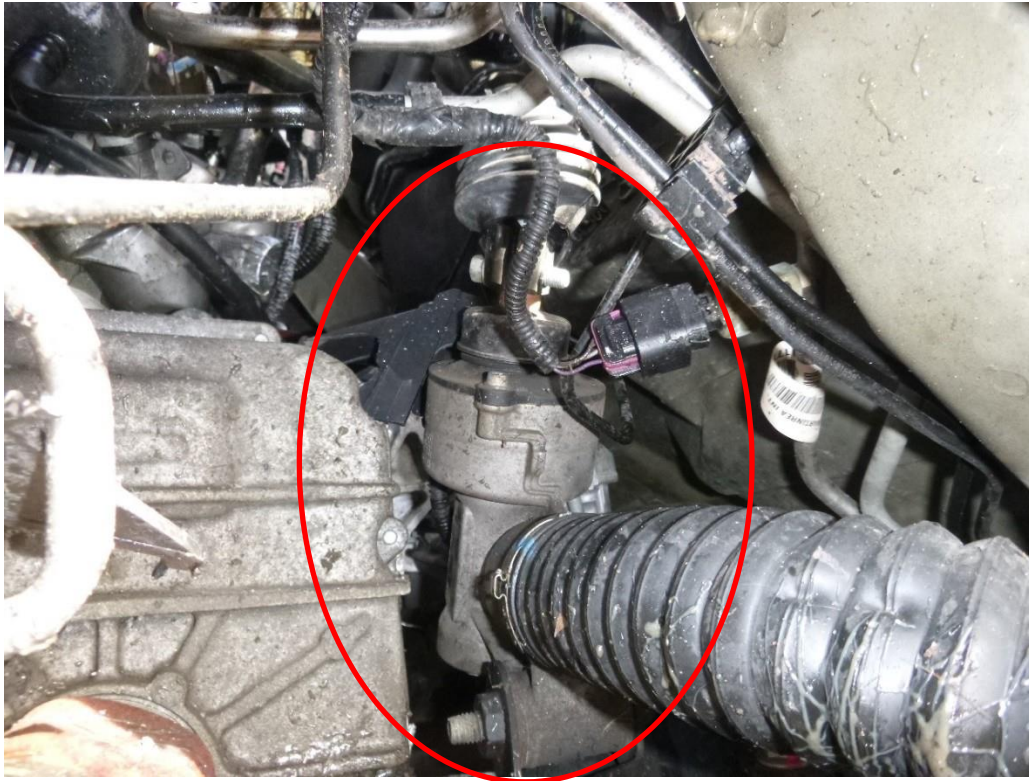

Photograph 5 - Depicting the 2015 Chevrolet Equinox power steering unit circled in red.



Photograph 6 - Depicting the 2015 Chevrolet Equinox steering column and couplings.

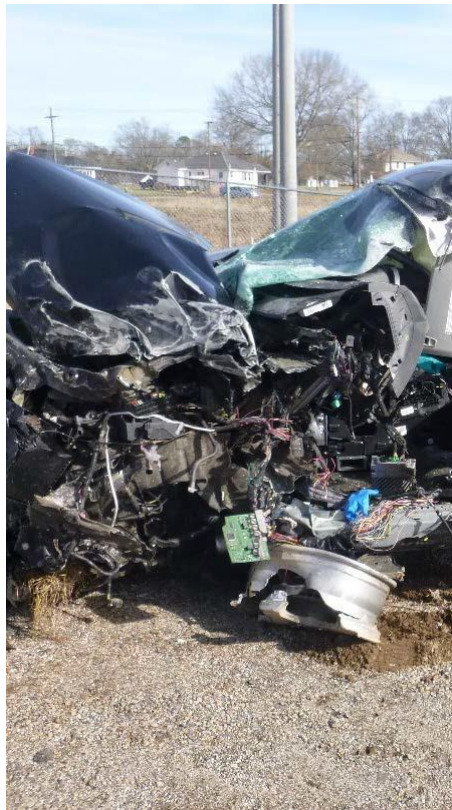

Photograph 7 - Depicting the damage to left front suspension coil spring, strut, and tie rod on the 2015 Chevrolet Equinox.



Photograph 8 - Depicting the damage to the master cylinder on the 2015 Chevrolet Equinox.



Photograph 9 - Depicting the right front and left rear rotor and brake assembly on the 2015 Chevrolet Equinox.