

Wednesday, June 08, 2022 01:47 PM

Service Report

s	Model erial No.				Reques Work Orde	r No PW						Wo	ork Order Statu Delivered Dat		:d
	Store No Employee		00	Contact Name Contact Phone	GEORGE PE	TRELIS			istomer Name		IFIC SURV	EY GROL	JP LLC		
;	Date Service M Equipmer Purchase	leter nt No	02/28/2022 58108 PSG00896	Equipment Location Instructions	OCEAN GUA	ARDIAN GE	EN 3								
,	lob Contr	rol	RR NO	Vehicle No. Vehicle Make Vehicle Model Vehicle Arr. No			Eng S Eng M Eng A	odel	09AN00261 AA 3516B 1743191	1	Per	duct ID N f Spec duct Cod	0K-2417		
eg	Oper	F/R	Task Description	Special Instructions	Warranty Type Code	MCustNo	MCustCls	LCustNo	o LCustNo	PCustNo	PCustCls	Cost Center	Component Code	Job Code	Standar Hours
2		0.0000	INSPECT ELECTRIC POWER GENERATOR	AIR GAPS AND INSPECT/GREASE BEARINGS PO PSG00896								PG	4450	040	0.00
eg	Oper	F/R	Task Description	Special Instructions	Warranty Type Code	MCustNo	MCustCls	LCustNo) LCustNo	PCustNo	PCustCls	Cost Center	Component Code	Job Code	Standar Hours
3		0.0000	REPLACE WITH NEW CKSHFT MAIN & ROD BRG	AFTER MARKET BEARINGS PO PSG00929								ME	1230	511	70,00

Report Generated by Wayne Valenta



Service Report

	Model Serial No.	3516B 09AN002	Make AA 61		-	st ID 679723 or No PW03942					Wo	ork Order Statu Delivered Da		d
Seg	Орег	F/R	Task Description	Special Instructions	Warranty Type Code	MCustNo MCustCis	LCustNo	LCustNo	PCustNo	PCustCls	Cost Center	Component Code	Job Code	Standard Hours
04		0.0000	CLEAN AFTERCOOLER	NO R/I LABOR, INCLUDED IN TEOH							ME	1063	070	20.00
Seg	Oper	F/R	Task Description	Special Instructions	Warranty Type Code	MCustNo MCustCls	LCustNo	LCustNo	PCustNo	PCustCls	Cost Center	Component Code	Job Code	Standard Hours
05		0.0000	REPLACE WITH NEW ENGINE COOLANT	NO LABOR, INCLUDED IN TEOH PO# PSG0112							ME	1395	511	0.00
Seg	Oper	F/R	Task Description	Special Instructions	Warranty Type Code	MCustNo MCustCls	LCustNo	LCustNo	PCustNo	PCustCls	Cost Center	Component Code	Job Code	Standard Hours
06		0.0000	ADJUST INLET/EXHAUST VALVE								ME	1105	025	5.00
Seg	Oper	F/R	Task Description	Special Instructions	Warranty Type Code	MCustNo MCustCls	LCustNo	LCustNo	PCustNo	PCustCls	Cost Center	Component Code	Job Code	Standard Hours
99		1660.0 000	TRAVEL TO/FROM ENGINE								PG	1000	056	2.00
Cust	omer Sigr	nature				Page 2 of 3	Techn	ician Signa	ture					

Wednesday, June 08, 2022 01:47 PM

Report Generated by Wayne Valenta



Service Report

200	3516B 09AN00261	Make AA	Request ID Work Order No		Work Order Status Invoiced Delivered Date				
03	Repair	Comment	#11 Rod bearing failed to meet cat st	ERVICE COM Dec, crank OK. Witing 2 weeks for b	MENTS I need to replace ALL rod bearings in engine. Cat bearings were 85 days out, customer opted earing to show up. Removed oil cooler, starter, oil pump, prelube pump to access base doors.				
04	Repair	Comment	Replace all rod bearings with IPD, torquing all to spec. R+R aftercooler. Remove turbo piping, air intake tract, replace aftercoolers with exchange. Reseal and install, torquing to spec. Fill with water and verify no leaks at this time.						
06	Repair	Comment	LOTO engine, remove valve covers and breathers. Adjust overhead, valves and injectors to spec. All OK inside. Torque all lock nuts to spec and install valve covers and breathers. Start engines and verify proper operation.						

Customer Signature Page 3 of 3 Technician Signature