

12 Months Locomotive Failure Repair History for BNSF 9015

Last Retrieval At: 2023-10-25|09:46

WO Typ	Open		Defect		Qualifier		Action
	Date	Station	JCD	Description	CD	Description	
DF 9	10/19/2023	FTWORT	F013	Wear Metal ;		Piston/Cylinder	
	Due Comment : 10/19/2023 09:52:13 CST (C840731) Shop Immediate ly - High iron High iron. CPA test and repairs. Inspect valve adjustment screw seat and lash adj? button? for scoring. Do not change oil. I inspect rings, pistons, liners. Inspect oil filters, screens and strainers for metal particles.						
DF 3	10/11/2023	UMBARG	F013	Won't Load ;		Engine Block	Duplicate
	Due Comment : 10/11/2023 02:53:47 CST (B160514) DP ALARM SWAPP ED OUT THE CABLES. WONT LOAD. 10/11/2023 04:52:2 9 CST (C848067) Send downloads to BNSF.techsupp ort@progressrail.com for detailed workscope.						
	10/11/2023	UMBARG					
	Comment : 10/11/2023 02:53:47 CST (B160514) DP ALARM SWAPP ED OUT THE CABLES. WONT LOAD. 10/11/2023 04:52:2 9 CST (C848067) Send downloads to BNSF.techsupp ort@progressrail.com for detailed workscope. 10/1 1/2023 04:59:30 CST (B161042) Responder rebooted computer and relinked. Loading normally.						
DF 9	10/5/2023	FTWORT	F013	Second Sample ;			
	Due Comment : 10/05/2023 11:37:37 CST (C840731) Collect oil sa mple and overnight to lab FE Engine Oil Second S ample Defect						
DF 9	10/1/2023	FTWORT		Communication loss ;		Wipu	
	Due Comment : 10/01/2023 00:30:42 CST (S_BAT_MAM) Witronix not ification: BNSF 9015						
DF 9	10/1/2023	FTWORT		60 Fuel Level invalid ;		Fuel Sensor #1	
	Due Comment : 10/01/2023 00:30:31 CST (S_BAT_MAM) Witronix not ification: BNSF 9015						
DF 9	9/14/2023	CHICAG	F020	Measurement Out Of Toleran;			Repaired
	Due Comment : 09/14/2023 01:25:26 CST (B147658) BNSF 9015 TMLT GEAR CASE LUBE 6 quarts = > ADDED - TM06 TM Cha ngeout Required						
	9/30/23	ALLINE					
	Comment : OOT - BNSF 9015 Traction Motor Lube Top D Kurth Complete September 30 2023 19:19 _____ R Coon TM changed September 30 2023 08:22						
DF 9	9/14/2023	CHICAG	F020	Measurement Out Of Toleran;			Repaired
	Due Comment : 09/14/2023 01:25:06 CST (B147658) BNSF 9015 TMLT GEAR CASE LUBE 6 quarts = > ADDED - TM05 TM Cha ngeout Required						
	9/30/23	ALLINE					
	Comment : OOT - BNSF 9015 Traction Motor Lube Top D Kurth Complete September 30 2023 19:19 _____ R Coon TM changed September 30 2023 08:22						
DF 9	5/16/2023	CHICAG		Communication loss ;		Wipu	Repaired
	Due Comment : 05/16/2023 15:00:47 CST (S_BAT_MAM) Witronix not ification: BNSF 9015						
	9/30/23	ALLINE					
	Comment : Communication loss D Kurth Complete September 30 2023 19:18 _____ D Brennan Unit has no mods or upgrades. Still on the 3G network. September 30 2 023 18:09						
DF 9	5/16/2023	CHICAG		60 Fuel Level invalid ;		Fuel Sensor #1	Repaired
	Due Comment : 05/16/2023 15:00:37 CST (S_BAT_MAM) Witronix not ification: BNSF 9015						
	9/30/23	ALLINE					
	Comment : 60 Fuel Level invalid D Brennan Unit has no mods or upgrades. Still on 3G network. September 30 2023 18:09						
DF 9	1/6/2023	FTWORT		Communication loss ;		Wipu	Repaired
	Due Comment : 01/06/2023 00:01:00 CST Mechanical batch ID (S_B AT_MAM) Witronix notification: BNSF 9015						
	5/16/23	LINCNE					
	Comment : Communication loss J Downs Pending May 16 2023 14:31 _____						
DF 9	1/5/2023	FTWORT		60 Fuel Level invalid ;		Fuel Sensor #1	Repaired
	Due Comment : 01/05/2023 17:30:52 CST Mechanical batch ID (S_B AT_MAM) Witronix notification: BNSF 9015						
	5/16/23	LINCNE					
	Comment : 60 Fuel Level invalid M Havlat good May 16 2023 14:34 _____						
DF 3	12/28/2022	DONCRE	F018	Feedback Signal ;		Feedback Sensors	Repaired
	Due Comment : 12/28/2022 01:26:22 CST Lee Billard (B001288) RA DIO: Crew reports b alarm. Unit has active coola nt temp faults, possible AWOT or wiring issue... MEO _____ 12/ 28/2022 02:16:10 CST Mohammad Marzoug (C847822) Take downloads and send to BNSFIntermediatesuppo rt@progressrail.com for complete workscope.						
	10/5/23	ALLINE					
	Comment : RADIO: Crew reports b alarm. Unit has a G Sander s Good January 5 2023 15:46 _____						
DF 9	12/25/2022	FTWORT		29 No Communication with D;		DVR	Repaired
	Due Comment : 12/25/2022 22:45:27 CST Mechanical batch ID (S_B AT_MAM) Witronix notification: BNSF 9015						
	10/5/23	ALLINE					
	Comment : 29 No Communication with DVR G Sanders Good Janu ary 5 2023 15:46 _____						
DF A	12/25/2022	STMICH		No Communication ;		DP Systems	Repaired
	Due Comment : 12/25/2022 08:42:19 CST Christopher Johnson (B00 9614) Phone: The Aurora responder reports the un it will not link to another unit or ETD. The TXD A and TXDB lights on the DP HOT radio a re flashing red. MEO						
	10/5/23	ALLINE					
	Comment : Phone: The Aurora responder reports t G Sanders OKFS January 5 2023 15:48 _____						
DF 9	12/13/2022	KANCMO	F015	Shorted ;		DB Grid	Repaired
	Due Comment : 12/13/2022 18:04:01 CST Mathew Chronister (B1781 07) DYN BRAKES CUT OUT CAUSING B ALARM ACCELEROM ETER WORKS.						
	10/5/23	ALLINE					
	Comment : DYN BRAKES CUT OUT CAUSING B ALARM M Fries Grids were sprayed, New grids installed. Verify opera tion on outbound. January 4 2023 19:01 _____						
DF W	12/4/2022	LINCNE	F020	High Impact ;		Wheel	Repaired
	Due Comment : 12/04/2022 18:37:39 CST Interface Wild wheel L5 , 110 KIP reading WHL L5 Wheel High Impa ct AURO						
	12/09/22	ALLINE				Other - Text Required	
	Comment : Wild wheel L5, 110 KIP reading WHL L R Ruzicka OKFS December 8 2022 07:45 _____ R Ruzicka OKFS December 8 2022 07:45						
DF 9	11/22/2022	SALUDA	F004	Dirty ;		Door Locks	Repaired
	Due Comment : 11/22/2022 01:06:43 CST Benjamin Dye (B035286) f ront door lock rusty, won't lock, needs to be re placed						
	12/09/22	ALLINE					
	Comment : front door lock rusty, won't lock J Carlson lock works fine wasnt even tight December 7 2022 05 :17 _____						
DF 9	11/12/2022	ALLINE		60 Fuel Level invalid ;		Fuel Sensor #1	Repaired
	Due Comment : 11/12/2022 07:00:31 CST Mechanical batch ID (S_B AT_MAM) Witronix notification: BNSF 9015 _____ 11/18/2022 08: 55:18 CST Mechanical batch ID (S_BAT_MAM) Duplicate symptom reported						
	10/5/23	ALLINE					
	Comment : 60 Fuel Level invalid G Sanders Good January 5 2 023 15:49 _____						

DF 9	11/8/2022	HAUSER	F013	External Water Leak ;			Repaired
	Due Comment :		11/08/2022 08:54:48 CST Interface At next shopping: treat 6gal (12bag,2crt)				
	111222	ALLINE					
	Comment :		At next shopping: treat 6gal (12bag,2crt J Newma n treated November 11 2022 23:17				
DF I	11/7/2022	FTWORT	F026	PAST DUE FRQ ;			Repaired
	111222	ALLINE					
DF I	11/7/2022	FTWORT	F026	PAST DUE HAND BRAKE ;			Repaired
	111222	ALLINE					
DF 9	11/7/2022	FTWORT	F003	PAST DUE AFM ;			Repaired
	111222	ALLINE					
DF 9	11/1/2022	HAUMRL	F006	Missing ;		Doors/Latch/Hinge	Repaired
	Due Comment :		11/01/2022 05:06:43 CST Kory Lazelle (B105645) Missing door to sand valve access, conductor side rear				
	111222	ALLINE					
	Comment :		Missing door to sand valve access N Garmon OK No vember 11 2022 16:00 _____ D Meggison Built and installed door November 11 2022 14:51				
DF 9	11/1/2022	HAUMRL	F004	Worn ;		Windshield	Repaired
	Due Comment :		11/01/2022 05:09:01 CST Kory Lazelle (B105645) leaking windshield seal				
	111222	ALLINE					
	Comment :		leaking windshield seal W Niemeier tightened eng side wiper idler arm post.. no other obvious en try point.. seals look good? November 11 2022 05 :31				
DF 9	11/1/2022	FTWORT		60 Fuel Level invalid ;		Fuel Sensor #1	Repaired
	Due Comment :		11/01/2022 11:01:35 CST Mechanical batch ID (S_B AT_MAM) Witronix notification: BNSF 9015				
	111222	ALLINE					
	Comment :		60 Fuel Level invalid N Garmon OK November 11 20 22 20:35 _____ S DeBock Found both electronic fue l displays bad order. Replaced both displays. No vember 11 2022 16:29				
DF 9	10/30/2022	FTWORT		29 No Communication with D;		DVR	Duplicate
	Due Comment :		10/30/2022 10:15:38 CST Mechanical batch ID (S_B AT_MAM) Witronix notification: BNSF 9015				
	103022	FTWORT					
DF 9	10/13/2022	MINOT	F004	:		Water Cooler (VTR)	Repaired
	Due Comment :		10/13/2022 16:01:55 CST Interface B033024 MINOT CAB CONDITION DEFECT REPORTED BY CREW Trouble C ode: WATER COOLER				
	103022	MINOT				Check	
	Comment :		CAB CONDITION DEFECT REPORTED BY CREW AD M Olson No defect found October 30 2022 04:09 _____				