

Date	Total Time In Service	Total Time Since o/h	Tach or hour meter	Description of work performed Signature and Certificate number
Heart of Virginia Aviation 11152 Airpark Rd Ashland, VA 23005 N2777U Tach: 3914.8			July 21, 2017	
Drained oil and removed oil filter. No containments found. Replenished engine with 5 quarts of Phillips 20W50 oil and installed new filter. No leaks found after run-up at this time.				
Stephen M. Leo				
9/25/2017	2457.81	3939.61		Diff. Comp Check Completed with following Results #172 #270 #374 #472 #568 #635 over 80 Removed and Replaced #6 cyl. induction New Millennium Assy PN SA10200AP Superior BN 10M1745769, New Proton PN SA53034B, New Proton Ring PN SA2000-5C Capped Rings 2nd Superior 5L 605-096 Installed All New GasKits And Induction Assy, TQ Cylinders 2nd 0300 Oil Manual, Replaced 1st GasKit #5 cyl. Induct, Replaced 2nd Port Fuel Stud #5 cyl. Induct, Replaced Fuel A Fuel Plug AT 1st Side 4th Side #6 Cylinder, Drained oil, Replaced oil filter (no metal noted), Replaced oil filter PN C174810B-1, Rechecked TQTS Phillips Xc 20W50, Inspected engine check gap and rotated spark plugs Replaced Induction Filter Replaced PN 8A610B Engine Ground Run 3AT. Cylinders BoreScope at 1st 2nd 3rd 4th 5th 6th IAW SB 003-3 no Defects Noted
9/25/2017	2437.81	3939.61		Noting That This engine has been inspected IAW FAR 43 Appendix D For An Annual and Found Airworthy

