



N304MA

Hobbs: 2757.9

Compressions:

M/O : 46/80

1. 76
2. 68
3. 66
4. 72
5. 63
6. 68

PreBuy Squawks:

- TIT ship gauge inop **A/W**
- JPI Backlight is too dim, cannot read screen
- Prop De-ice is inop, broken wire, grease all over brushes **A/W**
- Turbo leaking oil, 1384.2 hours since overhaul, Turbo TT 2757.9 **A/W**
- FW upper case half Engine bolt missing, found bolt in engine and reinstalled
- Standby alt pulleys not aligned correctly **A/W**
- Alt air duct has multiple holes **A/W**
- Landing gear no back clutch spring replaced at hobbs 1317.9, over due for 1000 hr recommended replacement
- Windshield band has loose spots at LH and RH bottom corners
- Both pilot and co pilot mike switch buttons missing
- Speed brake switch missing button
- Scratch on pilot window, all other windows are in good shape
- LH and RH ldg light lens are yellowed
- Spark plugs are worn past limits
- Minor dents at top LH wing at aileron bellcrank
- Borescoped cylinders, all appear normal
- Fuel system needs to be set up per TCM STD 97-3E **A/W**
- Prop due for recommended overhaul by calendar date of every 6 years
- O2 bottle due for hydrostatic test a 07-2024

Kerrville, TX 78028

www.dugosh.com |