

Old Bridge Flight School
182 Pension Rd.
Englishtown, NJ 07726

N737LY
Airframe Log. Tach time 6245.9
09/13/2021

Removed all access panels and engine cowling, inspected and lubed aircraft I/A/W Cessna service manual Service all tires, serviced battery All work accomplished I/A/W Cessna service manual.

Aircraft inspected I/A/W 100hour inspection and is airworthy.

Harrington H. Bishop [REDACTED]

Old Bridge Flight School
182 Pension Rd.
Englishtown, NJ 07726

N737LY
Aircraft Log. 03/14/2022 Tach time, 6266.5 TSMO 00.0
TTIS:41895.5

Installed this engine S/N RL-6446-61A, Lycoming O-320-H2AD on this date. Engine was installed with new mounts, all new flexible hoses, Reiff engine preheater, new oil cooler. New Baffle. Serviced engine with 6 Qts of Aeroshell 100 Mineral oil and 1 pint of Lycoming additive LW-16702. Ran engine and ground operational checks performed. All were normal, no leaks noted.

Engine is airworthy.

Harrington H. Bishop [REDACTED]

Old Bridge Flight School
182 Pension Rd.
Englishtown, NJ 07726

N737LY
Airframe Log. Tach time 6266.5
03/14/2022

Opened all access panels, Inspected and lubed aircraft, Replaced induction air filter, Checked all exterior lights. Rotated and lubed cable pulleys. Serviced battery. Bled both left and right brake, serviced tires. Tightened headset microphone jack on right side. Flight controls checked for proper travel Replaced upper cowl seal. ELT checked I/A/W FAR 91.207D. All Ads checked for compliance. Inspection panels reinstalled All work accomplished I/A/W Cessna Service Manual.

Aircraft inspected I/A/W Annual/100hour inspection and is airworthy.

Harrington H. Bishop [REDACTED]

SUB-TOTAL this

TOTAL-Carry forw.

brought forward from previous page

Old Bridge Flight School
182 Pension Rd.
Englishtown, NJ 07726

N737LY

Airframe Log. Tach time 6245.9
09/13/2021

Removed all access panels and engine cowling, inspected and lubed aircraft I/A/W Cessna service manual Service all tires, serviced battery All work accomplished I/A/W Cessna service manual.

Aircraft inspected I/A/W 100 hour inspection and is airworthy.

██████████
Harrington H. Bishop ██████████

Old Bridge Flight School

182 Pension Rd.

Englishtown, NJ 07726

N737LY

Aircraft Log. 03/14/2022 Tach time, 6266.5 TSMO 00.0

TTIS:41895.5

Installed this engine S/N RL-6446-61A, Lycoming O-320-H2AD on this date. Engine was installed with new mounts, all new flexible hoses, Reiff engine preheater, new oil cooler. New Baffle. Serviced engine with 6 Qts of Aeroshell 100 Mineral oil and 1 pint of Lycoming additive LW-16702. Ran engine and ground operational checks performed. All were normal, no leaks noted.

Engine is airworthy.

Harrington H. Bishop

Old Bridge Flight School

182 Pension Rd.

Englishtown, NJ 07726

HARRINGTON H. BISHOP

Old Bridge Flight School
182 Pension Rd.
Englishtown, NJ 07726

N737LY

Airframe Log. Tach time 6266.5
03/14/2022

Opened all access panels, Inspected and lubed aircraft,
Replaced induction air filter, Checked all exterior lights.
Rotated and lubed cable pulleys. Serviced battery. Bled
both left and right brake, serviced tires. Tightened headset
microphone jack on right side. Flight controls checked for
proper travel Replaced upper cowl seal. ELT checked I/A/W
FAR 91.207D. All Ads checked for compliance. Inspection
panels reinstalled All work accomplished I/A/W Cessna Service
Manual.

Aircraft inspected I/A/W Annual/100hour inspection and is airworthy.

HARRINGTON H. BISHOP

3-TOTAL this

TOTAL-Carry forw.

Old Bridge Flight School
182 Pension Rd.
Englishtown, NJ 07726

N737LY

Airframe Log. Tach time 6146.0

08/06/2021

Removed all access panels and engine cowling, inspected and lubed aircraft I/A/W Cessna service manual. Rotated and lubed all control pulleys. Checked interior and exterior lights.

All work accomplished I/A/W Cessna service manual.

Aircraft inspected I/A/W 100hour inspection and is airworthy.

HARRINGTON H. BISHOP

DATE	TOTAL TIME IN SERVICE	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
TOTAL brought forward from previous page			

Old Bridge Flight School
182 Pension Rd.
Englishtown, NJ 07726

Tach: 6046.0	TTIS: 6046.0	
N737LY	S/N 17269512	19 March 2021

Removed all access panels and engine cowling, Inspected and lubed aircraft I/A/W Cessna service manual. Rotated and lubed all control pulleys. Replaced right main tire and tube. Serviced brake reservoir. Replaced brake pads. Inspected and service battery. Torqued all valve cover screws, Replaced vacuum regulator garter filter, and vacuum air inlet filter. Checked all exterior and interior lights, replaced strobe light on right wing tip. Replaced wing strut fairings on left side. Repaired top cowling, replaced four cowling shock mounts. Researched all Checked applicable A/Ds and New AD compliance record provided. Checked ELT I/A/W FAR 91-2.7D.

Aircraft was inspected I/A/W Annual Inspection and is airworthy.

Harrington H Bishop

Old Bridge Flight School
182 Pension Rd.
Englishtown, NJ 07726

N737LY

RECORDING
METER
TIME

DEPARTMENT NO. OF PERSON PERFORMING
SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING

TOTALS brought forward from previous page

Old Bridge Flight School

182 Pension Rd.

Englishtown, NJ 07726

N737LY

Engine Log. 03/14/2022 Tach time, 6266.5 TSMO 00.0

TTIS:41895.5

Installed this engine S/N RL-6446-61A, Lycoming O-320-H2AD on this date. Engine was installed with new mounts, all new flexible hoses, Reiff engine preheater, new oil cooler. New Baffle. Serviced engine with 6 Qts of Aeroshell 100 Mineral oil and 1 pint of Lycoming additive LW-16702. Ran engine and ground operational checks performed. All were normal, no leaks noted.

Engine is airworthy.

Harrington H. Bishop

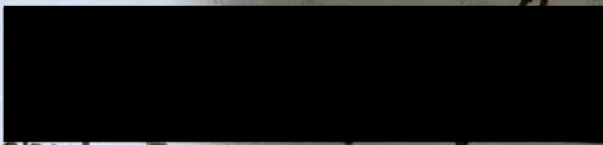
02 Feb 2022

TACH 6266.5

TSMOH O.O

Major overhaul O-320-H2AD engine S/N RL-6446-76T. Crankshaft .006 mains and .003 rods S/N 145514. Installed new Lyc camshaft P/N LW-16511 and hyd. lifters P/N 15B28093. Overhauled magneto Bendix D4RN-3000, P/N 10-682555-14 S/N I060117. Lyc cylinders 4ea. Nickel Plated. O/H carburetor 10-5217 S/N VCO18301. Installed new starter 149 NL/EC. Engine test cell run and found satisfactory. Itemized parts list and Release Certificates are Included. Mdl.O-320-H2AD S/N RL-6446-76T. Engine has been overhauled in reference to factory overhaul manual 60294-9-2. All applicable FAA AD's and Factory Service Bulletins have been complied with. All parts have been inspected and have been determined airworthy for return to service. Pertinent details of the overhaul are on file at this agency under work order No. 29089. Completed 2 Feb 2022.

Signed


Bloomsburg, Pa 17815 FAA R.S. JM2R930K

for Columbia Aircraft Services, Inc.

Old Bridge Flight School
182 Pension Rd.
Englishtown, NJ 07726

N737LY

Engine Log. Tach time 6245.9 Engine TTIS 4875.3
09/13/2021

Inspected Engine, replaced oil filter, Drained and service engine with 6 Qts. 15W/50 Oil, and ad Lycoming oil additive. Checked oil screen, checked ignition timing, Cleaned, tested and gapped spark plugs. Replaced valve cover screw on #1 cylinder.

Compression checked: #1 cyl. 60/80, #2 cyl. 60/80, #3 cyl. 72/80
#4 cyl. 70/80.

All work accomplished I/A/W Cessna and Lycoming service manual.

Engine inspected I/A/W 100 Hr. inspection and is airworthy.

Harrington H. Bishop

out of segment, log book was

Old Bridge Flight School
182 Pension Rd.
Englishtown, NJ 07726
N737LY

Engine Log. Tach time 6245.9 Engine TTIS 4875.3
09/13/2021

Inspected Engine, replaced oil filter, Drained and service engine with 6 Qts. 15W50 Oil, and ad Lycoming oil additive. Checked oil screen, checked ignition timing, Cleaned, tested and gapped spark plugs. Replaced valve cover screw on #1 cylinder.

Compression checked: #1 cyl. 60/80, #2 cyl. 60/80, #3 cyl. 72/80 #4 cyl. 70/80.

All work accomplished I/A/W Cessna and Lycoming service manual.

Engine inspected I/A/W 100 Hr. inspection and is airworthy.

Harrington H. Bishop

out of sequence, log book was

02 Feb 2022

TACH 6266.5

TSMOH O.O

Major overhaul O-320-H2AD engine S/N RL-6446-76T. Crankshaft .006 mains and .003 rods S/N 145514. Installed new Lyc camshaft P/N LW-16511 and hyd. lifters P/N 15B28093. Overhauled magneto Bendix D4RN-3000, P/N 10-682555-14 S/N 1060117. Lyc cylinders 4ea. Nickel Plated. O/H carburetor 10-5217 S/N VCO18301. Installed new starter 149 NL/EC. Engine test cell run and found satisfactory. Itemized parts list and Release Certificates are included. Mdl.O-320-H2AD S/N RL-6446-76T. Engine has been overhauled in reference to factory overhaul manual 60294-9-2. All applicable FAA AD's and Factory Service Bulletins have been complied with. All parts have been inspected and have been determined airworthy for return to service. Pertinent details of the overhaul are on file at this agency under work order No. 29089. Completed 2 Feb 2022.

Signed

[Redacted Signature]

for Columbia Aircraft Services, Inc.

Bloomsburg, Pa 17815 FAA R.S. JM2R930K