



Photo 1 – Damage to main rotor blade