

CEN22LA253

INVESTIGATION PHOTOGRAPHS



Photograph 1 - Top of engine after the accident (Courtesy of FAA)



Photograph 2 - Firewall from inside cockpit (Courtesy of FAA)



Photograph 3 - Fractured V-band clamp (Courtesy of FAA)



Photograph 4 - Engine accessory damage (Courtesy of FAA)



Photograph 5 - Airplane during recovery (Courtesy of FAA)