

NHSL Trouble Call Report

Date Reported	Time Reported	Reported By	Shift	Line	Location	Apparatus Type	Interlocking	Incident or Failure	Failed Component	Cause of Failure	Corrective Action	Notes
22-Aug-17	12:11:00 AM	S. Volz	11P-7A	NHSL	6S	SIGNAL	69TH	Signal violation and collision	N/A	Operator error	N/A	Rear-end collision in #1 platform
18-Jul-17	7:00:00 AM	M. Lam	6A-2P	NHSL	8N	SIGNAL	69TH	Dim on red	LED	Defective LED	LED replaced	
07-Jul-17	7:30:00 PM	M. Baldwin	2P-10P	NHSL	69th Yard	VETAG	69TH	No selection(s) reported	Undetermined	No trouble found	Under investigation	
07-Jun-17	6:27:00 PM	P. Walter	2P-10P	NHSL	4S	SIGNAL	69TH	Signal Violation	N/A	Operator error	N/A	
15-May-17	4:30:00 PM	R. Jackson	2P-10P	NHSL	7N	SIGNAL	69TH	Tie fire	N/A	No trouble found	Fire extinguished	
09-May-17	3:00:00 PM	M. Lam	2P-10P	NHSL	3S	VETAG	69th	No selection(s)	Lightning arrestor	Burnt lightning arrestor	Arrestor replaced	
04-May-17	6:00:00 AM	J. Ellis	6A-2P	NHSL	4 Switch	SWITCH	69th	Failed reverse	Lock Rod	Lock rod out of adjustment	Lock rod adjusted	
21-Apr-17	5:00:00 PM	D. Ross	2P-10P	NHSL	12B Switch	SWITCH	West Overbrook	Smoldering tie in area	N/A	Heaters left on	Smoldering tie extinguished	
27-Mar-17	7:40:00 AM	P. Walter	6A-2P	NHSL	6S	SIGNAL	69TH	Wrong-route violation	N/A	Operator error	N/A	Resulted in face-off
31-Jan-17	10:20:00 AM	J. Ellis	6A-2P	NHSL	1 Switch	SWITCH	69TH	Failed reverse	Lock Rod	Lock rod out of adjustment	Adjusted lock rod	
27-Dec-16	11:30:00 AM	P. Momot	6A-2P	NHSL	West Overbrook	Interlocking Control	West Overbrook	Microlok failure	Interlocking Control	Undetermined	Reset Microlok	
15-Dec-16	3:30:00 PM	P. Walter	2P-10P	NHSL	2S	SIGNAL	69TH	Signal Violation	N/A	Operator error	N/A	
11-Nov-16	7:50:00 AM	A. Scholl	6A-2P	NHSL	3N	SIGNAL	69TH	Failed to clear for one train	Undetermined	No trouble found	Under investigation	
10-Nov-16	8:20:00 AM	A. Scholl	6A-2P	NHSL	1 Switch	TRACK CIRCUIT	69TH	Track down	Heater Wire	Rail-heater wire shunting track	Wire repaired	
10-Nov-16	7:00:00 AM	J. Frisoli	7A-3P	NHSL	4A Switch	SWITCH	69TH	Switch run-through	N/A	Operator error	N/A	Bear paw replaced in switch
12-Oct-16	4:00:00 PM	M. Baldwin	2P-10P	NHSL	10B Switch	SWITCH	69TH	Failed normal	Lock Rod	Lock rod out of adjustment	Adjusted lock rod	
02-Oct-16	N/A	T. McCall	10P-6A	NHSL	A3T	TRACK CIRCUIT	69TH	Track down	CTPR	Defective CTPR	Replaced CTPR	
22-Sep-16	3:00:00 PM	M. Baldwin	2P-10P	NHSL	2T	TRACK CIRCUIT	69TH	Track down	Heater Wire	1B switch heater wires fouling circuit	Wires repositioned	