

NTSB Vehicle Photos

Schoharie, New York HWY19MH001

(19 pages)



Vehicle Photograph: 1- 2001 Ford Excursion Limousine – Overall damage view facing left front corner.



Vehicle Photograph: 2 - 2001 Ford Excursion Limousine – Overall damage view facing right front corner.



Vehicle Photograph: 3 - 2001 Ford Excursion Limousine – Image shows a spot weld joining the two frame rails.




Vehicle Photograph: 4 - 2001 Ford Excursion Limousine – Image documents the severe corrosion present on the right rear of the vehicle chassis.



Vehicle Photograph: 5 - 2001 Ford Excursion Limousine – Image shows the weld joining the extension frame rail to the original frame rail at the right front of the vehicle.



Vehicle Photograph: 6 - 2001 Ford Excursion Limousine – Image shows an opening in the floorboard due to corrosion. Interior carpet can be seen through the hole.

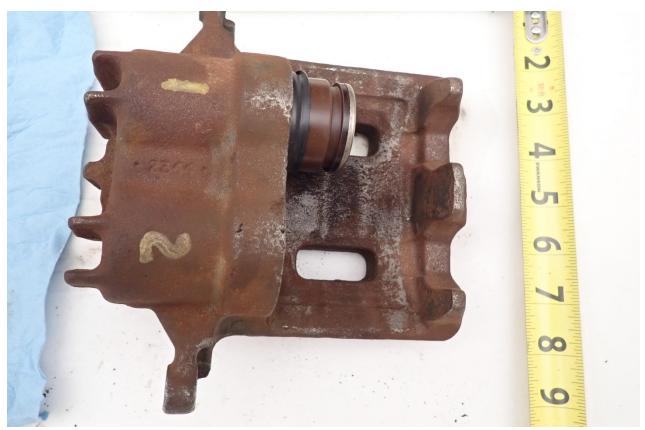

Vehicle Photograph: 7 - 2001 Ford Excursion Limousine – Left rear brake caliper showing one piston partially extruding from the piston bore.



Vehicle Photograph: 8 - 2001 Ford Excursion Limousine - Left rear brake rotor.



Vehicle Photograph: 9 - 2001 Ford Excursion Limousine - Friction surface of the left rear brake pad.



Vehicle Photograph: 10 - 2001 Ford Excursion Limousine – Image shows the backing plate of the left rear brake pad. It is in good condition and identifying markings are present.



Vehicle Photograph: 11- 2001 Ford Excursion Limousine – Image shows the right rear disc brake caliper and damage to one of the pistons.



Vehicle Photograph: 12 - 2001 Ford Excursion Limousine - Right rear brake rotor.



Vehicle Photograph: 13- 2001 Ford Excursion Limousine - Right rear brake pad friction surface.



Vehicle Photograph: 14 - 2001 Ford Excursion Limousine: - Image shows the worn condition of the right rear brake pad backing plate.



Vehicle Photograph: 15 - 2001 Ford Excursion Limousine – Image shows debris in the interior of the left front caliper piston bores.



Vehicle Photograph: 16 - 2001 Ford Excursion Limousine – Image shows the corrosion present on the left front brake rotor vent vanes.



Vehicle Photograph: 17 - 2001 Ford Excursion Limousine - Friction surface of the left front brake pad.



Vehicle Photograph: 18 - 2001 Ford Excursion Limousine – Image shows the severely deteriorated metal backing plate of the left front brake pad.



Vehicle Photograph: 19 - 2001 Ford Excursion Limousine – Image shows the interior of the right front caliper piston bore.



Vehicle Photograph: 20 - 2001 Ford Excursion Limousine – Image shows the severely corroded right front caliper piston shield.



Vehicle Photograph: 21- 2001 Ford Excursion Limousine - Right front disc brake rotor.



Vehicle Photograph: 22 - 2001 Ford Excursion Limousine - Friction surface of the right front brake pad.



Vehicle Photograph: 23- 2001 Ford Excursion Limousine - Image shows the severely deteriorated metal backing plate of the right front brake pad.



Vehicle Photograph: 24 - 2001 Ford Excursion Limousine - Damaged brake vacuum booster.



Vehicle Photograph: 25 - 2001 Ford Excursion Limousine – Damaged brake fluid reservoir.



 $\label{lem:condition} \mbox{Vehicle Photograph: 26 - 2001 Ford Excursion Limousine} - \mbox{Close-up image of the corroded steel tubing removed from the rear brake system.}$



Vehicle Photograph: 27 - 2001 Ford Excursion Limousine – Image shows a crimp in the rear hydraulic brake tubing with corrosion present.




Vehicle Photograph: 28 - 2001 Ford Excursion Limousine – Image shows a portion of the corroded steel brake tubing with a coating of brake fluid.




Vehicle Photograph: 29 - 2001 Ford Excursion Limousine - Fractured transmission main case.



Vehicle Photograph: 30 - 2001 Ford Excursion Limousine – Image shows the damaged transmission output shaft which was displaced from the vehicle during the crash.

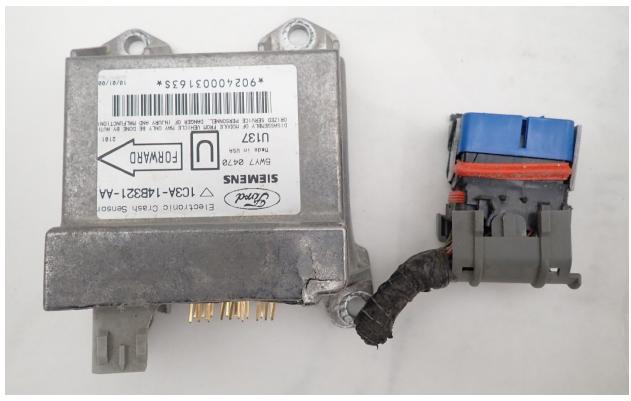

Vehicle Photograph: 31- 2001 Ford Excursion Limousine – Damaged Ford airbag control module.

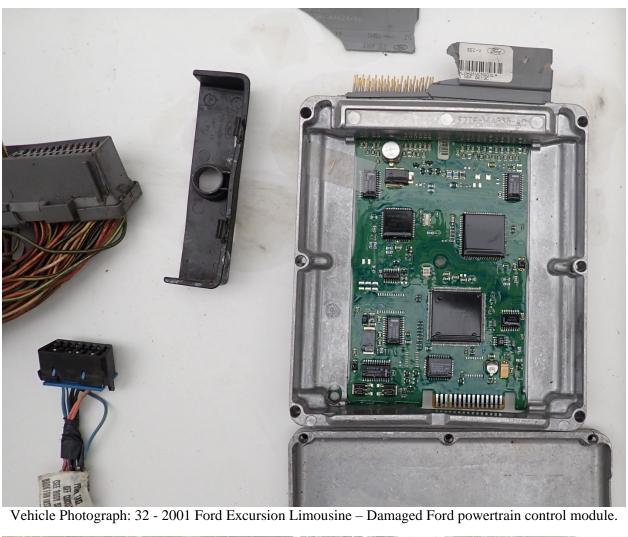



Vehicle Photograph: 33 - 2015 Toyota Highlander – Overall damage view facing the left front corner.



Vehicle Photograph: 34 - 2015 Toyota Highlander – Overall damage view facing the right rear corner.