

12 Months Locomotive Failure Repair History for BNSF 5753

Last Retrieval At: 2023-10-25|09:52

WO Typ	Open		Defect		Qualifier		Action
	Date	Station	JCD	Description	CD	Description	
DF 9	9/11/2023	ALLINE		Broken ;		J-Blocks	Repaired
				09/12/2023 00:20:48 CST (B314596) Right #5 t/m j block bolt broken off Component:Mechanical General Symptom:Other X Text Required Found bolt w as drilled crooked. Ne eds to go to drop table f or repair. Component:Mechanical General Repair A ction:Other X Text Required 09/12/2023 00:25:46 CST (X_XI_GEHTTP) Right #5 t/m j block bolt brok en off C 09/12/2023 00:20:48 CST (B314596) Right #5 t/m j block bolt broken off Component:Mechanical General Symptom:Other X Text Required Found bolt was drilled crooked. Ne eds to go to drop table for repair.Component:Mechanical GeneralRep air Action:Other X Text Required---GE Last upda te By:			
	91323	ALLINE					
				Comment : Right #5 t/m j block bolt broken off C 0 M Kittle Imann Drilled out and installed insert September 12 2023 22:37			
DF 3	8/11/2023	HOXIE	F018	Electrical Failure ;		Voltage Regulator	Repaired
				08/11/2023 07:17:36 CST (B161798) email: 8/11 00 :37 BCC Battery charge controller circuit. Unit may not charge batteries. Battery voltage at 06: 30 was 64 in Notch 5 (was 70volts before incident t logged). Unit shows to be the Remote lead of a 4/3. May have to relink to the 6213 or 5649			
	81423	ALLINE					
				Comment : email: 8/11 00:37 BCC Battery charge c R Coon T4 2 lug snapped off, lead relugged. BCC is good. A ugust 14 2023 13:59 X_XI_GEHTTP Interface I D From GE to XI See Service Sheet---GE Last up date By: August 13 2023 20:59			
DF 9	6/2/2023	FTWORT		33 Camera ;		DVR	Repaired
				06/02/2023 12:30:43 CST (S_BAT_MAM) Witronix not ification: BNSF 5753			
	71023	KANCKS					
				Comment : 33 Camera J Campbell OKFS July 10 2023 02:13			
DF 9	6/2/2023	FTWORT		44 DVR Limited: Audio Sign;		DVR	Repaired
				06/02/2023 12:30:43 CST (S_BAT_MAM) Witronix not ification: BNSF 5753			
	71023	KANCKS					
				Comment : 44 DVR Limited: Audio Signal Loss J Campbell OKF S July 10 2023 02:13			
DF 9	6/2/2023	FTWORT		26 Camera Failure (Overall;		DVR	Repaired
				06/02/2023 12:30:42 CST (S_BAT_MAM) Witronix not ification: BNSF 5753			
	71023	KANCKS					
				Comment : 26 Camera Failure (Overall Camera) J Campbell OK FS July 10 2023 02:13			
DF 9	6/2/2023	FTWORT		24 Microphone Failure (Mic;		DVR	Repaired
				06/02/2023 12:30:41 CST (S_BAT_MAM) Witronix not ification: BNSF 5753			
	71023	KANCKS					
				Comment : 24 Microphone Failure (Microphone) J Campbell OK FS July 10 2023 02:13			
DF 9	6/2/2023	FTWORT		Communication loss ;		Overall DVR	Repaired
				06/02/2023 12:30:41 CST (S_BAT_MAM) Witronix not ification: BNSF 5753			
	71023	KANCKS					
				Comment : Communication loss J Dorsett Reset Witronix syst em July 10 2023 00:50			
DF 9	6/2/2023	FTWORT		26 Camera Failure (Overall;		Camera #1	Repaired
				06/02/2023 12:30:42 CST (S_BAT_MAM) Witronix not ification: BNSF 5753			
	71023	KANCKS					
				Comment : 26 Camera Failure (Overall Camera) J Campbell OK FS July 10 2023 02:12			
DF 9	6/2/2023	FTWORT		26 Camera Failure (Overall;		Camera #2	Repaired
				06/02/2023 12:30:42 CST (S_BAT_MAM) Witronix not ification: BNSF 5753			
	71023	KANCKS					
				Comment : 26 Camera Failure (Overall Camera) J Campbell OK FS July 10 2023 02:12			
DF 9	5/11/2023	INTERB	F013	Low/Loss Pressure ;		Oil	Repaired
				05/11/2023 09:33:00 CST (X_XI_MAMHTTP) ENGINE OI L IS AT THE "ADD" MARK ON THE DIPSTICK			
	51423	HAVRE					
				Comment : ENGINE OIL IS AT THE "ADD" MARK ON THE D B Schmidtk e CRAFT COMPLETED May 14 2023 20:13 M Jappe changed oil and filters for water in oil Ma y 14 2023 20:35			
DF 2	5/6/2023	SSEATT	F014	Leak ;		Fuel Line	Repaired
				05/07/2023 00:21:55 CST (B164529) oil and fuel o n walkway, crew reporting an active leak from un known location. meo			
	51423	HAVRE					
				Comment : fuel leak B Schmidtk e CRAFT COMPLETED May 14 202 3 22:40 M Jappe replaced L-1 head May 14 2 023 22:33			
DF 8	5/6/2023	SSEATT	F006	Oily ;		9 WALKWAY/PLATFORM	Repaired
				05/07/2023 00:22:25 CST (B164529) oil and fuel o n walkway, crew reporting an active leak from un known location. meo			
	51423	HAVRE					
				Comment : oil B Schmidtk e CRAFT COMPLETED May 14 2023 20:1 3 M Jappe changed oil and filters May 14 2 023 20:34 A Hungerford oil draining. COLD & water in oil. May 13 2023 23:13			
DF 9	4/14/2023	NEWWES	F004	No Heat ;		Cab Heaters	Repaired
				04/14/2023 14:24:41 CST Interface ENGINEER SIDE WALL HEATER B/O			
	51423	HAVRE					
				Comment : ENGINEER SIDE WALL HEATER B/O B Schmidtk e CRAFT COMPLETED May 14 2023 18:42 M Spinler Repai red May 13 2023 22:01			
DF 9	3/29/2023	PASCO	F013	High Inhibitor ;			Repaired
				03/29/2023 08:53:37 CST Interface At next shopp ing - drain, refill coolant ----- 04/11/2023 11:09:42 CST Int erface Duplicate symptom reported At next shopp ing - drain, refill coolant			
	51423	HAVRE					
				Comment : At next shopping - drain, refill coolant B Schmidtk e CRAFT COMPLETED May 14 2023 18:43			
DF I	3/8/2023	FTWORT	F026	PAST DUE FRQ ;			Repaired
				31523 NORTHHT			
				Comment : BNSF 5753 FRQ Inspection FRQ with ERI			
DF I	3/8/2023	FTWORT	F026	PAST DUE HAND BRAKE ;			Repaired
				31523 NORTHHT			
				Comment : BNSF 5753 Hand Brake Insp Hand Bra R Polk ok Mar ch 14 2023 05:46			
DF I	3/8/2023	FTWORT	F003	PAST DUE FAI ;			Repaired
				31523 NORTHHT			
				Comment : BNSF 5753 ERCP Insp ERCP Change Ou R Haberer ob bed er portion from 6223 to install on 5753 Marc h 14 2023 08:32 B Stephens out of stock Mar ch 14 2023 01:43			

DF I	3/8/2023	FTWORT	F003	PAST DUE FAI ;			Repaired
	31523	NORTHHT					
	Comment : BNSF 5753 13CP Insp 13CP Change Ou						
DF 9	3/8/2023	FTWORT	F003	PAST DUE AFM ;			Repaired
	31523	NORTHHT					
	Comment : BNSF 5753 AFM Insp AFM Inspection J VanBrunt Due 03/07/2023 March 13 2023 20:56						
DF I	3/8/2023	FTWORT	F003	PAST DUE FAI ;			Repaired
	31523	NORTHHT					
	Comment : BNSF 5753 DBTV Insp DBTV Change Ou						
DF 9	1/4/2023	PULLTX	F013	Missing ;		Oil	Repaired
	Due Comment : 01/04/2023 01:28:39 CST Michael Hatter (B028159) NEEDS OIL						
	11023	ALLINE					
	Comment : LOW OIL T Giles came to us with the oil level fu ll good to go. January 10 2023 17:55						
DF 9	1/4/2023	PULLTX	F004	Loose ;		Cab Insulation	Repaired
	Due Comment : 01/04/2023 01:31:27 CST Michael Hatter (B028159) CAB CEILING NEEDS REPAIRS						
	11023	ALLINE					
	Comment : CAB CEILING R Rohnke Repaired January 10 2023 18 :47						
DF 9	11/27/2022	FTWORT		29 No Communication with D;		DVR	Duplicate
	Due Comment : 11/27/2022 20:00:33 CST Mechanical batch ID (S_B AT_MAM) Witronix notification: BNSF 5753						
	12022	FTWORT					
DF 9	11/25/2022	FTWORT	F014	60 Fuel Level invalid ;		WITRONIX FUEL SENSOR DEFECT	Duplicate
	Due Comment : 11/25/2022 18:30:36 CST Mechanical batch ID (S_B AT_MAM) Witronix notification: BNSF 5753						
	12022	FTWORT					
DF 9	10/25/2022	WICFAL	F004	;		Toilet (VTR)	Repaired
	Due Comment : 10/25/2022 13:45:28 CST Interface B176166 WICFA L CAB CONDITION DEFECT REPORTED BY CREW Trouble Code: TOILET						
	102722	ALLINE					
	Comment : CAB CONDITION DEFECT REPORTED BY CREW AD A Brans titer sfs October 27 2022 17:49						