



# Aviation Investigation Factual Report

<b>Location:</b>	Unalaska, Alaska	<b>Accident Number:</b>	ANC08FA050
<b>Date &amp; Time:</b>	April 9, 2008, 16:30 Local	<b>Registration:</b>	N741
<b>Aircraft:</b>	Grumman G-21A	<b>Aircraft Damage:</b>	Substantial
<b>Defining Event:</b>	Collision with terr/obj (non-CFIT)	<b>Injuries:</b>	1 Serious, 8 Minor
<b>Flight Conducted Under:</b>	Part 135: Air taxi & commuter - Scheduled		

## Factual Information

### HISTORY OF FLIGHT

On April 9, 2008, about 1630 Alaska daylight time, an amphibious Grumman G-21A airplane, N741, received substantial damage when it collided with a trailer van while on approach to Runway 30 at the Unalaska Airport, Unalaska, Alaska. The airplane was operated by Peninsula Airways, Inc., Anchorage, Alaska. The flight was conducted under Title 14, CFR Part 135, as scheduled commuter Flight 325, when the accident occurred. Of the nine people on board, the airline transport pilot and seven passengers sustained minor injuries, and one passenger sustained serious injuries. The flight originated at the Akutan Sea Plane Base, Akutan, Alaska, about 1615, and was en route to Unalaska. Company flight following procedures were in effect.

Airplanes landing at the Unalaska Airport on Runway 30 pass low over Ballyhoo Road before reaching the approach threshold of the runway. Ballyhoo Road provides the only access between the city of Unalaska and the city dock facility, north of the Unalaska Airport. Trucks transporting large container vans between the trailer yard and the city dock facility routinely use the road. There are two remotely controlled gates with warning lights on each side the runway threshold designed to block vehicle traffic while airplanes are landing on Runway 30. When the gate and warning light system is activated, the runway end identifier lights (REIL) are also supposed to be activated. Prior to landing, pilots are instructed to activate the remotely controlled gate and warning light system.

During a telephone interview with the National Transportation Safety Board (NTSB) investigator-in-charge (IIC) on April 10, the truck driver reported that he was transporting a 45-foot long by 13-foot tall trailer van from the Horizon Lines trailer yard to the city dock facility. He said that as he approached the part of the road where it crossed under the approach path of Runway 30, he saw that the warning lights were flashing, but the gates were not closed, so he stopped the truck to wait for the warning lights to go out. After waiting for about 45 seconds, the driver looked to see if he could see any landing traffic, but he did not see any. He reported that with the red lights still flashing, he drove onto the road in front of the threshold.

Shortly after passing the flashing warning lights, he heard a loud bang and the truck rocked to the left. He then saw the airplane collide with the runway on the left side of his truck.

The truck driver noted that he had worked in Unalaska for only 4 months, but during that time, the traffic gates at that intersection had never worked. Additionally, he said that the flashing warning lights would routinely activate with no arriving traffic, and remain activated, which would block traffic for long periods of time.

According to the Unalaska police officer assigned to the accident case, the accident truck

driver did not have a valid driver's license. Also, his commercial driver's license (CDL) was suspended.

During an interview with the NTSB IIC on April 11, the accident pilot said that as he started his initial approach to Runway 30, he activated the remotely controlled traffic warning devices as required. He said that as he flew towards Runway 30, he could see the REIL strobe lights, which are simultaneously activated when the gate and warning light system on the road is activated. Concurrently, he said he could see a large truck and trailer rig stopped at the intersection, adjacent to the southern traffic gate. During the approach, the pilot continued to watch the truck to be sure that it did not start moving. He then configured the airplane for landing by lowering the airplane's landing gear and flaps, and then completed his final prelanding checklist. The pilot said that as the airplane approached the runway threshold, he realized that the truck was now moving, and it was well onto the road in front of the threshold area. He applied full engine power in an attempt to go-around, but as the airplane began to climb, the nose of the airplane pitched up slightly, and the aft section of the airplane's belly and empennage struck the top of the trailer van.

The pilot said that immediately after the initial collision, he had no elevator control, and the airplane descended uncontrollably, nose down. It collided with the surface of the runway, and slid for several hundred feet.

The NTSB IIC asked the accident pilot if he used the visual approach slope indicator systems (VASI) while landing on runway 30. The pilot explained that at the time of the accident he was not using the VASI because he was attempting to shorten his ground roll after landing in order to avoid an unfavorable crosswind condition further down Runway 30.

The NTSB IIC asked the accident pilot if he was aware that the gates were out of service. The pilot said that he was aware that the gates had not been working for a long time.

The pilot reported that there were no preaccident mechanical anomalies with the airplane.

## PERSONNEL INFORMATION

### Pilot Information

The pilot held an airline transport pilot certificate with airplane multiengine land and sea ratings. He also held commercial pilot privileges with airplane single-engine land and sea ratings. His most recent first-class medical certificate was issued November 28, 2008, and contained the limitation that he must wear correcting lenses.

According to the NTSB Pilot/Operator Aircraft Accident Report (NTSB Form 6120.1) submitted by Peninsula Airways, dated April 15, 2008, the pilot's total flight time was 7,040 hours, of which 320 were in the accident airplane make and model, and 2,532 in multiengine airplanes. In the preceding 90 and 30 days prior to the accident, the report noted that in the 30 days

before the accident, the pilot flew about 9 hours. His flight time in the previous 90 days was about 22 hours. His most recent airman competency/proficiency check (CFR Part 135.293) check ride was on May 30, 2007, and a company check airman administered the check ride in the same make and model as the accident airplane.

#### AIRCRAFT INFORMATION

The airplane was equipped with two Pratt & Whitney R985-AN-14B radial engines, each rated at 450 horsepower.

The airplane's maximum gross weight was 9,200 pounds, and the estimated gross weight at the time of the accident was 8,833 pounds, or 367 pounds below its maximum gross weight.

The airplane was not equipped with a cockpit voice recorder, or a flight data recorder.

The airplane was maintained under the operator's Approved Aircraft Inspection Program (AAIP), which requires inspections to be performed approximately every 50 and 100 flight hours. The airplane had accumulated 12,228 hours in service at the time of the accident, and 10.2 flight hours had elapsed since the most recent "A" check inspection.

#### METEOROLOGICAL INFORMATION

The closest official weather observation station is located at the Unalaska Airport. At 1616, an Aviation Routine Weather Report (METAR) was reporting, in part: Wind, 30 degrees (true) at 9 knots with gusts to 15 knots; visibility, 10 statute miles; clouds and sky condition, 2,200 feet overcast; temperature, 30 degrees F; dew point, 21 degrees F; altimeter, 29.98 inHg.

#### COMMUNICATIONS

Review of the air-ground radio communications tapes maintained by the FAA at the Kenai Automated Flight Service Station (AFSS), revealed that as the accident flight neared the Unalaska Airport, about 3 minutes before the accident, the pilot announced his intentions to land on Runway 30 over the airport's Common Traffic Advisory Frequency (CTAF) on 122.6. The pilot then keyed his radio microphone 7-times, to activate the remotely controlled vehicle gate and warning light system.

No further radio communications were recorded from the accident airplane.

#### AERODROME AND GROUND FACILITIES

The Unalaska Airport is owned and operated by the State of Alaska, and certificated in accordance with Title 14, CFR Part 139. CFR Part 139 contains rules governing the certification and operation of airports in the United States with scheduled passenger carrying operations.

The airport has a single hard-surfaced runway, on a 120/300 degree magnetic orientation on Amaknak Island. Both runway ends have a 100-foot displaced threshold. Runway 30 is 3,900 feet long by 100 feet wide, and is positioned along the edge of Mount Ballyhoo that rises to 1,650 feet north of the airport. The airport is served by two nonprecision instrument approach procedures, an NDB and a GPS approach, with high intensity runway lights, runway end identifier lights (REIL), and a VASI.

As noted, near the threshold of Runway 30, there are two remotely controlled gates with warning lights on each side the runway threshold designed to block vehicle traffic while airplanes are landing on Runway 30. Procedures for landing on Runway 30 are outlined in the Airport Facility Directory (AFD), Alaska Supplement, which states, in part: "Stop light for vehicle traffic crossing Runway 30 threshold must be activated and deactivated for each aircraft operation over the threshold" and "...stop light for vehicle traffic crossing Runway 30 threshold, key 122.6 7 times for on, 3 times for stop light and REIL off." The AFD also recommends that aircraft cross the threshold at a minimum height of 25 feet.

According to documentation provided by the State of Alaska, the remotely controlled gate system was originally installed in 1994. During a telephone conversation with the NTSB IIC on April 10, the State of Alaska's Regional Safety and Security Officer reported that the gates have been out of service for more than a year due to budgetary constraints, as well as pending equipment upgrades, which will entail moving both gates to different sites on Ballyhoo Road.

An NTSB airports specialist reviewed current and historical inspection data provided by the State of Alaska, and the Alaska Region FAA Airports Division, which revealed the following:

#### State of Alaska

According to the State of Alaska's Regional Safety and Security Officer, airport personnel conduct daily inspections of the airport environment prior to the airport's first flight of the day. Any discrepancy or corrective actions are noted on the "Airport Condition Report" form. If outside agencies need to be notified of the discrepancy, notification is made and the date is noted on the form. If corrective action is made, it is noted on the form when the discrepancy was corrected. The State of Alaska's Regional Safety and Security Officer reported that her review of the airport's archived condition reports revealed no mention of the inoperative gates system, or any attempted corrective action within the last 10 years.

According to the Unalaska Airport Certification Manual (ACM), the Airport Manager is responsible for the "development of operational procedures for inspection, maintenance, and repair of airport facilities to ensure safe aircraft operations." The ACM specified the airport safety areas would be "inspected during each scheduled periodic inspection and any non-complying condition noted during the inspection would be corrected as soon as possible if resources are available at the airport."

The ACM further states that the Airport Manager is responsible for "publishing through a

Notice to Airmen (NOTAM) or other publications, all hazardous conditions or the potential of hazardous conditions of airport management is aware." At the time of the accident there were no NOTAMs or advisories in effect warning pilots that the gate system was inoperative.

#### FAA Airports Division

A 10-year review of annual, FAA, CFR 139 certification and compliance inspection forms revealed no mention of any discrepancy for the inoperative gates system at the Unalaska Airport.

On April 25, 2008, 16 days after the accident, the FAA noted two discrepancies concerning the inoperable roadway gate system citing public protection 139.335(a)(1); safeguards to prevent inadvertent entry to the movement area by unauthorized persons or vehicles. That entry states, in part: "Gates are inoperative and fencing is inadequate to prevent inadvertent access to the aircraft movement and safety areas for runway 12-30. Also, no formal procedures exist in the ACM for operating, securing, and maintaining gates when authorization is delegated by the airport authority to other designated representatives."

"Failure of the airport authority to take appropriate action to notify the FAA of reported incidents by the public of pilot deviations such as aircraft buzzing pedestrian/vehicle traffic on the perimeter road to the approach end of Runway 30; cargo aircraft landing without activating the red flashing traffic lights while on final approach to runway 30; and aircraft flying below the recommended threshold crossing height of 25 feet for runway 30; thus jeopardizing the safety of the public and airport personnel on the ground at DUT."

The FAA inspection record states that the above discrepancies would be corrected by September 2008.

The NTSB airport specialist's report is included in the public docket for this accident.

#### WRECKAGE AND IMPACT INFORMATION

The NTSB IIC arrived in Unalaska on April 23, 2008, after the airplane wreckage had been recovered to the operator's maintenance facility, and the trailer van had been removed.

According to photographs and on scene documentation provided by the Unalaska Police Department, all of the airplane's major components were found at the accident site.

After the initial collision with the trailer van, the airplane descended uncontrollably, nose down, and collided with the runway about 322 feet from the trailer van. The airplane's main landing gear collapsed, and the wreckage continued to slide for an additional 560 feet on the paved, dry runway. The airplane's wreckage came to rest on the right side of the runway, with the main fuselage oriented on a 70 degree heading. All headings/bearings noted in this report are magnetic.

Debris consisting of small pieces of plexiglas, aluminum, a door frame assembly, and various landing gear components, were noted in the debris path between the trailer van and the main wreckage site.

Both wings remained attached to the main fuselage attach points. The right wing sustained damage to the outboard portion, and the left wing sustained minor damage.

The main cockpit/cabin area of the fuselage was extensively crushed and distorted. The primary crush zone encompassed the cockpit and front seat passenger area, extending aft into the passenger cabin area. The fuselage was buckled and folded, and the empennage was buckled upward.

The underside portion of the airplane's amphibious hull was crushed upward and inward, and the nose was distorted upward. The aft and underside portion of the airplane's amphibious hull was crushed and torn open, which exposed the crushed elevator control push-pull tubes.

No preaccident mechanical anomalies were discovered during the IIC's wreckage exam.

#### ADDITIONAL INFORMATION

During a telephone conversation with the NTSB IIC on April 9, 2009, the State of Alaska, Department of Transportation, Southwest District Superintendent reported that construction of the new gate system was completed on November 9, 2008, and the new gate system is fully operational.

Additionally, effective March 12, 2009, the FAA published updated arrival and departure procedures for the Unalaska Airport in the AFD, Alaska Supplement, which states, in part: "\*\*\*\*\*DANGER\*\*\*\*\* There is a road crossing the approach of RWY 30. Warning System and Gates must be activated. The gates are controlled by Pilot Controlled Lighting (PCL) on frequency 122.6 (CTAF). This frequency controls the REILS, MIRLS, and the gates."

A complete copy of the updated procedures published in March 12, 2009 AFD is included in the public docket of this accident.

#### WRECKAGE RELEASE

The Safety Board released the wreckage to the owner's representatives, at the accident airport, on April 23, 2008. The Safety Board retained no parts or components.

## Pilot Information

<b>Certificate:</b>	Airline transport	<b>Age:</b>	37,Male
<b>Airplane Rating(s):</b>	Single-engine land; Single-engine sea; Multi-engine land; Multi-engine sea	<b>Seat Occupied:</b>	Left
<b>Other Aircraft Rating(s):</b>		<b>Restraint Used:</b>	
<b>Instrument Rating(s):</b>	Airplane	<b>Second Pilot Present:</b>	No
<b>Instructor Rating(s):</b>	Airplane single-engine	<b>Toxicology Performed:</b>	No
<b>Medical Certification:</b>	Class 1 Without waivers/limitations	<b>Last FAA Medical Exam:</b>	November 28, 2008
<b>Occupational Pilot:</b>	Yes	<b>Last Flight Review or Equivalent:</b>	May 30, 2007
<b>Flight Time:</b>	7040 hours (Total, all aircraft), 320 hours (Total, this make and model), 6500 hours (Pilot In Command, all aircraft), 22 hours (Last 90 days, all aircraft), 9 hours (Last 30 days, all aircraft), 5 hours (Last 24 hours, all aircraft)		

## Aircraft and Owner/Operator Information

<b>Aircraft Make:</b>	Grumman	<b>Registration:</b>	N741
<b>Model/Series:</b>	G-21A	<b>Aircraft Category:</b>	Airplane
<b>Year of Manufacture:</b>		<b>Amateur Built:</b>	
<b>Airworthiness Certificate:</b>	Normal	<b>Serial Number:</b>	B-97
<b>Landing Gear Type:</b>	Tailwheel	<b>Seats:</b>	10
<b>Date/Type of Last Inspection:</b>	March 25, 2008 AAIP	<b>Certified Max Gross Wt.:</b>	9200 lbs
<b>Time Since Last Inspection:</b>	10 Hrs	<b>Engines:</b>	2 Reciprocating
<b>Airframe Total Time:</b>	12228 Hrs at time of accident	<b>Engine Manufacturer:</b>	Pratt & Whitney
<b>ELT:</b>	C91 installed, activated, did not aid in locating accident	<b>Engine Model/Series:</b>	R985
<b>Registered Owner:</b>	Peninsula Airways, Inc.	<b>Rated Power:</b>	450 Horsepower
<b>Operator:</b>	Peninsula Airways, Inc.	<b>Operating Certificate(s) Held:</b>	Commuter air carrier (135), On-demand air taxi (135)



## Meteorological Information and Flight Plan

<b>Conditions at Accident Site:</b>	Visual (VMC)	<b>Condition of Light:</b>	Day
<b>Observation Facility, Elevation:</b>	PADU, 22 ft msl	<b>Distance from Accident Site:</b>	
<b>Observation Time:</b>	16:16 Local	<b>Direction from Accident Site:</b>	
<b>Lowest Cloud Condition:</b>		<b>Visibility</b>	10 miles
<b>Lowest Ceiling:</b>	Overcast / 2200 ft AGL	<b>Visibility (RVR):</b>	
<b>Wind Speed/Gusts:</b>	9 knots / 15 knots	<b>Turbulence Type Forecast/Actual:</b>	/
<b>Wind Direction:</b>	300°	<b>Turbulence Severity Forecast/Actual:</b>	/
<b>Altimeter Setting:</b>	29.88 inches Hg	<b>Temperature/Dew Point:</b>	-1°C / -6°C
<b>Precipitation and Obscuration:</b>			
<b>Departure Point:</b>	Akutan, AK (KQA )	<b>Type of Flight Plan Filed:</b>	VFR
<b>Destination:</b>	Unalaska, AK (DUT )	<b>Type of Clearance:</b>	None
<b>Departure Time:</b>	16:15 Local	<b>Type of Airspace:</b>	

## Airport Information

<b>Airport:</b>	Unalaska Airport PADU	<b>Runway Surface Type:</b>	Asphalt
<b>Airport Elevation:</b>	22 ft msl	<b>Runway Surface Condition:</b>	Dry
<b>Runway Used:</b>	30	<b>IFR Approach:</b>	Visual
<b>Runway Length/Width:</b>	3900 ft / 100 ft	<b>VFR Approach/Landing:</b>	Full stop

## Wreckage and Impact Information

<b>Crew Injuries:</b>	1 Minor	<b>Aircraft Damage:</b>	Substantial
<b>Passenger Injuries:</b>	1 Serious, 7 Minor	<b>Aircraft Fire:</b>	None
<b>Ground Injuries:</b>	N/A	<b>Aircraft Explosion:</b>	None
<b>Total Injuries:</b>	1 Serious, 8 Minor	<b>Latitude, Longitude:</b>	53.900276,-166.53334(est)

## Administrative Information

<b>Investigator In Charge (IIC):</b>	Johnson, Clinton
<b>Additional Participating Persons:</b>	Donald W Duncan; Federal Aviation Administration (Operations); Anchorage, AK Bryan Carricaburu; Peninsula Airways, Inc. ; Anchorage , AK
<b>Report Date:</b>	June 2, 2009
<b>Last Revision Date:</b>	
<b>Investigation Class:</b>	<a href="#">Class</a>
<b>Note:</b>	The NTSB traveled to the scene of this accident.
<b>Investigation Docket:</b>	<a href="https://data.nts.gov/Docket?ProjectID=67801">https://data.nts.gov/Docket?ProjectID=67801</a>

The National Transportation Safety Board (NTSB) is an independent federal agency charged by Congress with investigating every civil aviation accident in the United States and significant events in other modes of transportation—railroad, transit, highway, marine, pipeline, and commercial space. We determine the probable causes of the accidents and events we investigate, and issue safety recommendations aimed at preventing future occurrences. In addition, we conduct transportation safety research studies and offer information and other assistance to family members and survivors for each accident or event we investigate. We also serve as the appellate authority for enforcement actions involving aviation and mariner certificates issued by the Federal Aviation Administration (FAA) and US Coast Guard, and we adjudicate appeals of civil penalty actions taken by the FAA.

The NTSB does not assign fault or blame for an accident or incident; rather, as specified by NTSB regulation, “accident/incident investigations are fact-finding proceedings with no formal issues and no adverse parties ... and are not conducted for the purpose of determining the rights or liabilities of any person” (Title 49 *Code of Federal Regulations* section 831.4). Assignment of fault or legal liability is not relevant to the NTSB’s statutory mission to improve transportation safety by investigating accidents and incidents and issuing safety recommendations. In addition, statutory language prohibits the admission into evidence or use of any part of an NTSB report related to an accident in a civil action for damages resulting from a matter mentioned in the report (Title 49 *United States Code* section 1154(b)). A factual report that may be admissible under 49 *United States Code* section 1154(b) is available [here](#).