



Aviation Investigation Factual Report

Location:	Rockdale, Texas	Accident Number:	CEN14LA253
Date & Time:	May 26, 2014, 16:40 Local	Registration:	N188DP
Aircraft:	Beech A36	Aircraft Damage:	Substantial
Defining Event:	Loss of engine power (total)	Injuries:	4 None
Flight Conducted Under:	Part 91: General aviation - Personal		

Factual Information

On May 26, 2014, about 1840 central daylight time, a Beech A36, N188DP, was substantially damaged when the engine lost power and the pilot made a forced landing on a road near Rockdale, Texas. The pilot and three passengers on board were not injured. The airplane was registered to and operated by Pilots Choice Aviation, Inc., Georgetown Texas, under the provisions of 14 Code of Federal Regulations Part 91 as a personal flight. Visual meteorological conditions prevailed at the time of the accident, and an instrument flight rules flight plan had been filed. The flight originated from Huntsville Municipal Airport (KUTS), Huntsville, Texas, at 1825, and was en route to Georgetown Municipal Airport (KGTU), Georgetown, Texas.

According to the pilot's statements, both main fuel tanks were filled to capacity, but the auxiliary tanks were not serviced. The first leg of the flight from New Orleans, Louisiana, to Huntsville, Texas, was uneventful. The pilot elected to go to Huntsville due to the weather conditions in the Austin, Texas, area. After spending several hours at Huntsville, the pilot and his family departed for Georgetown. About 20 minutes into the flight, the engine made "an abrupt change in sound" and the engine began to lose power. All cylinder EGTs (exhaust gas temperature) were above 1500 degrees Celsius (C.) Switching from the right tank to the left tank did not restore power, so the pilot returned the selector to the right tank. The pilot advanced the mixture, throttle, and propeller control full forward and noticed the cylinder EGTs were registering 200 degrees. He advised air traffic control that his engine was losing power and was given radar vectors to the H.H. Coffield Regional Airport (KRCK), about 4 miles southwest of the flight's position. The pilot subsequently declared an emergency. Unable to glide to the runway, the pilot made a forced landing on uneven terrain near County Road 322. The right main landing gear did not extend fully prior to touch down and the airplane ground looped. The fuselage was buckled and the outboard portion of the right wing was torn off.

Under the auspices of the National Transportation Safety Board, the engine was functionally tested at Air Salvage of Dallas in Lancaster, Texas, on July 21. The engine tested satisfactory at all power settings and no anomalies were noted.

Pilot Information

Certificate:	Private	Age:	47
Airplane Rating(s):	Single-engine land	Seat Occupied:	Left
Other Aircraft Rating(s):	None	Restraint Used:	3-point
Instrument Rating(s):	Airplane	Second Pilot Present:	No
Instructor Rating(s):	None	Toxicology Performed:	No
Medical Certification:	Class 3 With waivers/limitations	Last FAA Medical Exam:	October 17, 2012
Occupational Pilot:	No	Last Flight Review or Equivalent:	September 24, 2013
Flight Time:	513 hours (Total, all aircraft), 139 hours (Total, this make and model), 436 hours (Pilot In Command, all aircraft), 33 hours (Last 90 days, all aircraft), 8 hours (Last 30 days, all aircraft)		

Aircraft and Owner/Operator Information

Aircraft Make:	Beech	Registration:	N188DP
Model/Series:	A36	Aircraft Category:	Airplane
Year of Manufacture:	1979	Amateur Built:	
Airworthiness Certificate:	Normal	Serial Number:	E-1476
Landing Gear Type:	Retractable - Tricycle	Seats:	6
Date/Type of Last Inspection:	February 1, 2014 Annual	Certified Max Gross Wt.:	3600 lbs
Time Since Last Inspection:		Engines:	1 Reciprocating
Airframe Total Time:	5360 Hrs	Engine Manufacturer:	Continental
ELT:	Installed, activated	Engine Model/Series:	IO-520-BB87
Registered Owner:	PILOTS CHOICE AVIATION INC	Rated Power:	285 Horsepower
Operator:	PILOTS CHOICE AVIATION INC	Operating Certificate(s) Held:	None
Operator Does Business As:		Operator Designator Code:	PLCA

Meteorological Information and Flight Plan

Conditions at Accident Site:	Visual (VMC)	Condition of Light:	Day
Observation Facility, Elevation:	GTU,790 ft msl	Distance from Accident Site:	41 Nautical Miles
Observation Time:	17:25 Local	Direction from Accident Site:	270°
Lowest Cloud Condition:		Visibility	10 miles
Lowest Ceiling:	Broken / 9500 ft AGL	Visibility (RVR):	
Wind Speed/Gusts:	6 knots / None	Turbulence Type Forecast/Actual:	/ None
Wind Direction:	120°	Turbulence Severity Forecast/Actual:	/
Altimeter Setting:	29.95 inches Hg	Temperature/Dew Point:	23°C / 17°C
Precipitation and Obscuration:			
Departure Point:	Huntsville, TX (KUTS)	Type of Flight Plan Filed:	None
Destination:	Georgetown, TX (KGTU)	Type of Clearance:	VFR flight following
Departure Time:	18:25 Local	Type of Airspace:	Class E

Airport Information

Airport:	H.H. Coffield Regional KRCK	Runway Surface Type:	
Airport Elevation:	474 ft msl	Runway Surface Condition:	Unknown
Runway Used:		IFR Approach:	None
Runway Length/Width:		VFR Approach/Landing:	Forced landing

Wreckage and Impact Information

Crew Injuries:	1 None	Aircraft Damage:	Substantial
Passenger Injuries:	3 None	Aircraft Fire:	None
Ground Injuries:	N/A	Aircraft Explosion:	None
Total Injuries:	4 None	Latitude, Longitude:	30.650928,-96.999221(est)

Administrative Information

Investigator In Charge (IIC):	Scott, Arnold
Additional Participating Persons:	Matthew D Wetzel; FAA Flight Standards District Office; Houston, TX
Report Date:	March 4, 2015
Last Revision Date:	
Investigation Class:	Class
Note:	
Investigation Docket:	https://data.nts.gov/Docket?ProjectID=89282

The National Transportation Safety Board (NTSB) is an independent federal agency charged by Congress with investigating every civil aviation accident in the United States and significant events in other modes of transportation—railroad, transit, highway, marine, pipeline, and commercial space. We determine the probable causes of the accidents and events we investigate, and issue safety recommendations aimed at preventing future occurrences. In addition, we conduct transportation safety research studies and offer information and other assistance to family members and survivors for each accident or event we investigate. We also serve as the appellate authority for enforcement actions involving aviation and mariner certificates issued by the Federal Aviation Administration (FAA) and US Coast Guard, and we adjudicate appeals of civil penalty actions taken by the FAA.

The NTSB does not assign fault or blame for an accident or incident; rather, as specified by NTSB regulation, “accident/incident investigations are fact-finding proceedings with no formal issues and no adverse parties ... and are not conducted for the purpose of determining the rights or liabilities of any person” (Title 49 *Code of Federal Regulations* section 831.4). Assignment of fault or legal liability is not relevant to the NTSB’s statutory mission to improve transportation safety by investigating accidents and incidents and issuing safety recommendations. In addition, statutory language prohibits the admission into evidence or use of any part of an NTSB report related to an accident in a civil action for damages resulting from a matter mentioned in the report (Title 49 *United States Code* section 1154(b)). A factual report that may be admissible under 49 *United States Code* section 1154(b) is available [here](#).