

LOG # LF26 ^{SDG} ^{RTS 10-7-96}

TARGET # _____

COORD: LAT 40 39 50.14

LONG 72 37 27.24


Green Tag # ~~C255~~ C255

DEBRIS FIELD #1 Green
(Far)

REFER METALLURGY GROUP NOTES

LHS Aft Body Skin, S-8L → 24L, STA 2285 → 2360.

Body skin panel section includes Y ring at STA 2360 and several small portions of empennage structure as shown on next page. Upper fracture surface of Y ring is shown below. Fails through Y ring fastener holes at/near stringer attach.

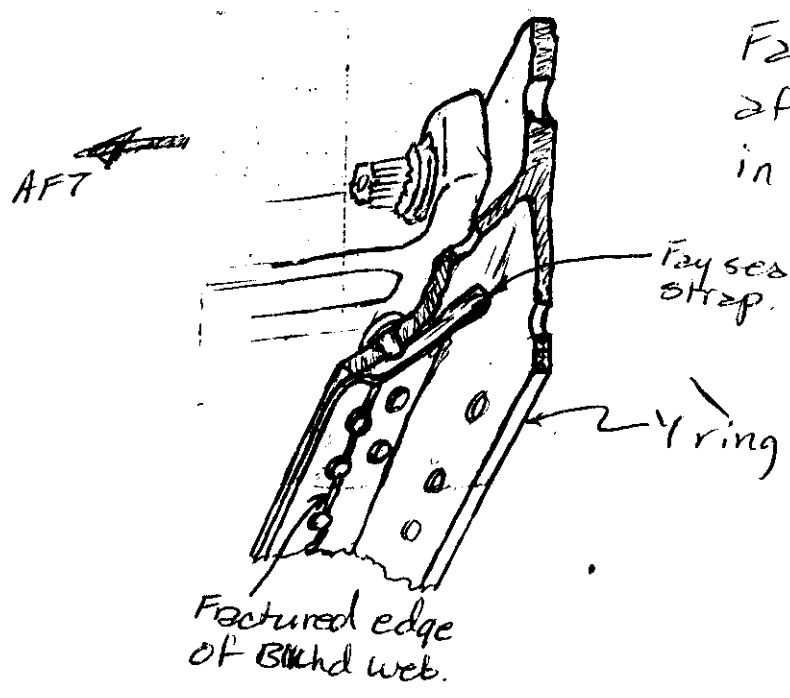


Fastener common to aft leg of Y ring remain in place with Bkhd web failed at aft-most row. At this location the failure of the web is coincident with the end of a fay sealed strap between the web and chord.

There is no evidence of fire damage or sooting in this area.


S. Chisholm 8/12/96
Neil Scovell TWA-10-6-96
R. ... IAA 10-25-96
John ... FAA 10-22-96

LF26

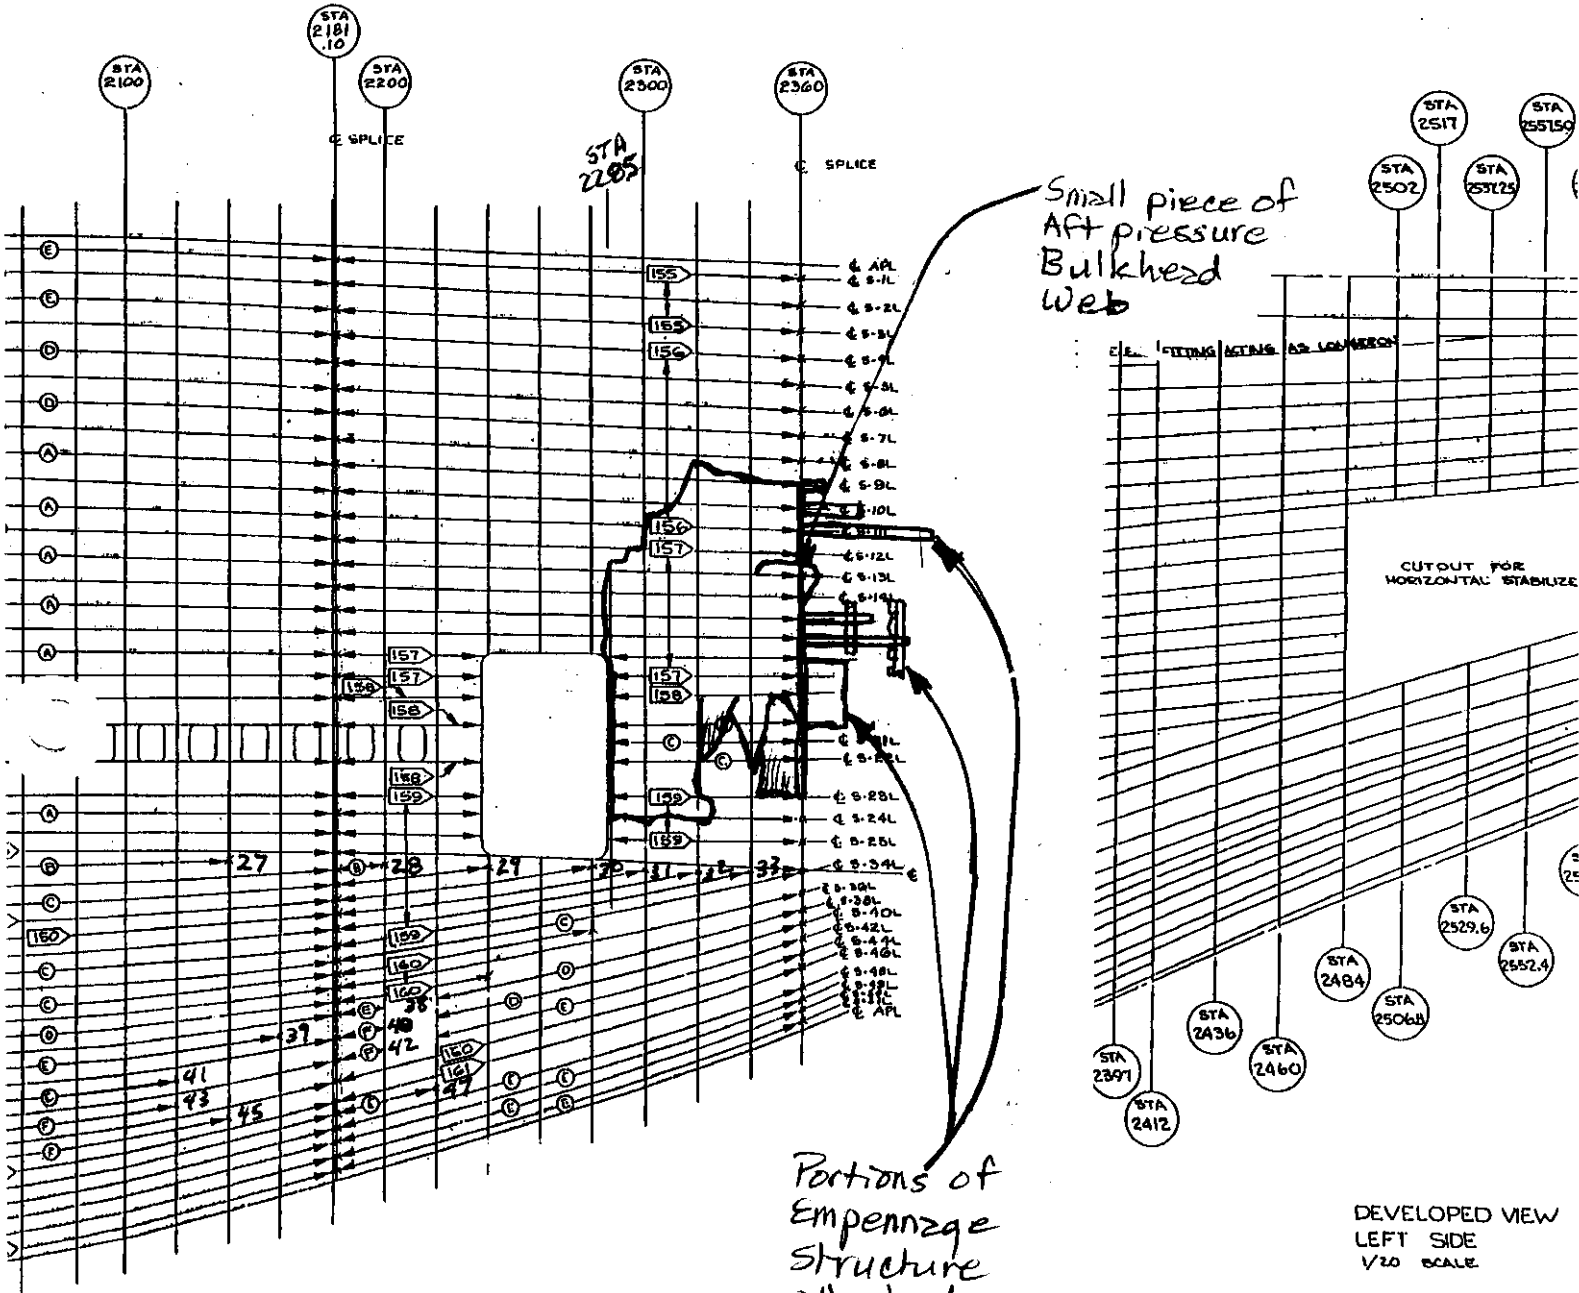

Small piece of Aft pressure Bulkhead Web

Portions of Empennage structure attached to skin segment.

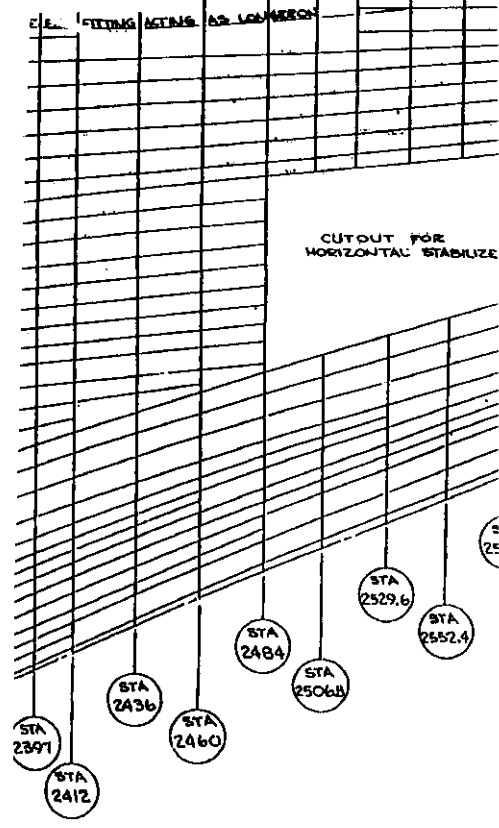

DEVELOPED VIEW LEFT SIDE 1/20 SCALE

DESIGN	747
REVISED	
DATE	424946
ENG. NO.	
GROUP	800
BY	
CHECKED	
APPROVED	

FR 9

10-26-76

2