


RIGHT ~~LEFT~~ FORWARD NOSE  
LANDING GEAR DOOR  
DOOR ACTUATION ROD

LF192

A-731  
(RED)

- ROD FRACTURED AT EACH END
- ① - UPPER END FRACTURED CIRCUMFERENTIALLY THROUGH EACH OF FOUR HOLES FOR END FITTING. FRACTURE INDICATES PRIMARILY A TENSION FAILURE.
- ② - LOWER END FRACTURED CIRCUMFERENTIALLY ADJACENT TO THREADED AREA. FRACTURE INDICATES PRIMARILY TENSION FAILURE WITH SOME BENDING.
- ③ - ROD HAS A DENT LOCATED 16.5 IN BELOW UPPER END. MAXIMUM DEPTH OF DENT IS APPROXIMATELY .6 IN. IMPACT MARKS ARE LOCATED IN THE DENT AREA.
- ④ - ROD IS BENT ABOUT THE DENT AREA APPROXIMATELY 15°.

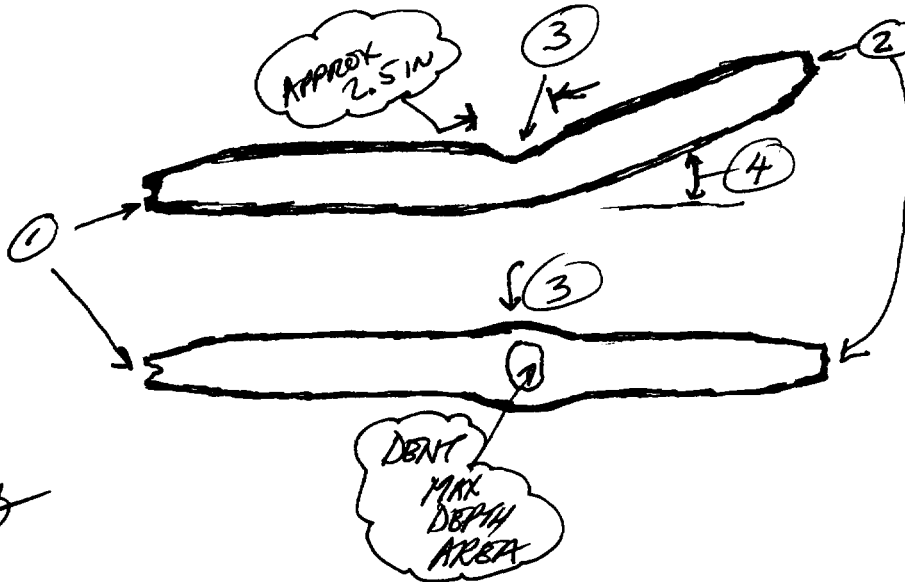

~~ALPA~~  
9-10-97  
ALPA

~~TWA~~  
9-11-97  
TWA

TWA  
9-11-97

S. OBERHOLSER  
FOENR 9/2/97

Dennis Santiago IAM  
9-12-97