

REFER FIRE AND EXPLOSION GROUP NOTES FOR FIRE DAMAGE

LOG # LF-20 ⁵⁰⁶ _{275 10-7-96}

TARGET # _____

COORD: LAT 40° 39.072

LONG 72° 38.453

DEBRIS FIELD #2

Yellow TAG #B180

Aft 41 and Fwd 42 Belly Skins


STA 440 → 580, S-42L → 37R

Skin panel very deformed.

See next sheet for plan view of skin Assy. Most

stringers are still attached and

somewhat flattened against the skin.

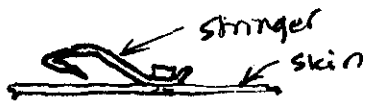

No frame segments remain attached. Most edges on

segment are bent downward. The lav service panel between STA 540/560 is still in place. The panel outer skin is pushed upward into the service panel.

Large portion of cargo container (R1) recovered in same load. No evidence of burn damage.




R. Bianchi IAM 10-25-96

TWA
 2/12/97
 S. Chisholm
 8/7/96
 Stephen F. Klapach Sr
 FAA 10-22-96

Aft 41 and FWD 42 BELLY SKINS

LF20

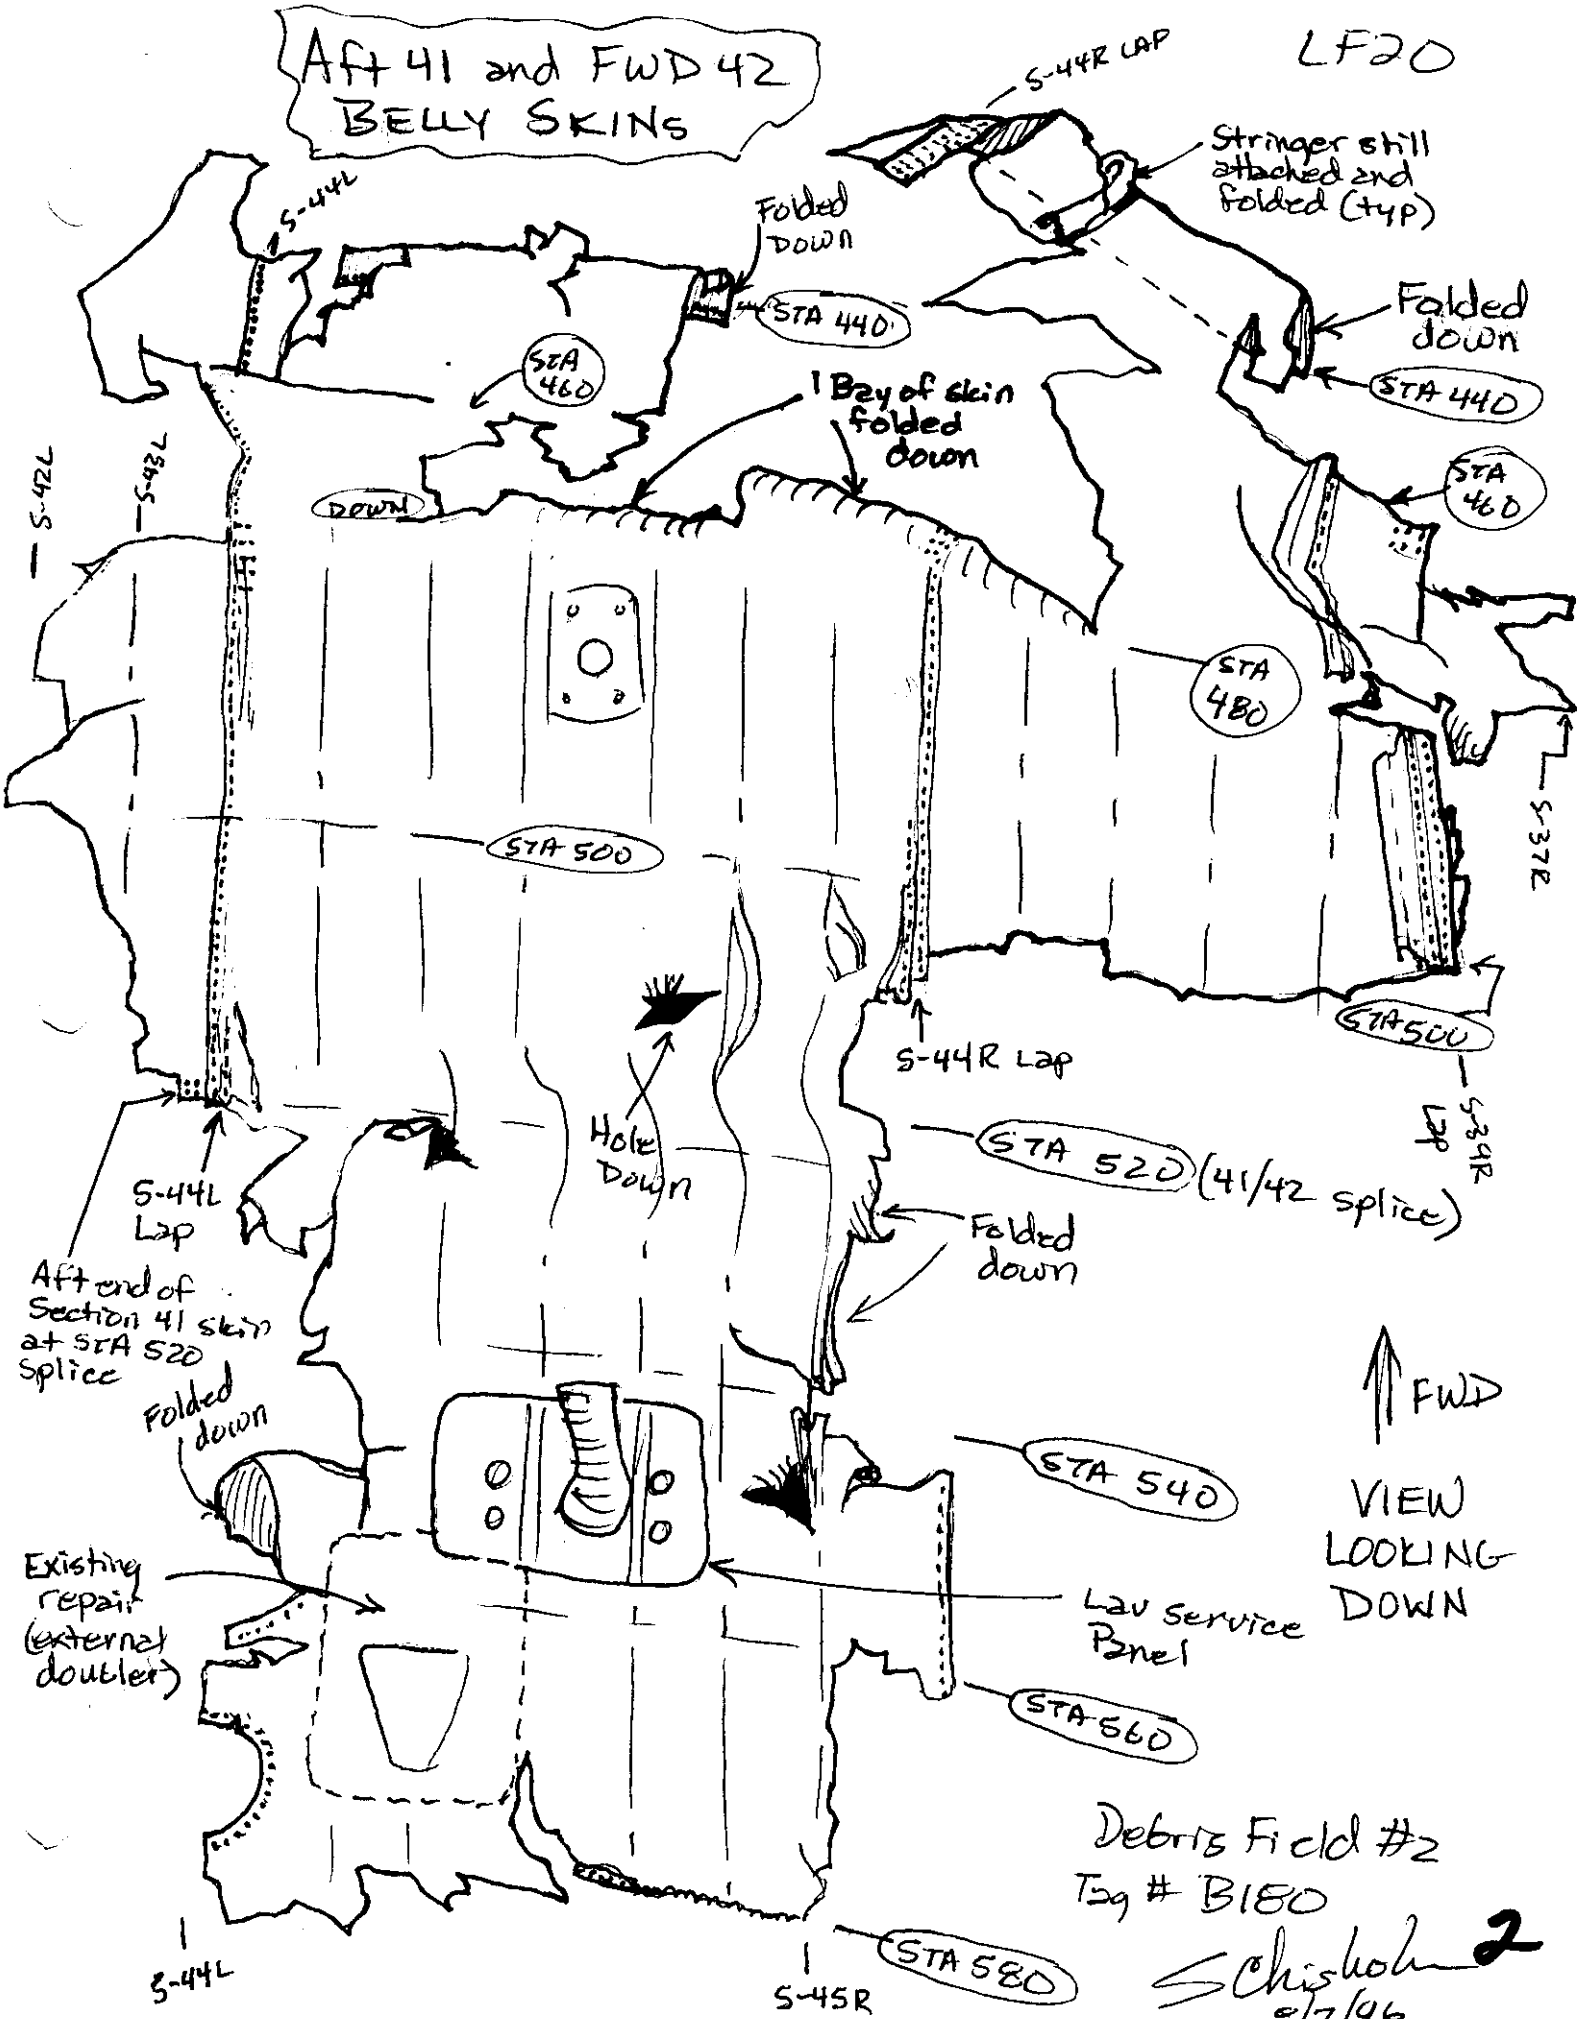

Debris Field #2
Tag # B180

Schishoh **2**
8/2/96
Stephen W. Lapault
Ft. A. 22-2