

LOG # LF 96

TARGET # _____

COORD: LAT _____

LONG _____

DEBRIS FIELD _____

TAG # N 7000

RED

SKIN STA 780 TO STA 800

LEFT STR 37 TO S-40L

SMALL PORTION OF FUSELAGE SKIN
FROM LHS LOWER LOBE. NO FRAMES
OR STRINGERS REMAIN ATTACHED AND
ALL STRINGER FASTENER HOLES ARE
OPEN. THIS SEGMENT MATCHES UP WITH
LF1 (FWD), LF5 (UP), LF24B (AFT) AND
LF22-6 (DOWN).


THERE IS NO EVIDENCE OF FIRE DAMAGE OR
SOOTING.

S. Chisholm
1/10/97

Shandukh
FAA 3/19/97
Tobias
FAA 1-10-97

Dennis Santiago IAM
3-24-97

Leigh D'John - ALPA
3-19-97

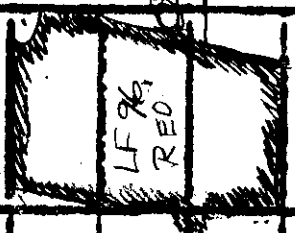

No. 9 (LF)

LF 96

LF 96
RED



800

LF 96


740

37

38

39

40

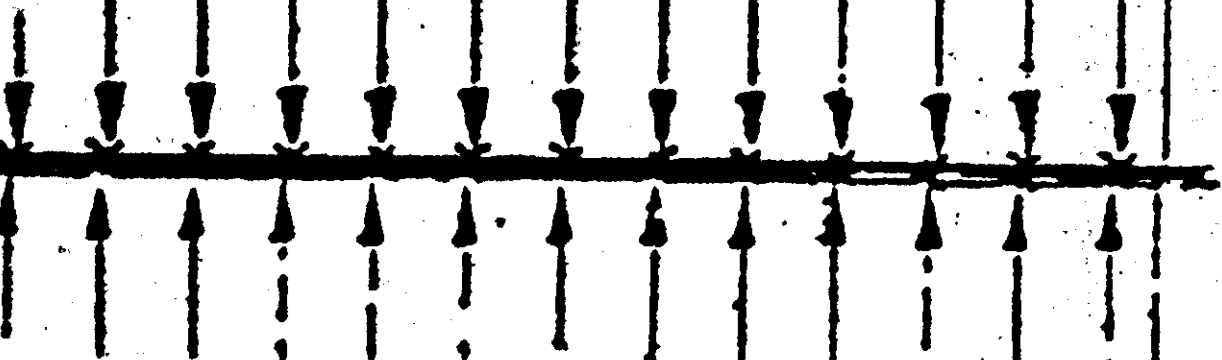

LF 96

STA 780

RED TAG #N7000

STA 800

LFS

S-37L

UP
FWD

bent inboard

S-38L

Fasteners missing in this row and holes puckered inboard

LFI

Upper row of fasteners in place

S-39L

Middle row of fasteners missing

Lower row of fasteners in place

S. Chisholm
1/10/17

LF 24B

S-40L

VIEW LOOKING INBOARD

LF 22-6

