


918 SQ FT OF 1/4" PL SIDE
 160 SQ FT OF 3/8" PL VERTICAL FRAMES
 350 LINEAL FT 3X2X1/4 L
 106 LINEAL FT 5X3X1/4 L
 57 SQ FT OF 1/4" PL HORIZONTAL F.P.

1/4" DAMAGED SIDE

CUT CURTAIN PL. ABOUT 6" AFT OF FR 42.

LOCALIZED BUCKLED PLATE

CURB PL UNKNOWN VEHICLE RAMP TO BE PARTIALLY REMOVED. REFER TO LOWER VEH. DECK PLAN VIEW ON SHT 3.

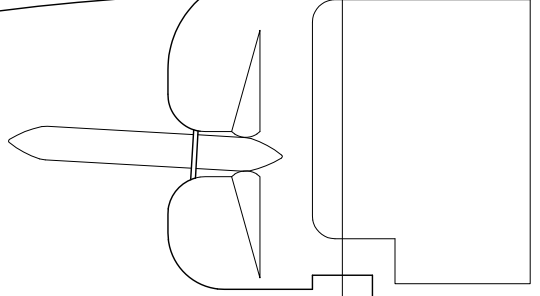

35 40 45 50 55 60 65 70 75


27" SPC

24" SPC

PROFILE

LOOKING OUTBD AT PORT CURTAIN PLATE

EVERETT SHIP REPAIR			
 COLUMBIA-SENTINEL ENGINEERS, INC. NAVAL ARCHITECTS & MARINE ENGINEERS SEATTLE, WASHINGTON			
WSF CATHLAMET ABOVE DK DAMAGE			
DRAWN LNZ	APPROVED	APPROVED BY LETTER DATED: OWNER:	A.B.S.:
CHECKED	DATE 19 AUG 22		U.S.C.G.:
DWG NO. 2265-100-01		SHEET 1 OF 10	SCALE: NONE
		REV	D

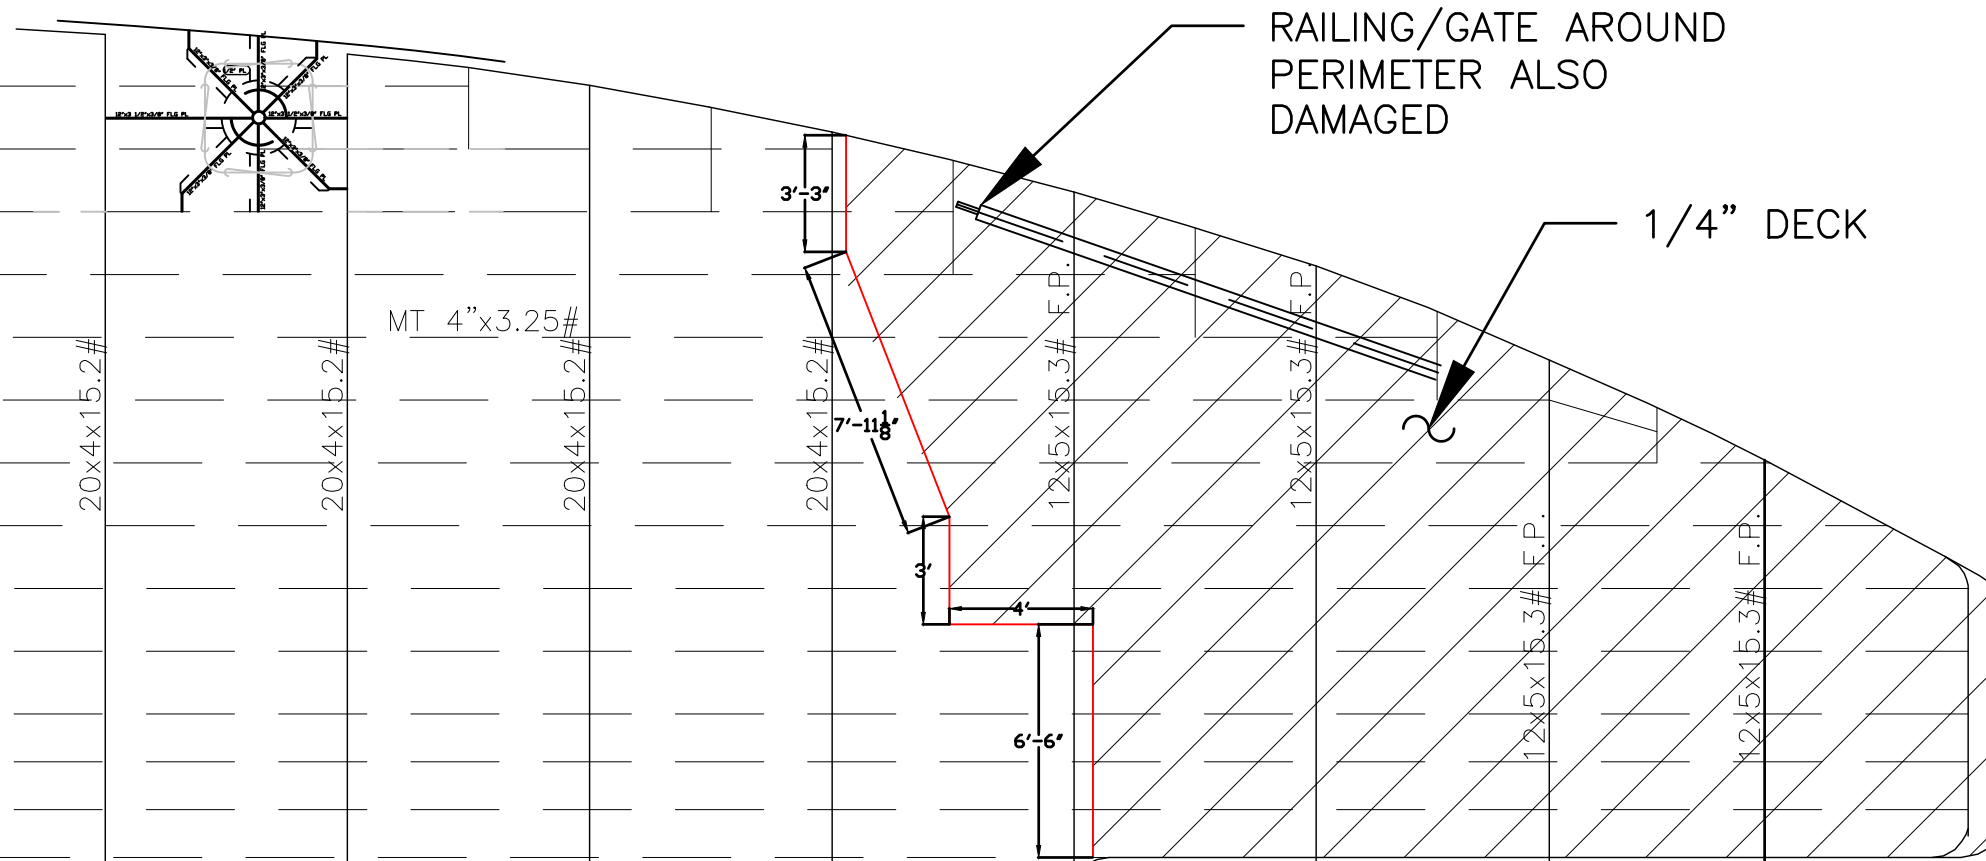

412 SQ FT OF 1/4" PL DECK
 76 SQ FT OF 3/8" PL FOR DECK TRANX
 FRONT & INSIDE PERIMETER = ?
 MT4x3.5# LINEAL FEET = 209 FT

PLAN-PASSENGER DK

40

45

50

55

60

65


70

75

27" SPC

24" SPC

358 SQ FT OF 1/4" PL DECK
 85 LINEAR FEET OF WT 4"x7.5# LONG'L
 28 LINEAR FEET OF 4X1/4" F.B.
 12 LINEAR FEET OF 1X1/4" BACKING BAR
 12 SQ FT OF 15.3# PL.

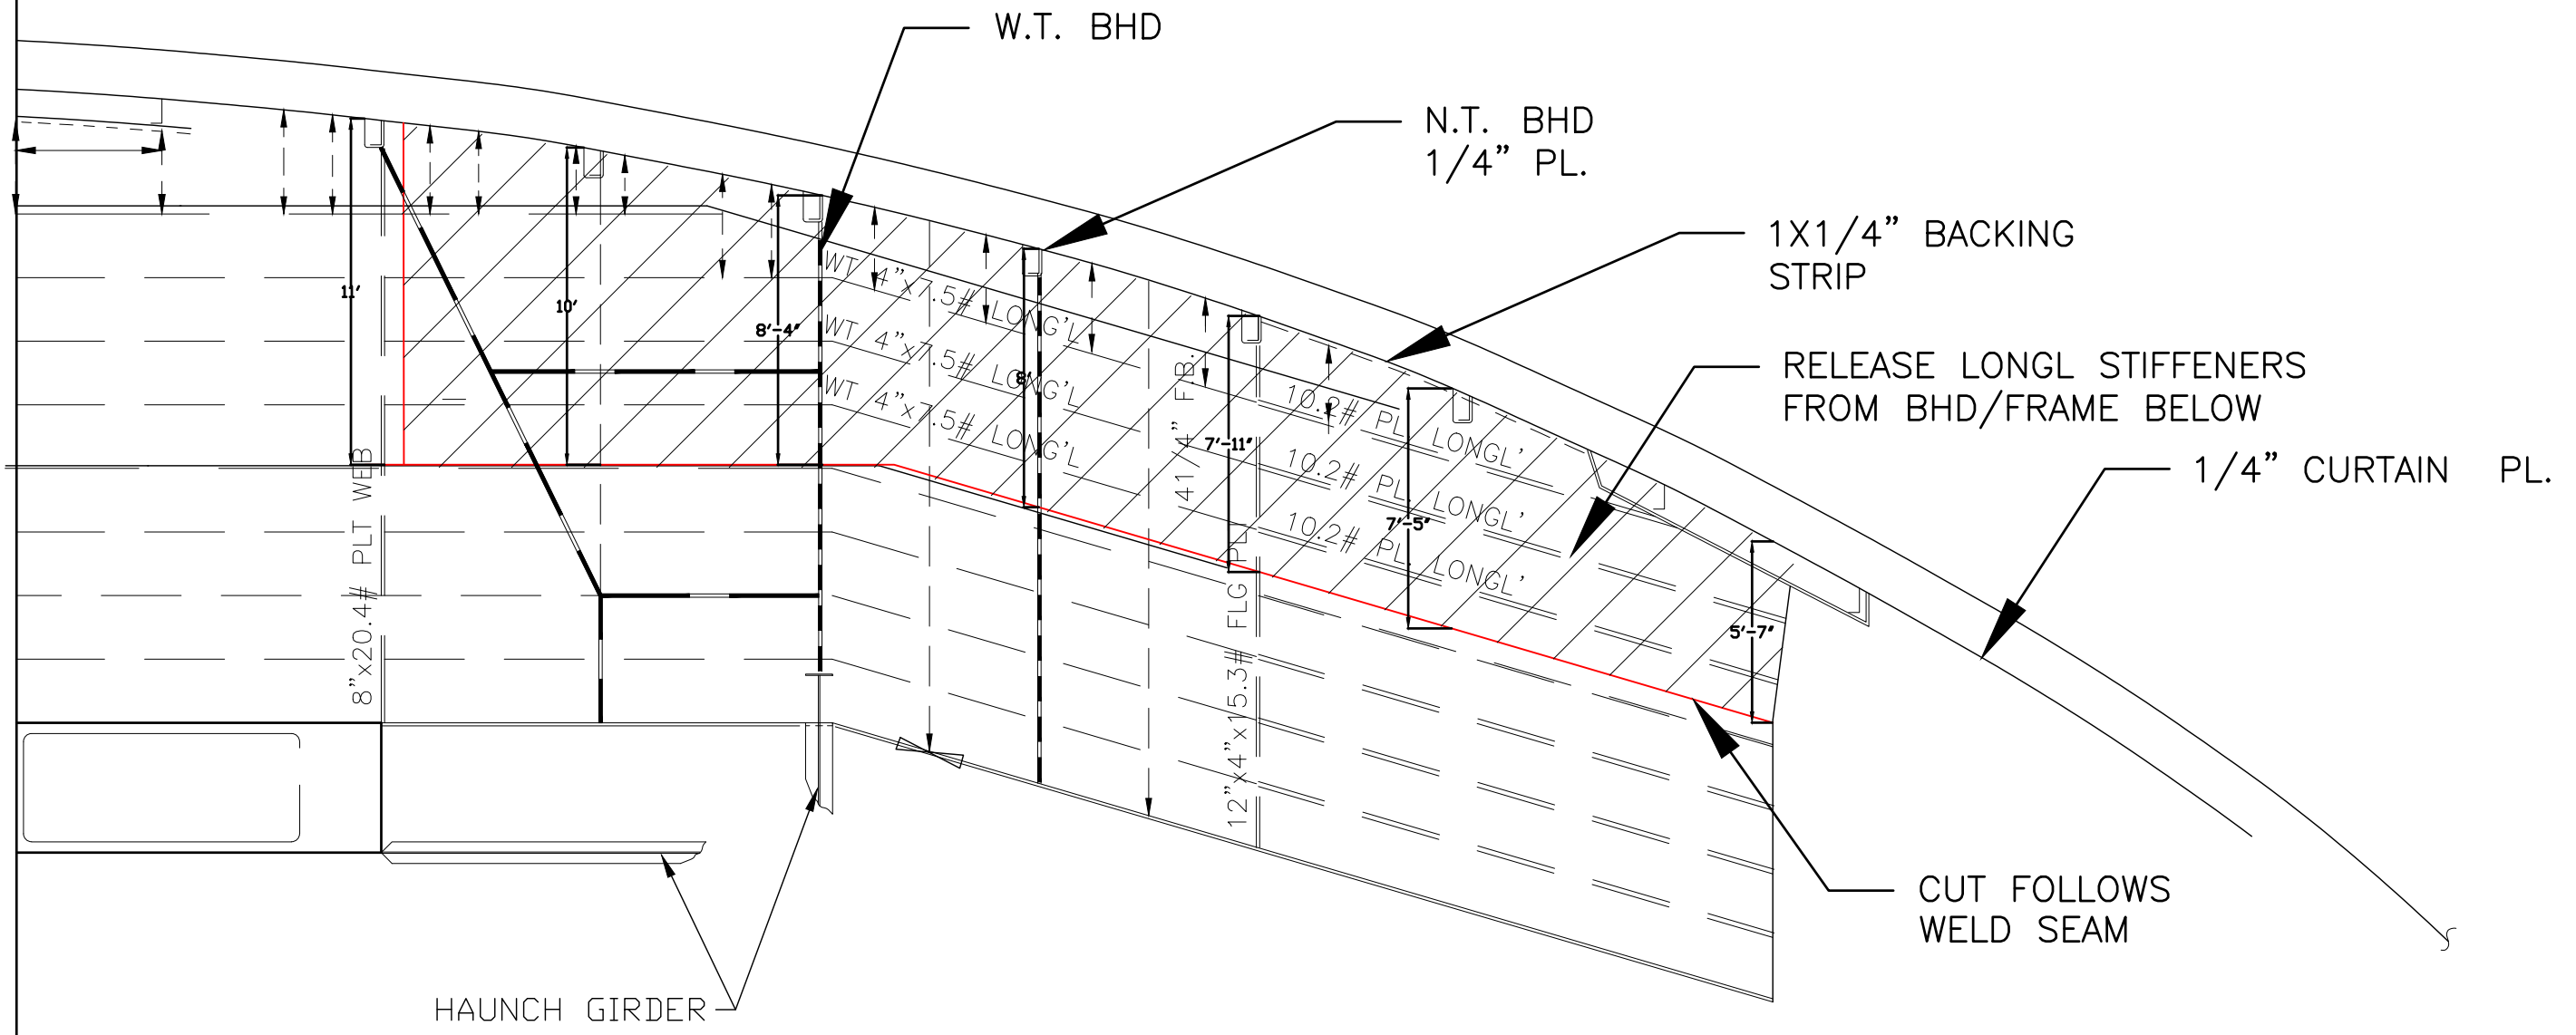

PLAN—LOWER RAMP DECK

40 50 56 60 70 VESSEL