

HELENA RGNL (HLN)(KHLN) P (ARNG) 2 NE UTC-7(-6DT) N46°36.40' W111°59.00' **GREAT FALLS**
 3877 B S4 **FUEL** 80, 100, 100LL, JET A OX 1, 3 LRA Class I, ARFF Index B **NOTAM FILE HLN H-1D, L-13C**
RWY 09-27: H9000X150 (ASPH-PFC) S-100, D-160, 2S-175, **IAP, DIAP, AD**
 2D-250 HIRL

RWY 09: REIL. VASI(V4L)—GA 3.0° TCH 45'. Ground. 0.3% down.

RWY 27: MALSR. VASI(V4L)—GA 3.0° TCH 47'. Rgt tfc.

RWY 05-23: H4644X75 (ASPH-PFC) S-21, D-30 MIRL 1.2% up SW
RWY 05: Road.

RWY 23: PAPI(P2L)—GA 3.0° TCH 49'. Fence. Rgt tfc.

RWY 17-35: H2989X75 (ASPH-PFC) S-21, D-30 MIRL 1.7% up SE

RWY 35: Ground. Rgt tfc.

RWY 10-28: 1800X50 (TURF)

MILITARY SERVICE: FUEL A+ (C406-442-2190. Opr 1200-0600Z†, OT \$125 fee) (NC-80, 100, 100LL)

AIRPORT REMARKS: Attended 1200-0800Z†. ARFF coverage provided for scheduled Part 121 air carriers only exc with prior apvl, call 406-442-2821. Ldg rgts cstm avbl call 406-449-5506. Rwy 17-35 and Rwy 05-23 (exc btn Twy F and Rwy 09-27) not avbl for air carrier use by acft with greater than 30 pax seats. Twy A, Twy B, and Twy C (btn Twy A and Rwy 35) not avbl for air carrier use by acft with greater than 30 pax seats. When twr clsd ACTIVATE HIRL Rwy 09-27, MIRL Rwy 05-23 and Rwy 17-35, REIL Rwy 09, MALSR Rwy 27—CTAF. Ldg fee for all coml acft and all acft over 10,000 lbs. Flight Notification Service (ADCUS) avbl. NOTE: See SPECIAL NOTICE.

MILITARY REMARKS: ARNG Opr Mon-Fri 1400-0030Z† Mon-Fri, exc hol. Exercise caution while taxiing. AASF ramp not stressed for large acft. Ctc flt ops for ramp advisory 126.2, DSN 406-324-5775, C406-324-5775. No tran svc Sat, Sun, hol or after 2300Z† Mon-Fri.

AIRPORT MANAGER: 406-442-2821

WEATHER DATA SOURCES: ASOS (406) 443-4317

COMMUNICATIONS: CTAF 118.3 ATIS 120.4 UNICOM 122.95

RCO 122.55 255.4 (GREAT FALLS RADIO)


APP/DEP CON 119.5 229.4 (1300-0500Z†)

SALT LAKE CENTER APP/DEP CON 133.4 285.4 (0500-1300Z†)

TOWER 118.3 257.8 (1300-0500Z†) GND CON 121.9

ARNG OPS 40.65 126.2 321.45

AIRSPACE: CLASS D svc 1300-0500Z† other times CLASS E.

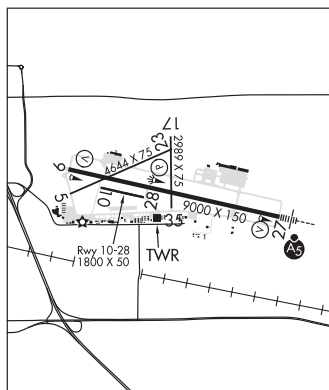

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE HLN.

(H) VORTACW 117.7 HLN Chan 124 N46°36.41' W111°57.21' 254° 1.2 NM to fld. 3823/16E.

VOR portion unusable:

035°-050° byd 35 NM blo 12,000'
 105°-165° byd 25 NM blo 17,000'
 165°-185° byd 25 NM blo 13,500'
 185°-230° byd 25 NM blo 17,500'
 203°-213° byd 22 NM blo 13,000'
 230°-270° byd 25 NM blo 12,500'

TACAN AZIMUTH & DME unusable:

035°-070° byd 35 NM blo 13,000'
 165°-185° byd 25 NM blo 13,500'
 250°-300° byd 25 NM blo 14,000'
 320°-035° byd 25 NM blo 13,000'

TACAN DME unusable:

035°-070° byd 35 NM blo 13,000'
 105°-150° byd 25 NM
 105°-210° byd 15 NM blo 11,100'
 105°-210° byd 20 NM blo 12,000'
 150°-165° byd 25 NM blo 17,000'
 165°-185° byd 25 NM blo 13,500'
 185°-210° byd 25 NM
 203°-213° byd 22 NM blo 13,000'
 210°-250° byd 15 NM blo 12,000'
 210°-250° byd 25 NM blo 17,500'
 250°-300° byd 25 NM blo 14,000'
 320°-035° byd 25 NM blo 13,000'

TACAN AZIMUTH unusable:

105°-150° byd 15 NM
 150°-165° byd 15 NM blo 17,000'
 185°-210° byd 15 NM
 210°-250° byd 15 NM blo 17,500'

CAPITOL NDB (HW) 335 CVP N46°36.40' W111°56.23' 258° 1.9 NM to fld. NDB unmonitored when ATCT clsd.

HAUSER NDB (MHW) 386 HAU N46°34.13' W111°45.48' 268° 9.6 NM to fld. NDB unmonitored when HLN ATCT clsd.

ILS 110.1 I-HLN Rwy 27. Unmonitored when ATCT closed. Localizer backcourse unusable byd 22° rgt of course, unusable within 2.7 DME.

HELLER FARM (See WINIFRED on page 118)**HINDSALE** (6U5) 0 SE UTC-7(-6DT) N48°23.28' W107°05.00'**BILLINGS**

2220 NOTAM FILE GTF

RWY 07-25: 2200X75 (TURF) LIRL(NSTD) 0.7% up W**RWY 07:** Road.**RWY 10-28:** 2160X200 (TURF) 0.3% up W**RWY 10:** Road.**RWY 16-34:** 1960X75 (TURF) 1.5% up S**RWY 16:** P-line.**RWY 34:** Fence.**AIRPORT REMARKS:** Unattended. Rwys soft when wet. Hay bales and farm equipment adjacent to rwy. Rwys not clearly defined.

Rwy 16-34, Rwy 07-25 and Rwy 10-28 marked with white cones full length of rwy. Rwy 16 p-lines marked with globes.

Rwy 07-25 NSTD LIRL 335' spacing between lgts, one thld lgt each end. For rwy lgts phone 406-364-2272/2387.

AIRPORT MANAGER: 406-364-2272**COMMUNICATIONS:** CTAF 122.9**HOGELAND** (6U6) 1 NW UTC-7(-6DT) N48°51.61' W108°39.66'**BILLINGS**

3139 B NOTAM FILE GTF

RWY 07-25: 3140X60 (TRTD) 0.6% up W**RWY 16-34:** 1230X50 (TURF)**RWY 34:** Bldg.**AIRPORT REMARKS:** Unattended. Rwy 16-34 for emerg use only, road and drainage ditch parallel rwy on east side. Rwy 07-25

patches of loose aggregate and grvl.

AIRPORT MANAGER: 406-379-2582**COMMUNICATIONS:** CTAF 122.9