


CW 151  
WING CENTER SECTION  
UPPER SKIN

TAG # Z4009  
GREEN ZONE  
TRAWLING

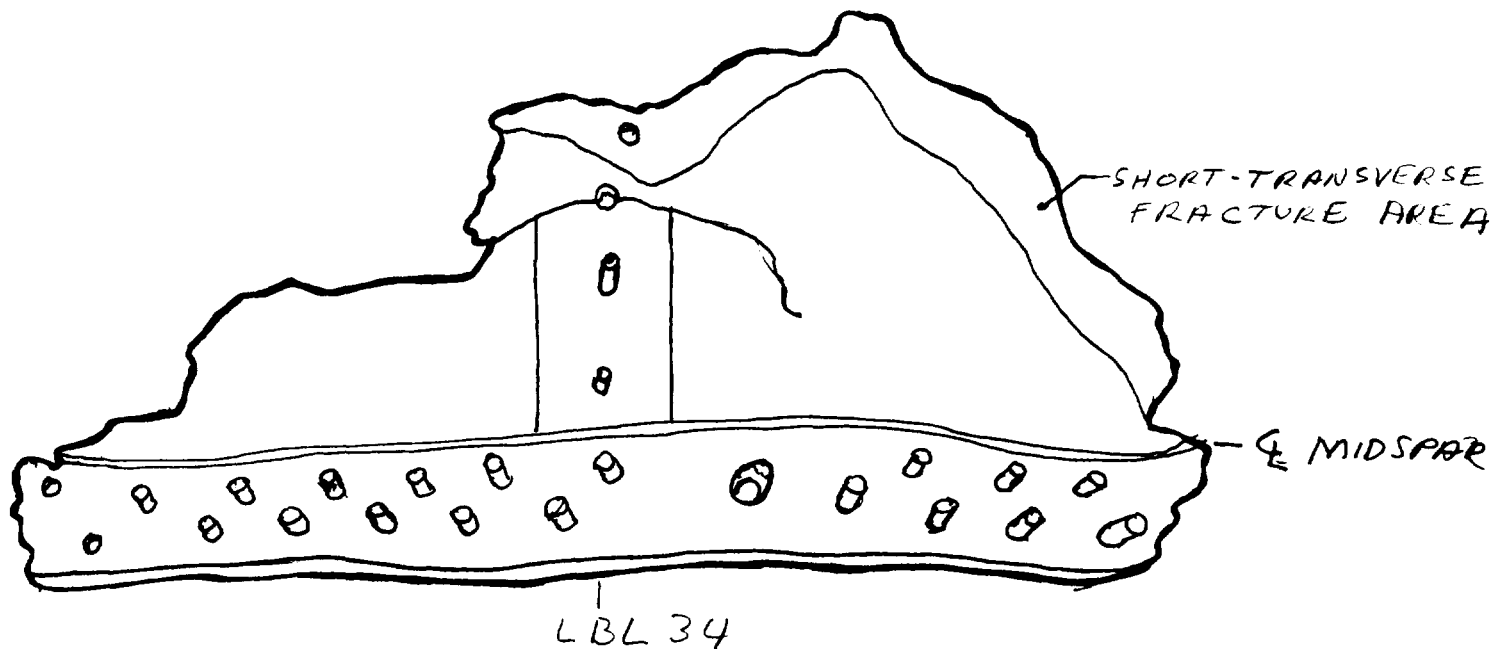

UPPER SKIN PANEL FORWARD OF MID SPAR SPLICE.  
SPAR CHORD IS ATTACHED AND FRACTURED AT  
HEEL LINE OF WEB FLANGE. THE FASTENERS FOR  
THE PANEL AFT HAVE THEIR HEADS FRACTURED OFF.

LBL 34 FLOOR BEAM IS NOT ATTACHED, AGAIN, THE  
FASTERER HEADS HAVE FRACTURED IN TENSION.  
THE FASTENER HOLE FOR THE LBL 34 FLOOR BEAM  
TENSION FITTING IS ELONGATED FORWARD.

THE PART HAS A SLIGHT WAVE SHAPE ALONG  
THE INBD - OUTBD DIRECTION.

PART IS LIGHTLY SOOTED AND CONNECTS TO  
CW 102 WHICH IS BURNED. FRACTURES ARE SOOTED

Dennis Santiago IAM  
3/23/97

R. L. WHITTINGTON

John D. Johnson - ALPA  
20 MAR 97

Burton H. H. H.  
3/22/97 TWA

Stephen F. Kippenhan Jr.  
FAA 04-02-97