

SIDE OF BODY RIB - RIGHT WING - WING CENTER TANK

CW-318	CW-319	CW-320	CW-321	CW-322
Z-2798	D-2010	D-2009	Z-2714	Z-2735
41"	26"	39"	40"	33"
GREEN	WHITE	WHITE	GREEN	GREEN

These segments are all portions of side of body rib stiffeners. See the accompanying sheet for location description.

All of these stiffener portions have some rivets remaining in the fastener holes that exhibit shear failures with tension interaction evident at some locations.

There is no sooting on these parts.

W. Stuyant 11/24/96 BOKING
J. Klapack 11-26-96 WWA
R. Beckett 12-7-96 FHM
Stephen F. Klapack Jr 12-12-96 FHM
SD GREEN 12-17-96 AWA

S.D.B. RIB STIFFENERS

A. REIMER
10/17/96

CW-319

D-2010
WHITE


P/N 65811553-12 26" LONG 4" ROLL STRAP.

FOURTH (4TH) STIFF AFT OF FRONT SPAR

NOTE: THIS STIFF WAS FOUND LAYING ON THE LOWER SKIN (OUTBOARD WING) SECTION - ADJACENT TO THE LWR SKIN PUNCTURES ALONG ≈ WBL150, AND THE CWT DRY BAY VICINITY.

CW-320

D-2009
WHITE

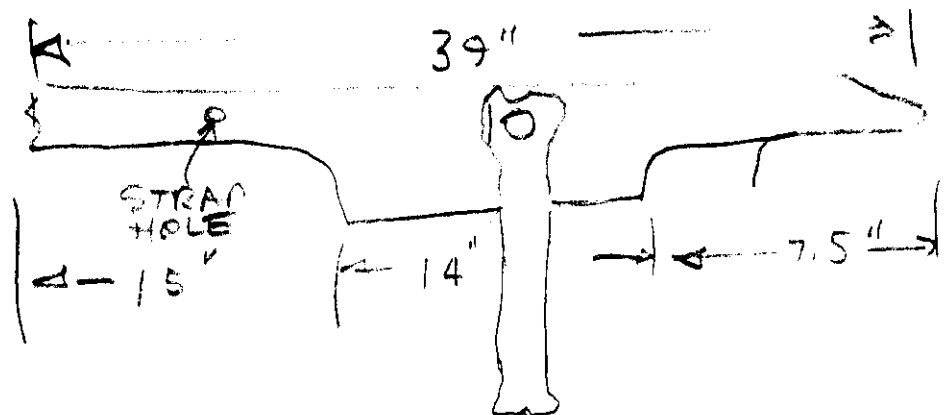

NOTE FROM CW 319 APPLIES,

CW-318

Z-2798
GREEN

P/N 6511554-16 (4TH AFT₁) 4" LONG C/W UPR END FTG, AND 2 PCS OF 6" LONG ROLL STRAPS

OF SWB3

CW-321

Z-2714
GREEN

P/N 65811554-12 (1ST FWD SWB²) 40" LONG C/W UPR END

CW-322

Z-2735
GREEN

P/N 65811555-8 (3RD AFT OF M.S) 33" LONG C/W UPR END.