

LOG # FBM-32

TARGET # _____

COORD: LAT _____

LONG _____

DEBRIS FIELD _____

TRAWL LINE #

A RED E-152-NS

B GREEN B-127-NS

1897
37
51
188
16
172


FLOOR BEAM POSTS

RBL96 STA 940 PART A

RBL96 STA 960 PART B

FBM 32A: ✓ UPPER FRACTURE IS $\approx 3"$ BELOW F/B, SQ BREAK ON AFT & INBD FACES AND ANGLED UPWARD ON FWD & OUTBD FACES $\approx 1"$ HIGHER. FRACTURE FACES ARE $\approx 45^\circ$. POST BENDS INBOARD AND AFT CENTERED ABOUT \approx WL 172 $\approx 15^\circ$ IN BOTH DIRECTIONS. LOWER FRACTURE IS @ THE LOWER FAST ACCESS CUTOOTS UPPER END. \approx WL 152

FBM 32B: ✓ UPPER FRACTURE IS AS SHOWN. THIS POST IS ALSO BENDS INBD $\approx 15^\circ$ AT WL 172. LOWER FRACTURE IS SIMILAR TO PART A

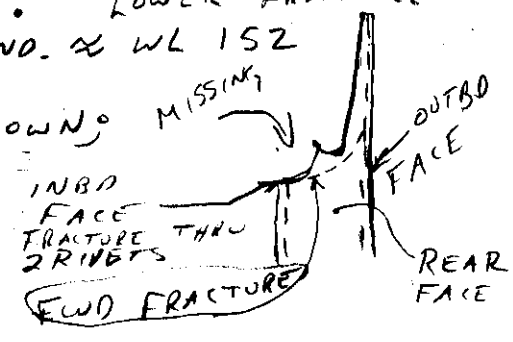

REAR VIEW OF POST

Tom Todman
FAA 4-11-97

Dennis Lantieri IAM
4-8-97

A. B. ...
4/8/97

Barry Smith
1/20/97

Phil ...
TWA 4-15-97