

LOG # FBM-8

TARGET # \_\_\_\_\_

COORD: LAT \_\_\_\_\_


LONG \_\_\_\_\_

DEBRIS FIELD RED

8A-A 261

8B-A 711

8C - SOURCE TAG A174

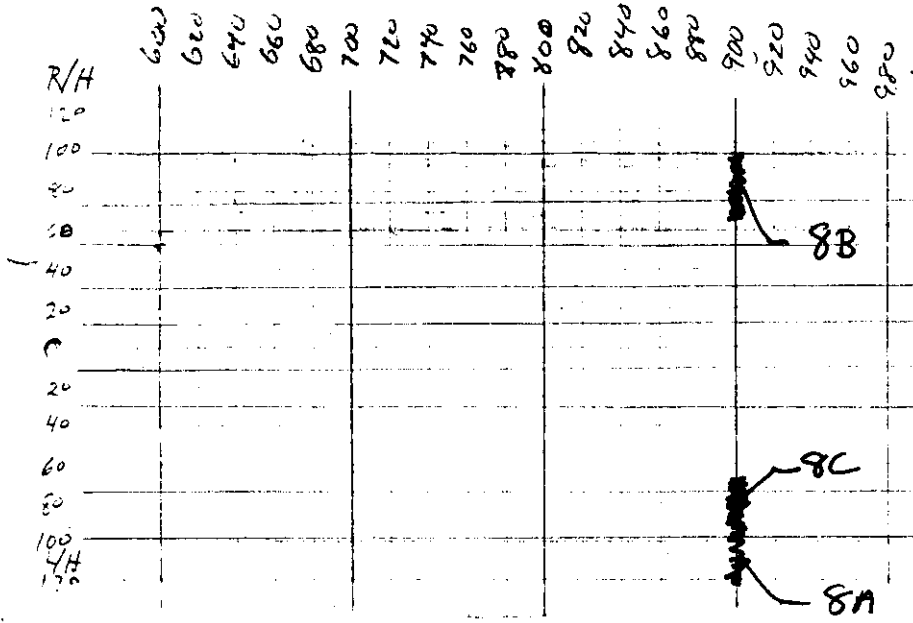

VARIOUS FLOOR BEAM PIECES STA 900

8A STA 900 F/B WITH FRAME ATTACHED. <sup>LBL 85 TO SOB</sup> FRAME  
 FRACTURED THRU S-25 AND S-28 & FASTENERS  
 UPPER CAP SEPARATED FROM LBL 108 INBD TO LBL 91  
 (SEE F/B DWG)

8B <sup>RBL 55 TO RBL 96</sup>  
 STA 900 LOWER CHORD, WEB AND LEG OF UPPER CHORD.  
 LOWER CHORD BENDS UP 90° @ RBL 80  
 WEB FRACTURED FROM LOWER CHORD OUTBD OF  
 BL 80 BEND AND FOLDED FLIP ≈ 180°  
 (SEE F/B DWG)

8C UPPER CHORD AND WEB LBL 74 TO LBL 88  
 MATES UP TO FBM-9. <sup>(INBD)</sup> WHEN MATCHING FRACTURES,  
 8C IS 90° BENT DOWN WITH RESPECT TO FBM 9  
 MATES UP WITH FBM-12C OUTBD END,  
 WITH FRACTURES MATING UP FBM-8C IS BENT  
 DOWN ≈ 30° WITH RESPECT TO FBM-12C.  
 (SEE F/B DWG)

McKinney TGA  
10-27-96

Denise Antelope IAM  
11/23/96

Buddy Smith 10/23/96

BOEING  
Stephen F. Kapuchin  
FAN 10-24-96

ALL APPS  
11/4/96