


LOG # LF131
 TARGET # D2110
 COORD: LAT _____
 LONG _____

B, HOCKING
 BOEING
 3/1/97


DEBRIS FIELD WHITE

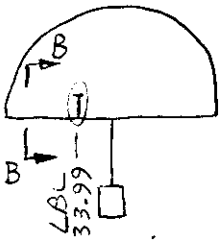

VIEW A-A

PRESSURE DECK FLOORBEAM SEGMENT,
 LBL 33.99, STA 1257 TO 1282

THE SEGMENT APPEARS TO BE SOOTED MODERATELY
 ALONG BOTH SIDES (INBOARD & OUTBOARD)

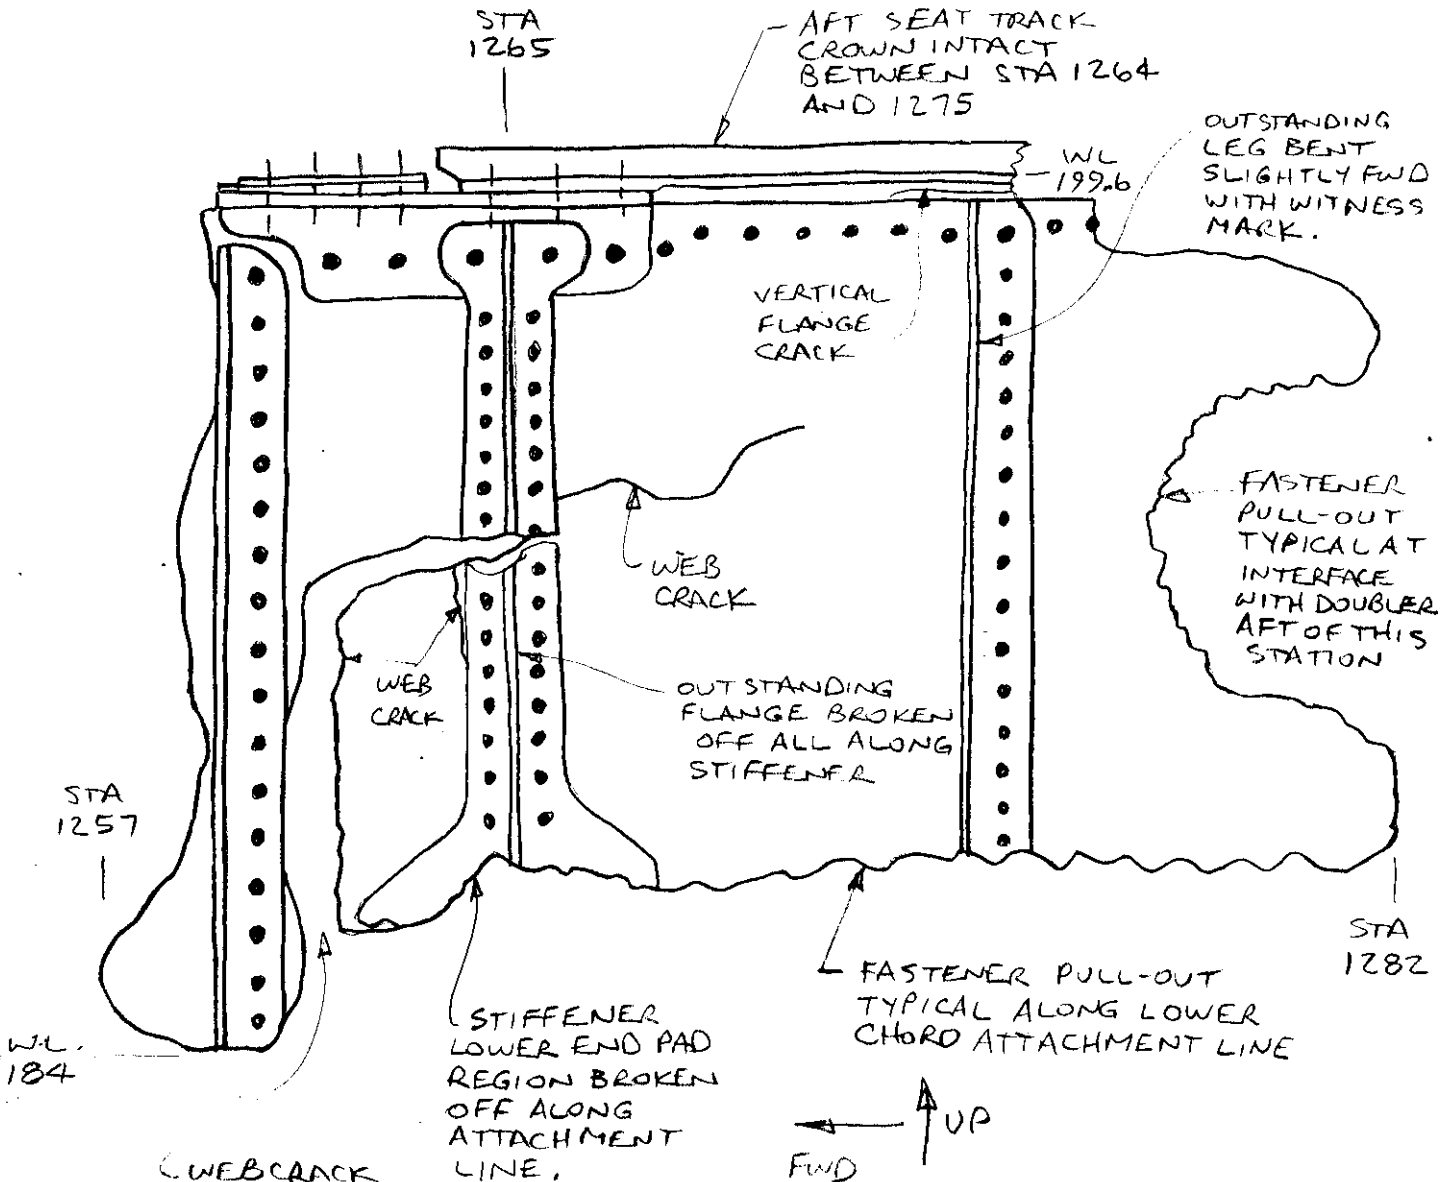

WEB CRACK
 OPENED UP
 DUE TO FWD
 STIFFENER BENT
 FWD AND INBOARD
 SLIGHTLY AT MID-
 HEIGHT VICINITY.


UP
 FWD
VIEW B-B

NOTE: PRESSURE DECK WEB AND
 FLOORBEAM LOWER CHORDS
 START DOWNWARD SLOPE
 GOING FORWARD AT STA 1265

Chandrahulu
 TWA 3/21/97
 Dennis Santiago IAH
 3-6-97
 John D. Johnson - ALPA
 3-17-97

Stephen F. Kelly
 FAA CS-1A-97


55

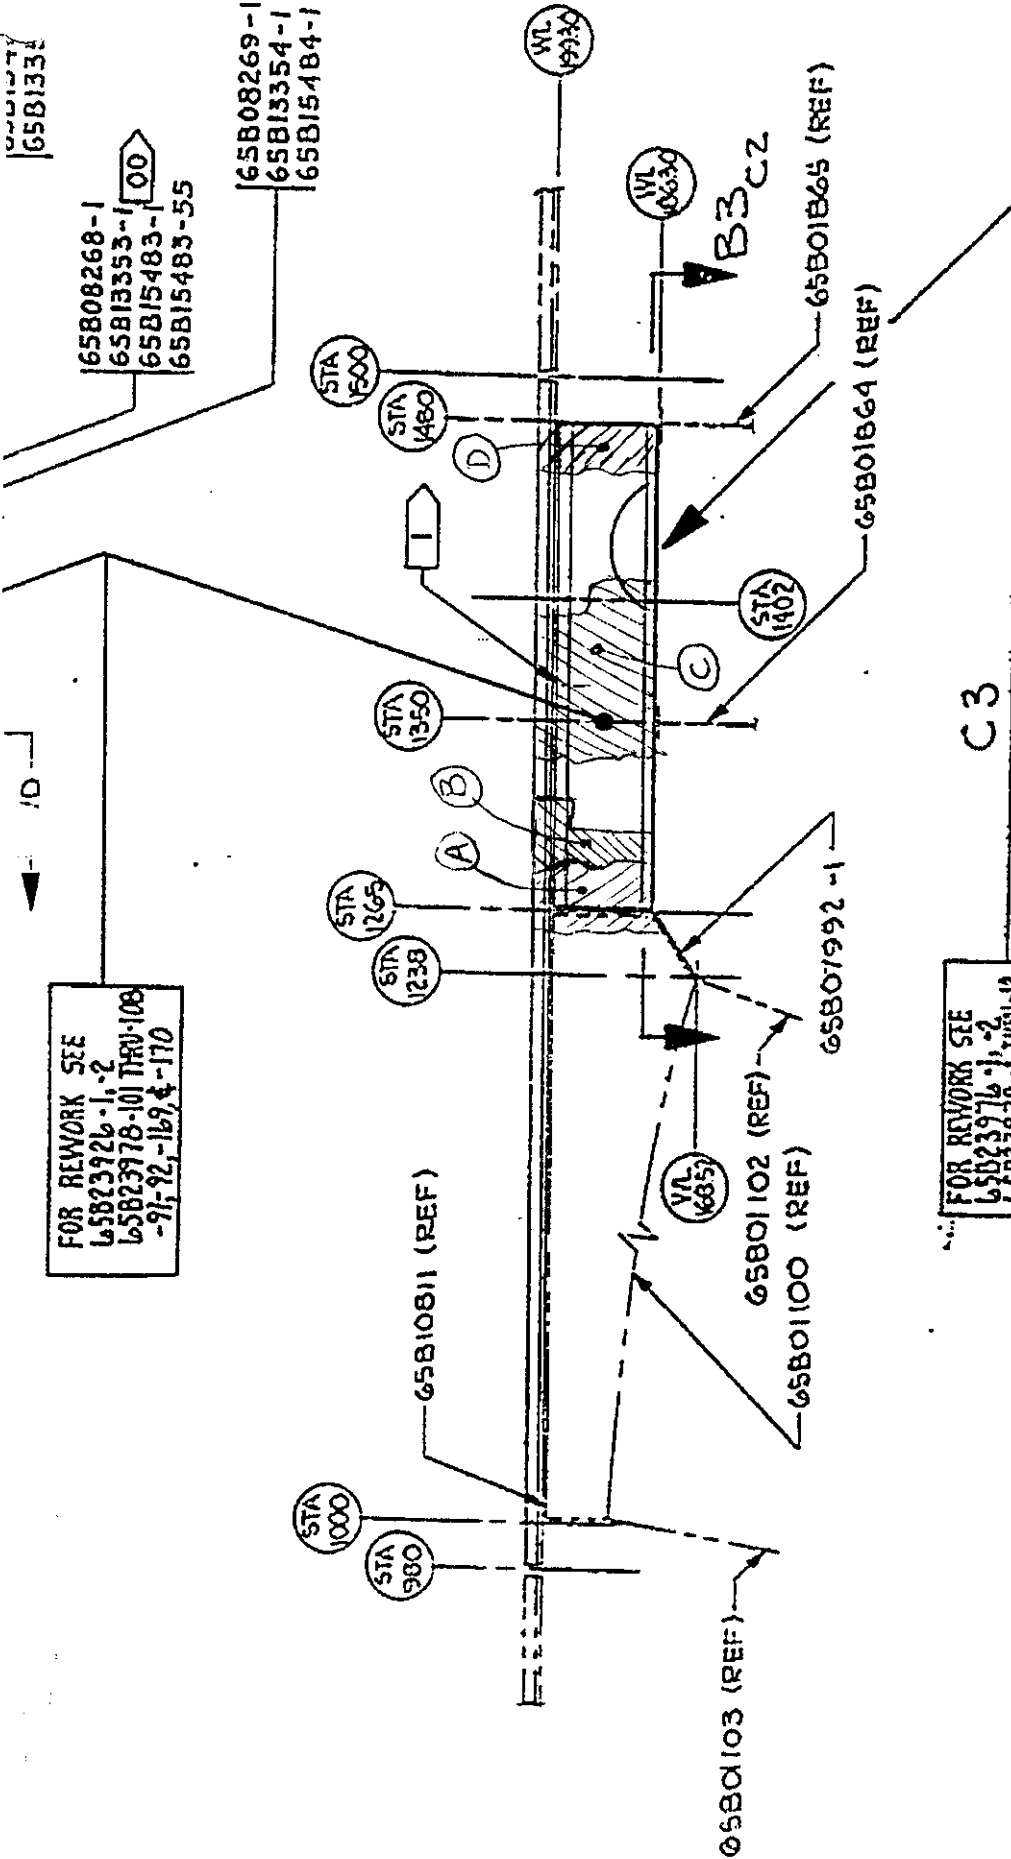

FOR REWORK SEE
 65B23926-1, 2
 65B23978-101 TRU-108
 -91, 92, 169, 170

FOR REWORK SEE
 65B23976-1, 2
 65B23978-1 TRU-12
 65B24785-1, 2, 3, 4

LBL 33,99
 FURB M

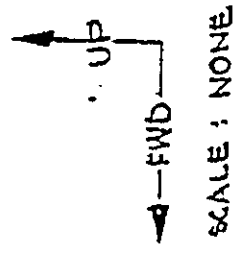

ITEM	LOG #
A	LF 131
B	LF 132
C	LF 133
D	LF 134

Stephen F. K...
 11/17-03/14-97