

LOG # LF 189

TAG TARGET # _____

COORD: LAT _____

LONG _____

DEBRIS FIELD _____

FBI # 8-3-96-85

↳ STA 660 & 660 LOWER LOBE FRAMES, WITH LATERAL BEAM; SKIN STA 660-700, STR 39L-41½L

- FRAMES HAVE PUSHED THRU SKIN
- THE UPPER SKIN AT THE STR 39L LAP SPLICE HAS BEEN PEELED UPWARDS, MOST PREDOMINATELY BETWEEN STA 660-680
- NO OBVIOUS SIGNS OF SOOT NOR FIRE DAMAGE


Tom Todman
FAA 3-28-97

Dennis Santiago IAM
4-4-97

[Signature]
4-6-97

[Signature] ALPA
11/4/97
[Signature]
3/25/97

Pg 1 of 3

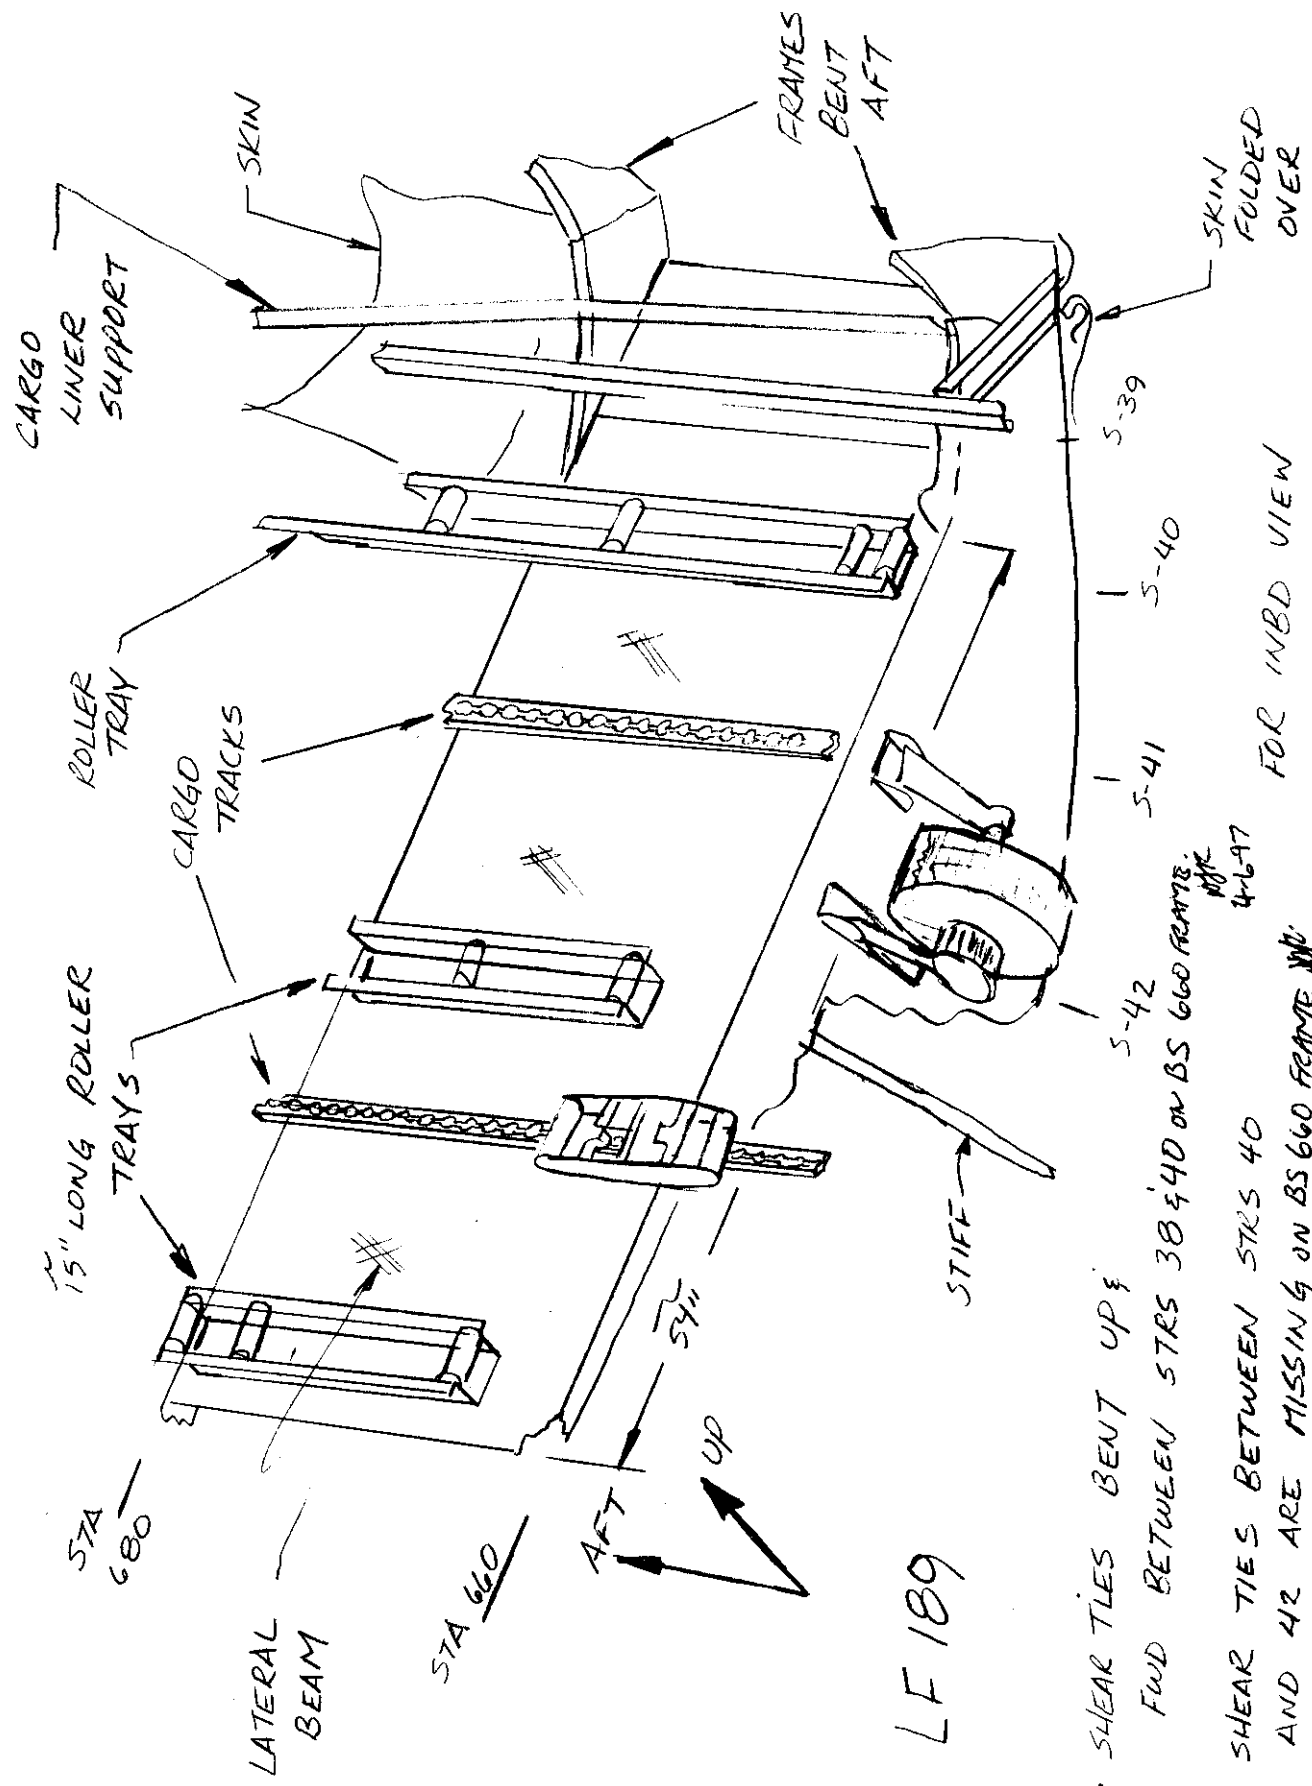

LF 189

- SHEAR TIES BENT UP & FWD BETWEEN STRS 38 & 40 ON BS 660 FRAME; 4-6-97
 - SHEAR TIES BENT UP & AFT BETWEEN STRS 40 AND 42 ARE MISSING ON BS 660 FRAME; 4-6-97
 - SHEAR TIES BENT FWD AND UP BETWEEN S-38L AND S-39L; AND S-41L AND S-41L. 4-6-97
- FOR INBD VIEW OF SKIN SEE NEXT PAGE

