

LOG # LF50

RTB
N-10-96

TARGET # _____

COORD: LAT 40-38-31

LONG 72-38-58

TAG #
A131.

DEBRIS FIELD RED

FRAME AND CARGO FLOOR

STA 860 - 880 RBL 15 TO S36L


- STA 860 FRAME FROM S38L TO S40L, UPPER CHORD TORE AWAY FROM WEB FROM S40 TO RBL 25 SKIN AND STRINGERS ARE MISSING
- STA 880 FRAME FROM S36 TO S41, UPPER CHORD TORE AWAY FROM WEB FROM S42 TO RBL 5
- SHEAR WEB BETWEEN STATIONS IS STILL ATTACHED AND STRAIGHT FROM SIDE OF BODY SHEAR TIE TO FRACTURE AT RBL 15.

Barry Smith
10/22/96

Neil Scivilli
TWA 10-10-96
C/TK JAM 10-11-96

REFER FIRE AND EXPLOSION GROUP NOTES FOR FIRE DAMAGE

Stephen F. Klapeckson
FBI 10-22-96

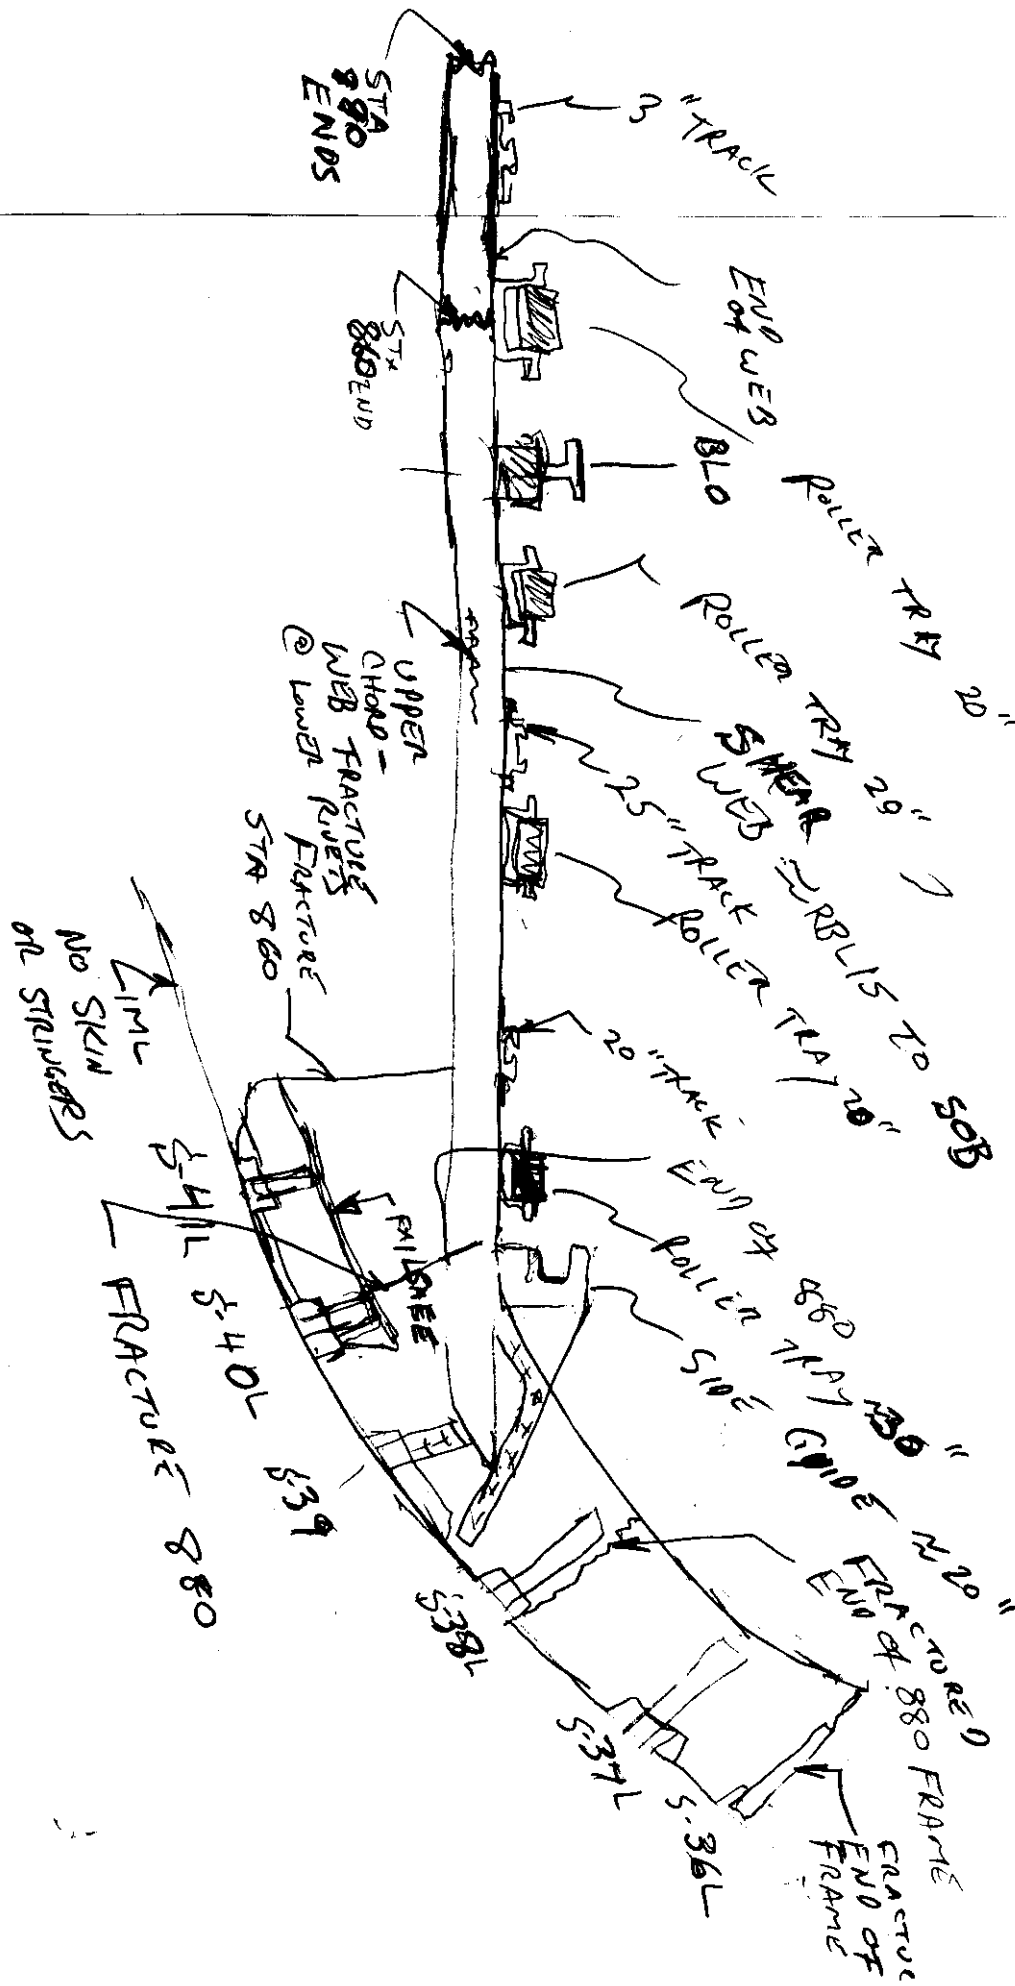

2

Stephen F. Klupwell
 FPM-10-22-76
 2/2