


LW 16
TAG # C909

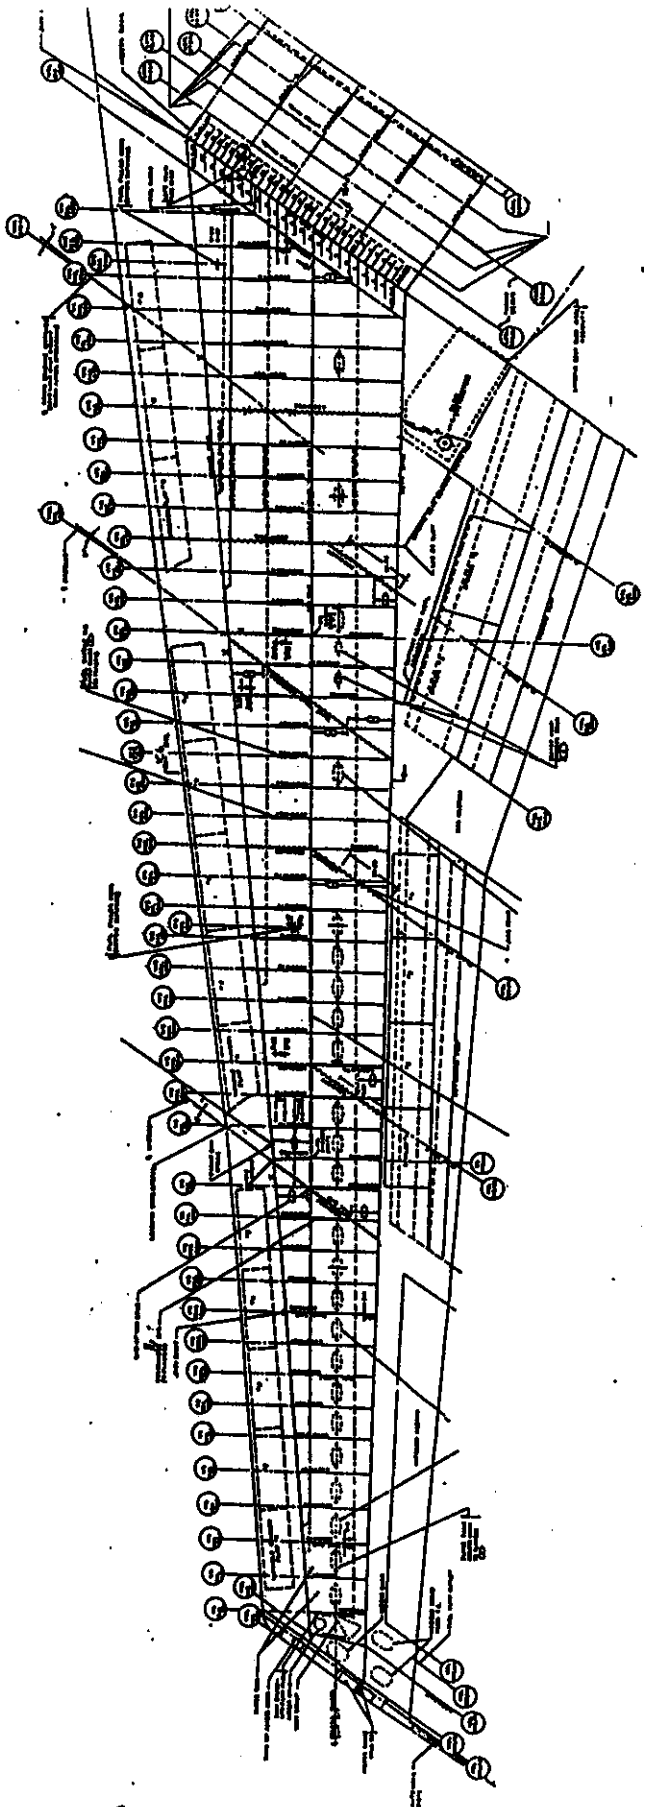

[Signature]
11-11-96 ADA

Stephen F. Klepach
FHA 10-28-96

FLAP TRACK SUPPORT
LEFT WING WBL 353
STRINGER 7

FASTENERS THRU
UPPER RIB CHORD MISSING

FITTINGS BENT
INBD AT UPPER
RIB CHORD

MOST
FASTENERS
FAILED IN
TENSION

RIB
WEB

SKIN BENT
DOWN

LWBL
353

STATIC
FAILURE IN
SKIN

PIECE FOUND BY ITSELF
R-19-96-22
E

FWD ←

↑ UP

- FAA
OUTBDX
- ALPA

ENGR.	TAG# C909	REVISED	DATE	LW 16 ^(MS) Integ IAM
CHECK				WHITINGTON & BOEING
APR				MR. [unclear] 10/13 - TWA
APR				BOEING