

LW 28

SJ GREEN - ALPA

11-7-96

D. Santiago - IAM

Mr. P. ... - TWA


12/13

Lee ... - FAA

10.28.96 - NTSB

TRAC # C 2261  
GREEN  
WHITTINGTON 9/5/96

BOEING

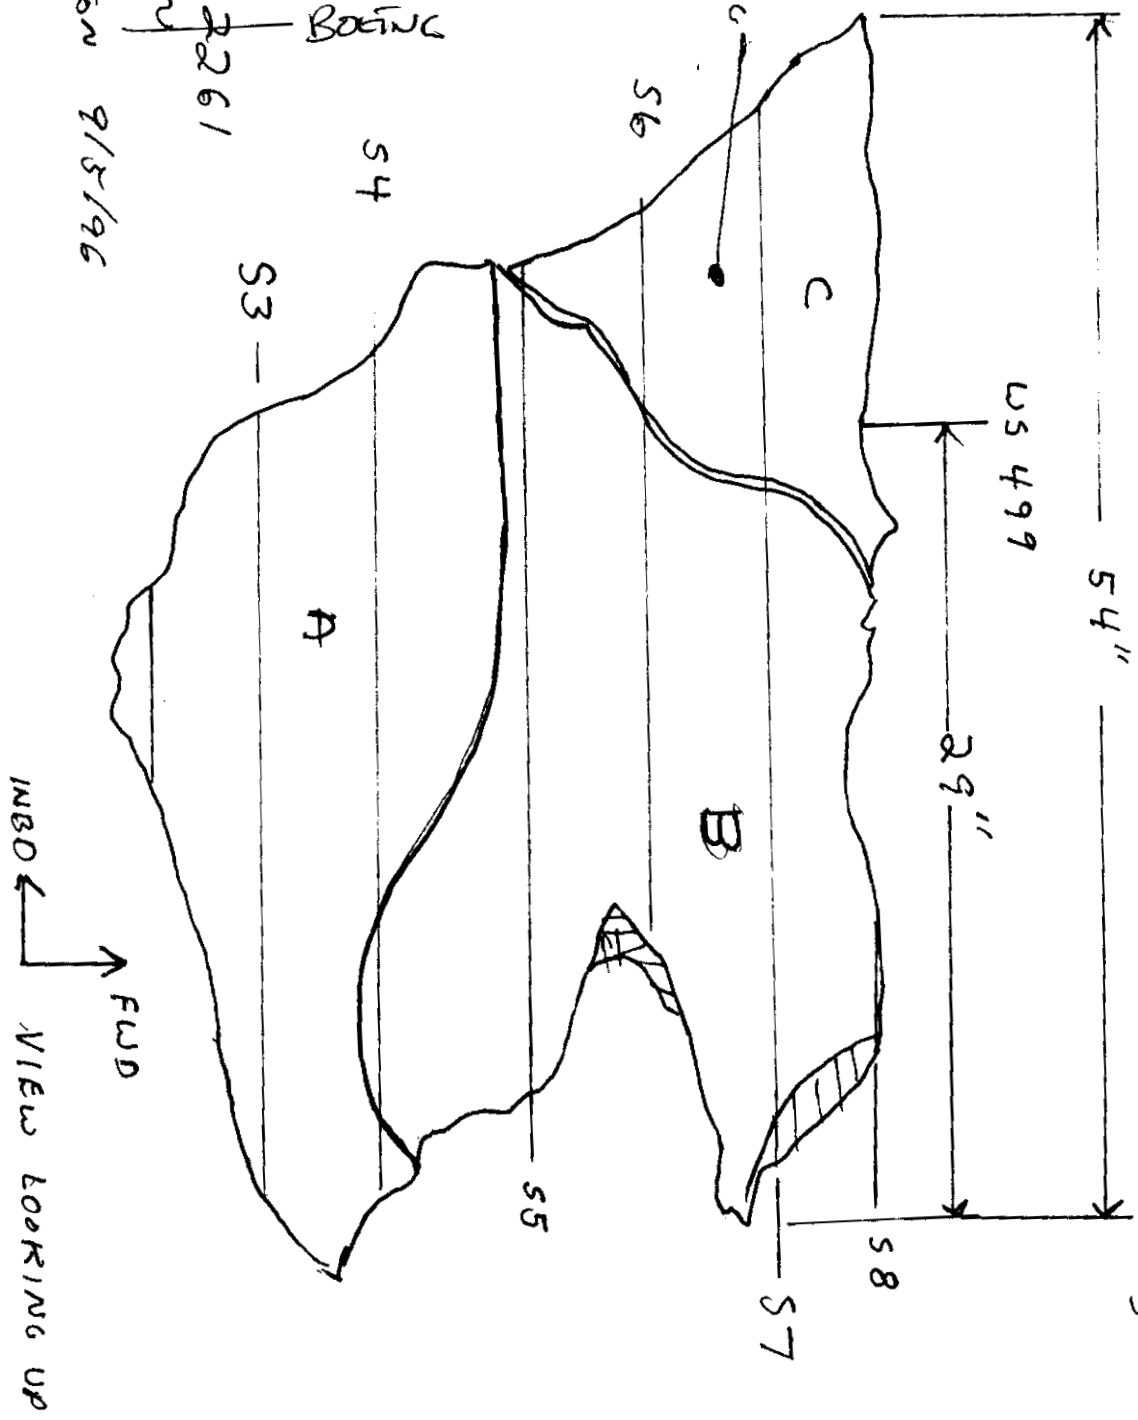

LW 28  
UPPER SKIN PANEL

ENGR.			REVISED	DATE	<b>BOEING</b>
CHECK					
APR					
APR					

# LW28

- A) SMALL PIECE OF UPPER WING SKIN LOCATED AT W.S. 499 NEAR REAR SPAR. PIECE IS FLAT, WITH RANDOM DUCTILE FRACTURES. NO STRINGERS ATTACHED. NO SMOKE OR FIRE DAMAGE.
- B) SMALL PIECE OF UPPER WING SKIN FROM W.S. 499 TO W.S. 528. FROM STRINGER 4 TO STRINGER 7. PART IS FLAT AND HAS NO STRINGERS ATTACHED. PANEL IN VENT AREA BETWEEN STRINGERS 6 AND 7 IS CLEAN WITH NO SOOT OR FIRE DAMAGE.
- C) SMALL PIECE OF WING SKIN, UPPER PANEL FROM W.S. 499 & W.S. 463 AND FROM STRINGER 5 TO STRINGER 7. PART IS FLAT WITH NO STRINGER ATTACHED. VENT STRINGER AREA BETWEEN STRINGER 6 & 7 IS CLEAN. NO SMOKE OR FIRE DAMAGE.

R. L. WHITTINGTON - BOEING  
9/5/96

S. GREEN 11-16-86 - ALPA

Dennis Santiago 11-7-96 - TAM

M. J. [unclear] 12/13 - TWA

John Zaffarano 10/22/96 - TAA

- NSB

ENGR.			REVISED	DATE		
CHECK						
APR						
APR						
					<b>BOEING</b>	