


067

AS OF 9/15/96
LOCATION OF THIS
PANEL IS BEST POSSIBLE
ESTIMATE.
75% SURE OF
POSITION
PLAN

LW30

SW/PCEN - ALPA
11/17/96
Dhantag - FOM
M/S/PCEN - TWA
10/28/96
Foulyus - ITPA
10-28-96
- NISB

WHITTINGTON
9/15/96
- BOEING

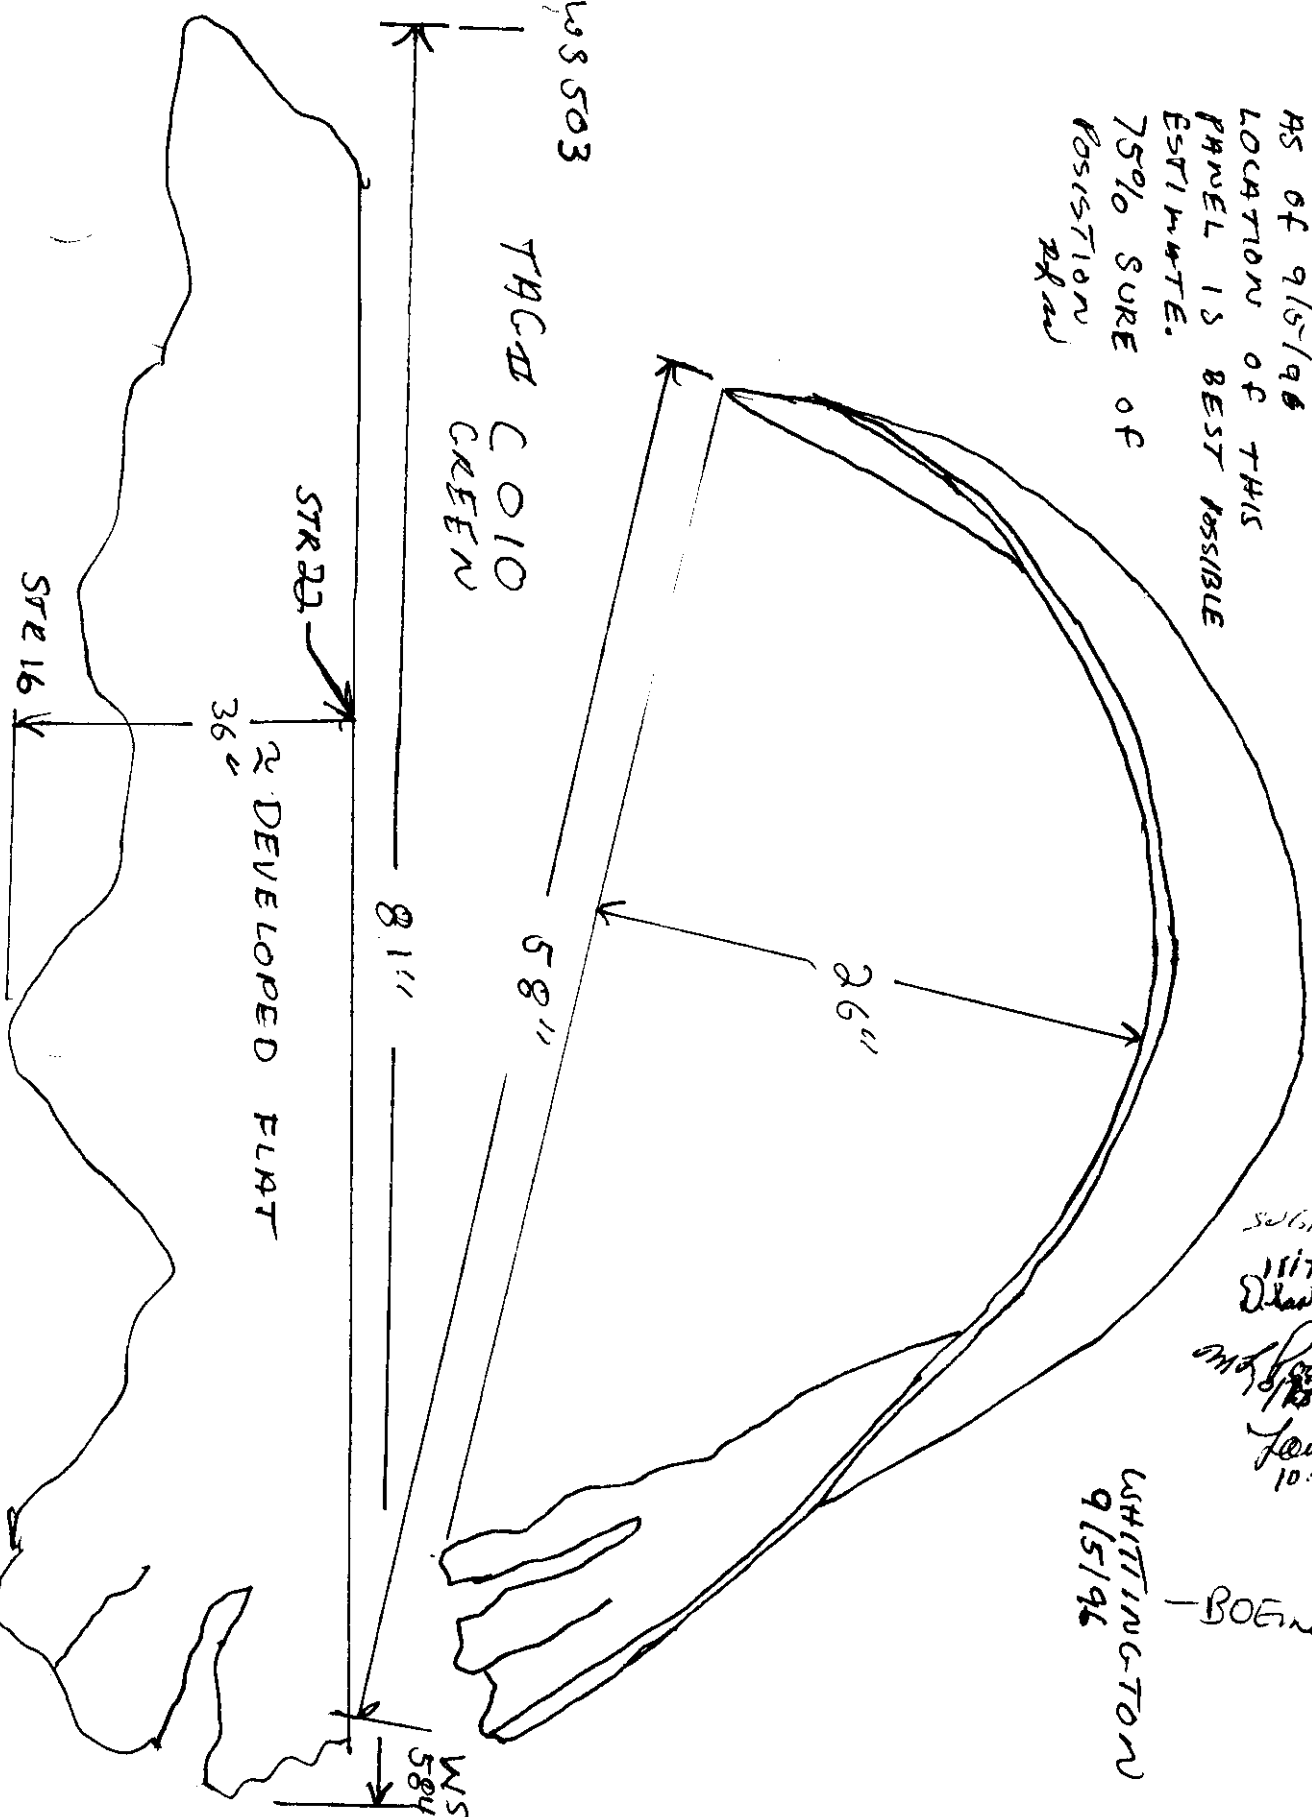

ENGR.	REVISD	DATE		
CHECK				
APR				
APR				
			BOEING	

LW30

UPPER WING SKIN

THIS IS A PIECE OF UPPER WING SKIN FROM W.S. 503 TO 584 AND FROM STR 16 TO STR 22. * PANEL HAS NO STRINGERS OR IDENTIFYING MARKS. PANEL IS BENT IN NEARLY CONSTANT RADIUS BEND OF 26" WITH AFT EDGE TWISTING OUT. NO SMOKE OR FIRE DAMAGE, ALL EDGES ARE DUCTILE STATIC FRACTURES.

* LOCATION OF PANEL IS NOT DEFINATE, AS MORE PIECES COME IN LOCATION MAY BE REFINED.

R.L. WHITTINGTON - BOEING
9/6/96

[Signature] - TWA
7/9/96

[Signature] - FAA
10-28-96

- NTSB

SD GREEN - ALPA
11-16-96

[Signature] - TAM
11-7-96

ENGR.			REVISED	DATE		
CHECK						
APR						
APR						
					BOEING	