


SEE ADDITIONAL COMMENTS

LEFT WING

LW-50

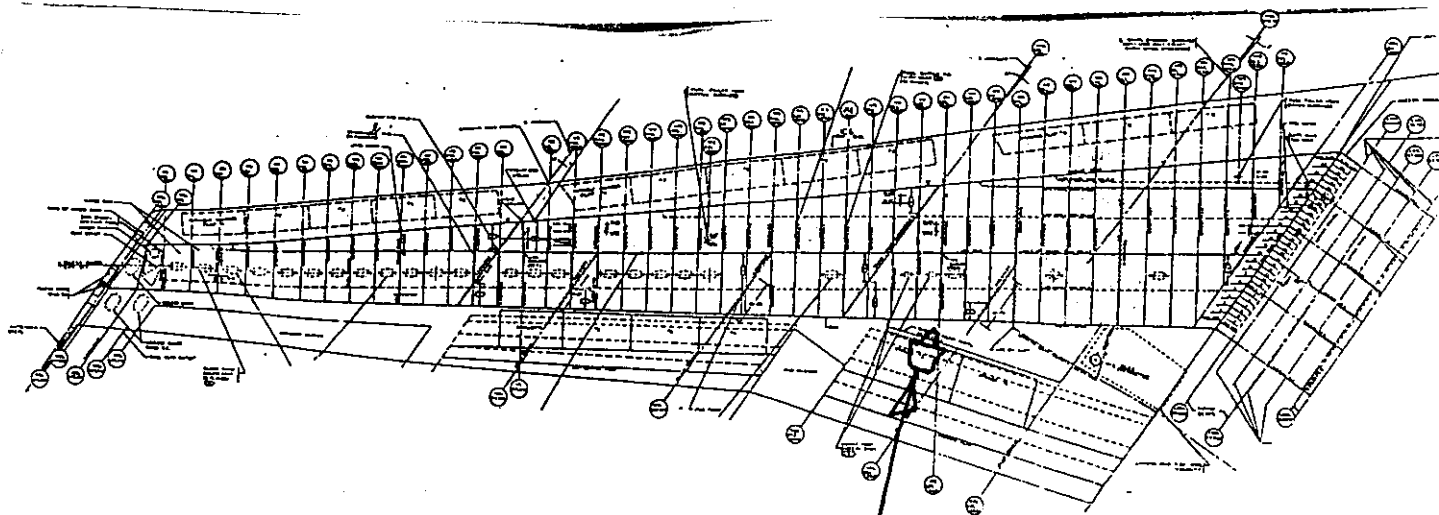

LOG# LW-50

TARGET# Z2544


COORDS: LAT _____

LONG _____

REFER FIRE AND EXPLOSION GROUP NOTES FOR FIRE DAMAGE

DEBRIS FIELD GREEN

SPOILER #5 WITH ACTUATOR IN RETRACTED POSITION. A 2 FT X 2 FT SECTION OF THE SPOILER PANEL REMAINS ATTACHED TO THE ACTUATOR ATTACH FITTING. THE REMAINDER OF THE SPOILER PANEL IS TORN OFF INCLUDING THE HONEYCOMB CORE. THE BOTTOM HALF OF THE ACTUATOR FITTING ON THE SPOILER SUPPORT BEAM IS TORN OFF. ALL TEARS AND FRACTURES LOOK LIKE IMPACT DAMAGE.

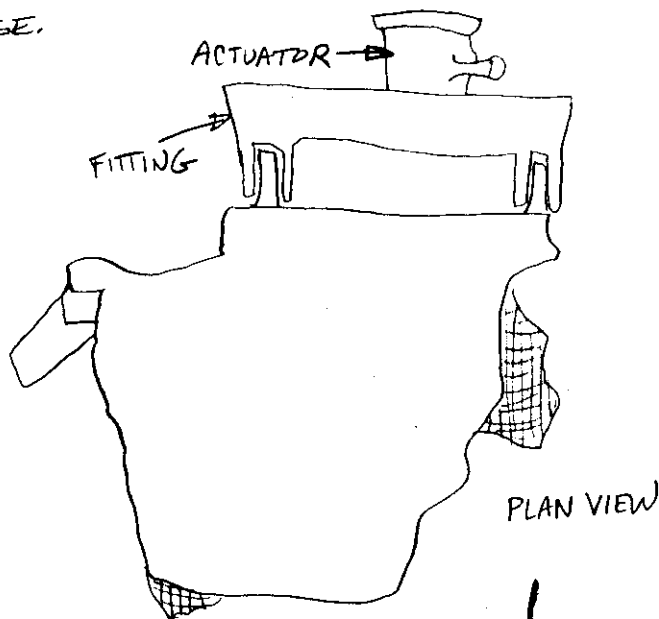

D. ORTH - BOEING
10/23/96

My Alpha - TWA
10-30-96

SD GREEN - ALPA
11-7-96

Stephen F. Klopuch 11-3-96
FBI - 10-28-96
NO Photo

D. Lantieri IAM 11/7/96

ADDITIONAL COMMENTS

LW-50 Additional Comments

1. Piece exhibits no soot or burn damage
whatsoever. — ON SPOILER. POSSIBLE OR SOOT ON
ATTACH FITTING.

S.D. GREEN ALPA

11-17-96

~~ALPA~~ ALPA
12-6-96

Thelberg
Tues 12-6-96

Dennis Hartig IAM
12-6-96

S. Little

BOEING
6 DEC 96

Tom Todaro
FAA 12-6-96