RUDDER

LOWER RUDDER SECTION LOC'N = FLOATER BLUE TAG # E 2034 FBI = N/A PART DATED' 7/19'


REFER FIRE AND EXPLOSION GROUP NOTES FOR FIRE DAMAGE


LOWER SECTION OF PUDDER MEASURES APPROX 28" XEZ" FROM RUDDER STA BLB TO 107.75, PART DOES NOT QUITE REACH TRAILING EDGE - SEE SKETCH. AN AKEA OF THE LHS SKIN IS NOT ATTACHED BETWEEN RUSTA 82.8 & 95.27. OUTER SKINS HAVE CRACKING, PUNCTURES, SURFACE ABRASIONS WITH SOME EXPOSED HONEY COMB PORTIONS OF RIBE AT RU, STA'S BZ. 8 & 95,2 REMAIN HITTACHED.

Meplo 12-16-96

-ALPA KHANOWER TEC Denis Sontingo I Am 12/13/96 12-16-96

Stephen F. Klupach SIL FAM

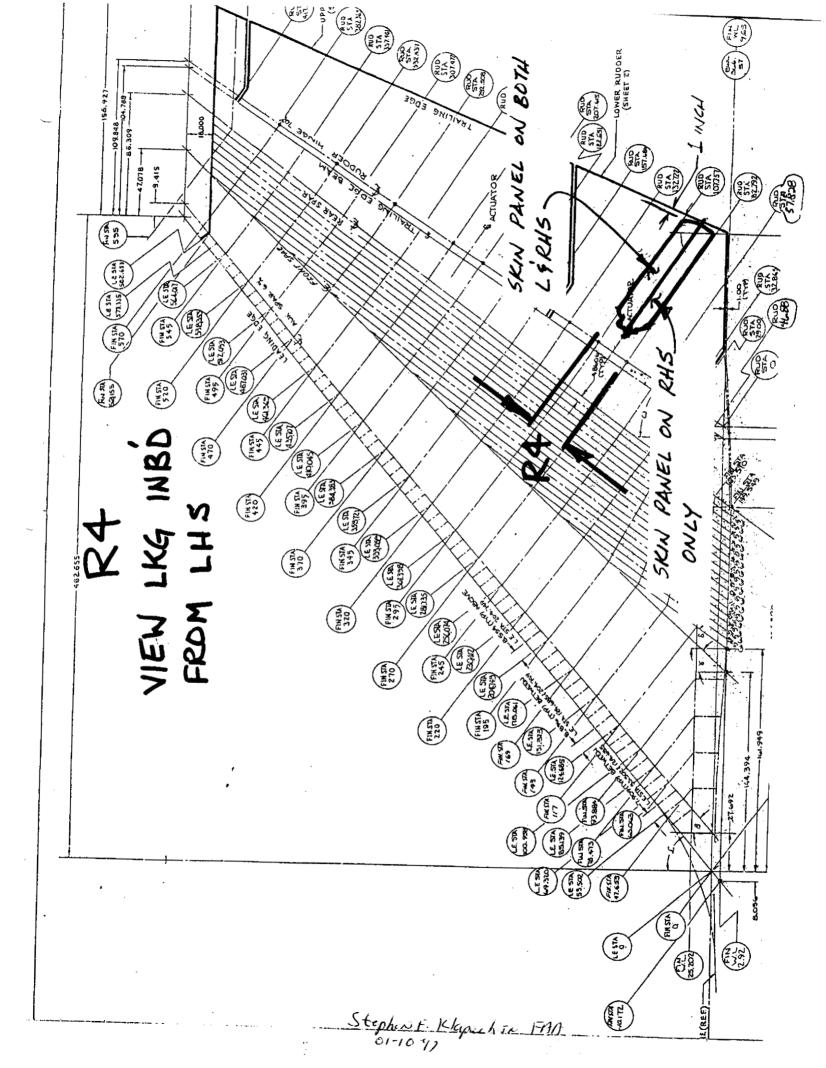

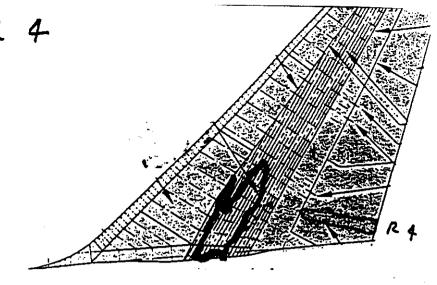

R-A Lower Rudden (FLOAT)

Lower Section of Rudden Measures Approximately

21' × 64"

Encompasses Rusta 107.757 & Rusta 82.792

Prece is Ripped-Cracked & Torn of All Station

Honey Comb is Encompasses

Honey Comb is Exposed in Some AREAS.

PREPAREL MISSING

- RUSTA 107.757


PROSTA 107.757

PROSTA 107.757


95,275 APPL

- RUSTA 82.792.

Stephen F Klupuch or FBN 12-02-96

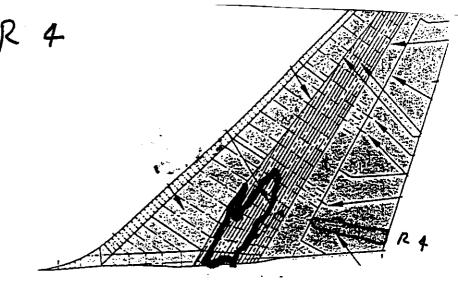

R-A. Lower Rudden (FLORT) BLUE TAGE E 2034
Lower Section of Rudden Minsukes Approximately
21 x th 28x82
Encompasses Rusta 107.757 & Rusta 82.792
Piece is Ripped-Cracked & Torn of All Station
Honey Comb is Exposed in some AREAS.

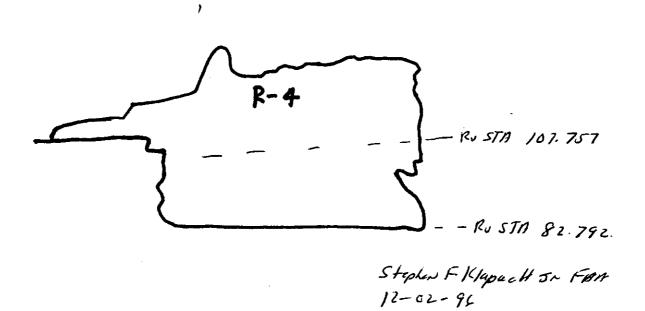

1,8635514:2

and the second s

4 (1 the 2

· ,

.

Section

Additional Information

Lower rudder from rudder station 82.792 to 107.757 approximately 64 inches from trailing edge running forward. An area of right left skin panel is not attached. Portions of ribs at rudder stations 82.792 and 95.275 remain attached. Outer skins have cracking, punctures, and minor surface abrasions.

Stephen F. Klupuch Jr FAR 01-10-47