

LOG #

RF-31

RTS
8/13/96

TARGET #

B2014

COORD: LAT

LONG

DEBRIS FIELD
8/4/96-64

NOT YELLOW

AVAILABLE

SKIN STA 1480 → 1547

STR'S 27R → 36R

§ STA 1480 BULKHEAD SEGMENT

- NO OBVIOUS SIGNS OF FIRE DAMAGE NOR SOOT
THRU-OUT BULKHEAD AND SKIN

- SKIN IS MANGLED OUT OF PLANE AND WHICH
COULD BE FUNCTION OF TRANSPORTATION

Villalobos
Text 10-11-96

SK FAA


Tom Tachno
FAA-10/17/96

Dennis Santiago IAM
10/18/96

Pg 1 of 3


2 R. Hanauer 10/18/96

RF-31

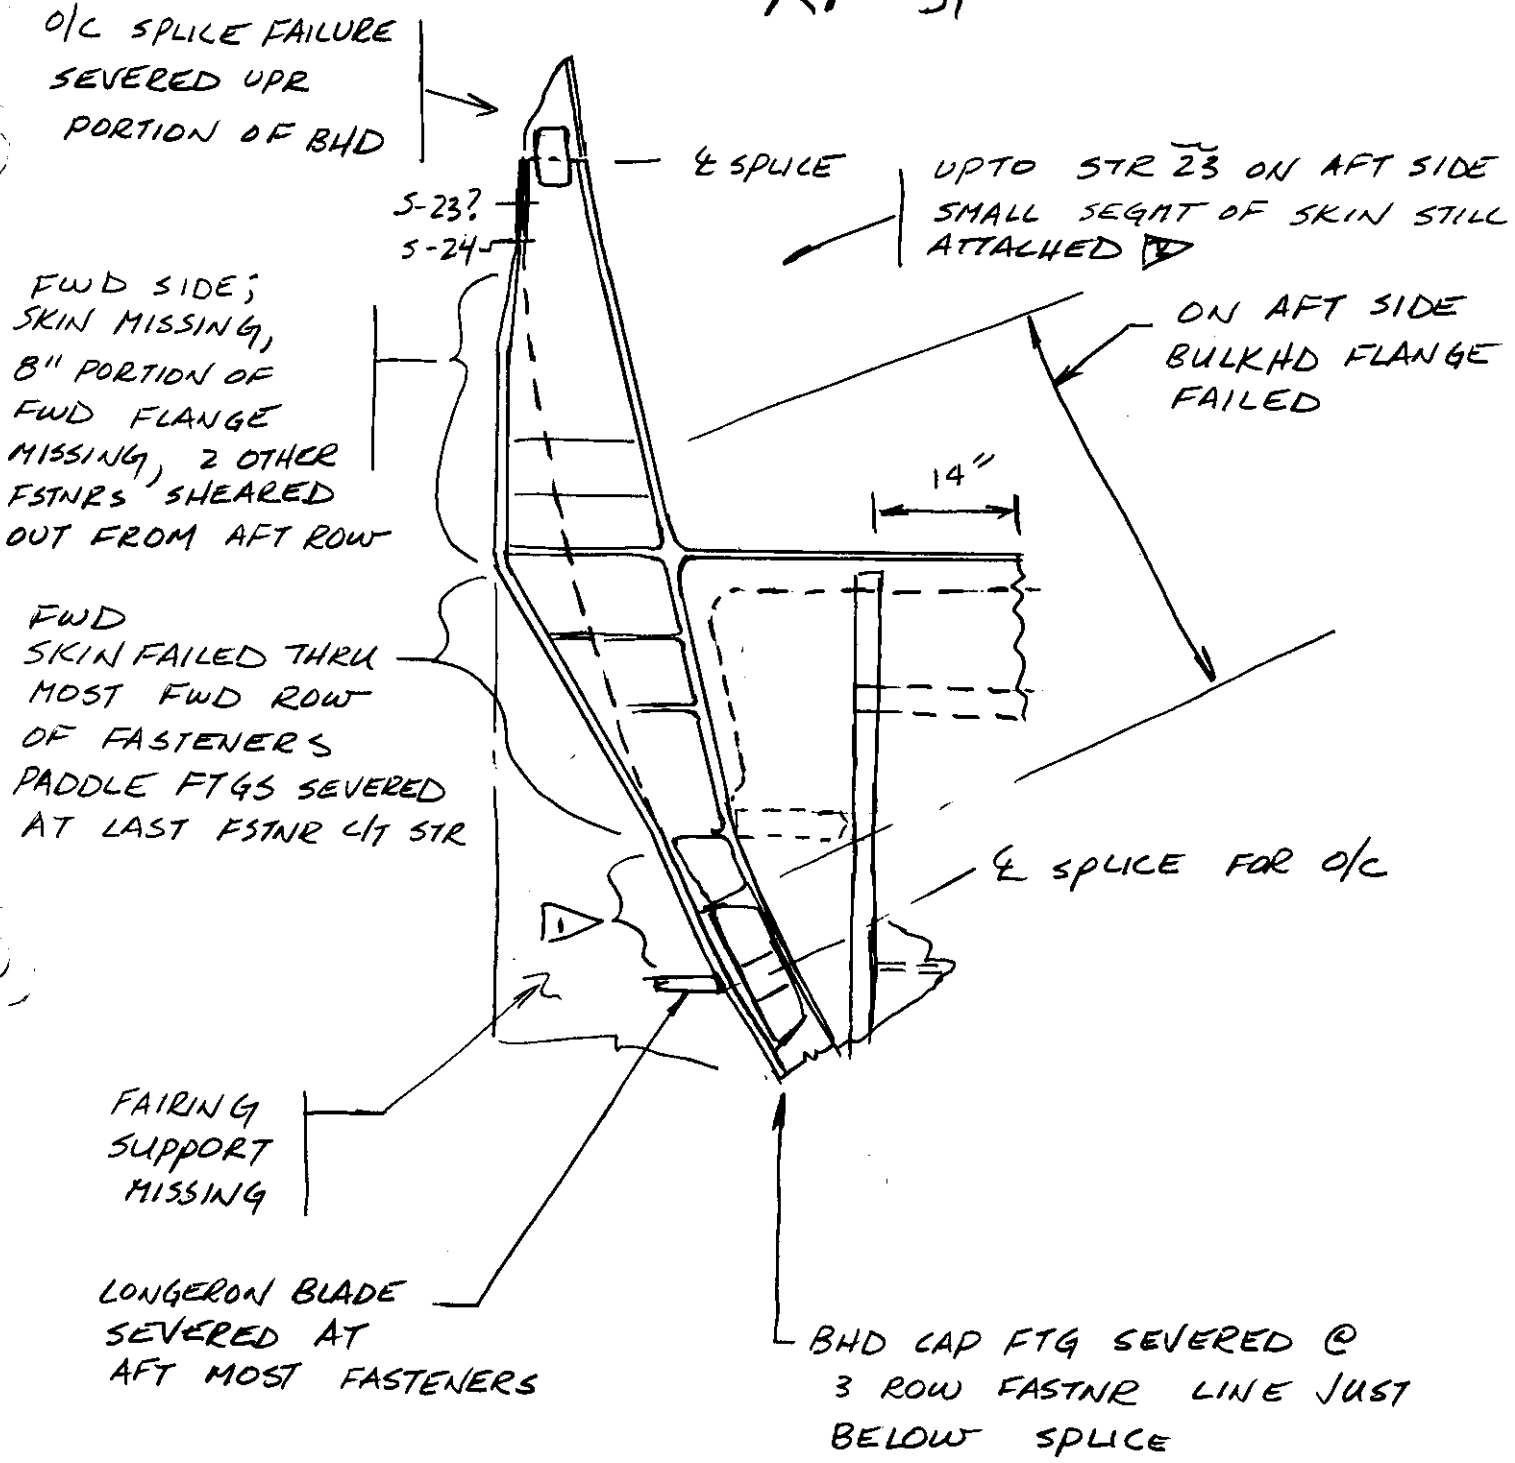

1 FWD FLANGE OF BULKHD SEVERED THRU AFT ROW OF FASTENERS CIT SKIN

2 THIS SKIN SEGMENT FAILED W/ ANGLED FRACTURE SURFACE THRU AREA W/O FASTENER HOLES

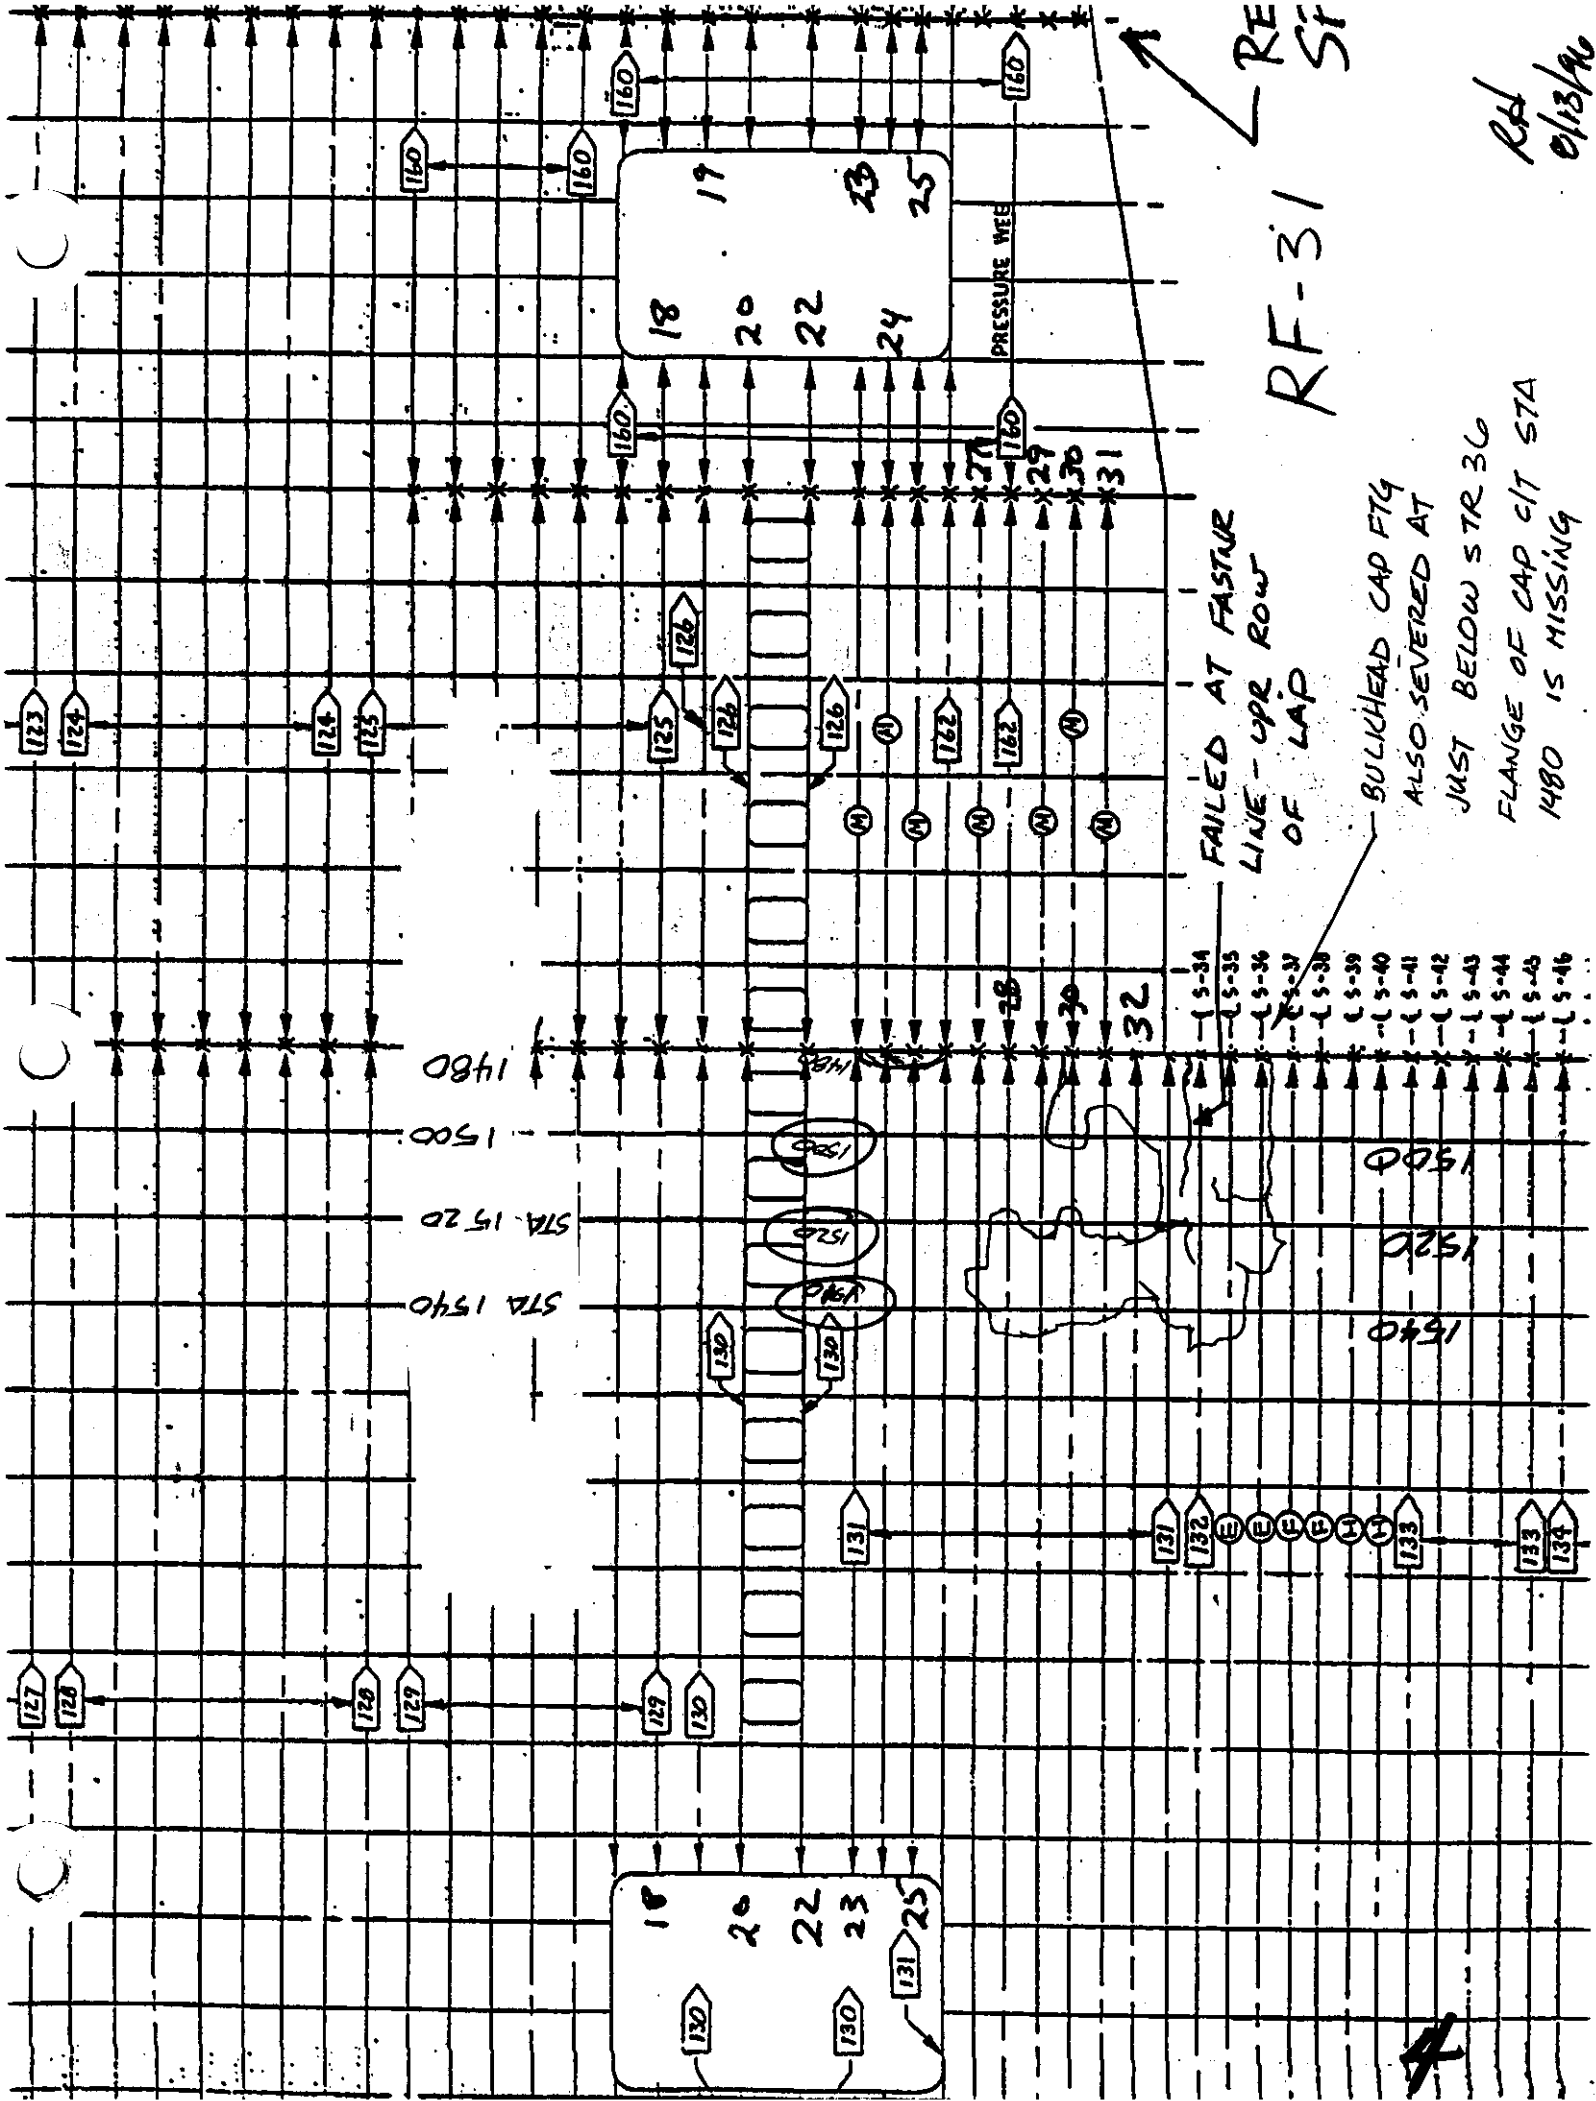

RF-31
RE SI

RA
01/13/90

FAILED AT FASTUR
LINE - UPR ROW
OF LAP

BULKHEAD CAP FT4
ALSO SEVERED AT
JUST BELOW STR 30
FLANGE OF CAP C/T STA
1480 IS MISSING

1480
1500
STA 1520
STA 1540

1500
1520
1540

