

LOG # RF45-G

TARGET # C2133

COORD: LAT \_\_\_\_\_  
LONG \_\_\_\_\_

Station 1800 - 1820

DEBRIS FIELD Green #1  
8/23/96-15

Piece of Aft CGO Door Approximately Measures  
25" x 17" Located at Fwd Edge of Door  
& goes aft, it Encompasses Mid Section Latch  
CAM & part of The Torque Tube.

Severe Deformation, Skin severely curled  
outward, Birt cracked crushed & Rivets  
MISSING

09-18-96

Stephen Klapach  
FAA

Tom Todd  
FAA 10-10-96

W. J. [Signature]  
TWA 10-11-96


Henry Missel  
Boeing  
9-21-96

2

11/15




MAINTENANCE MANUAL

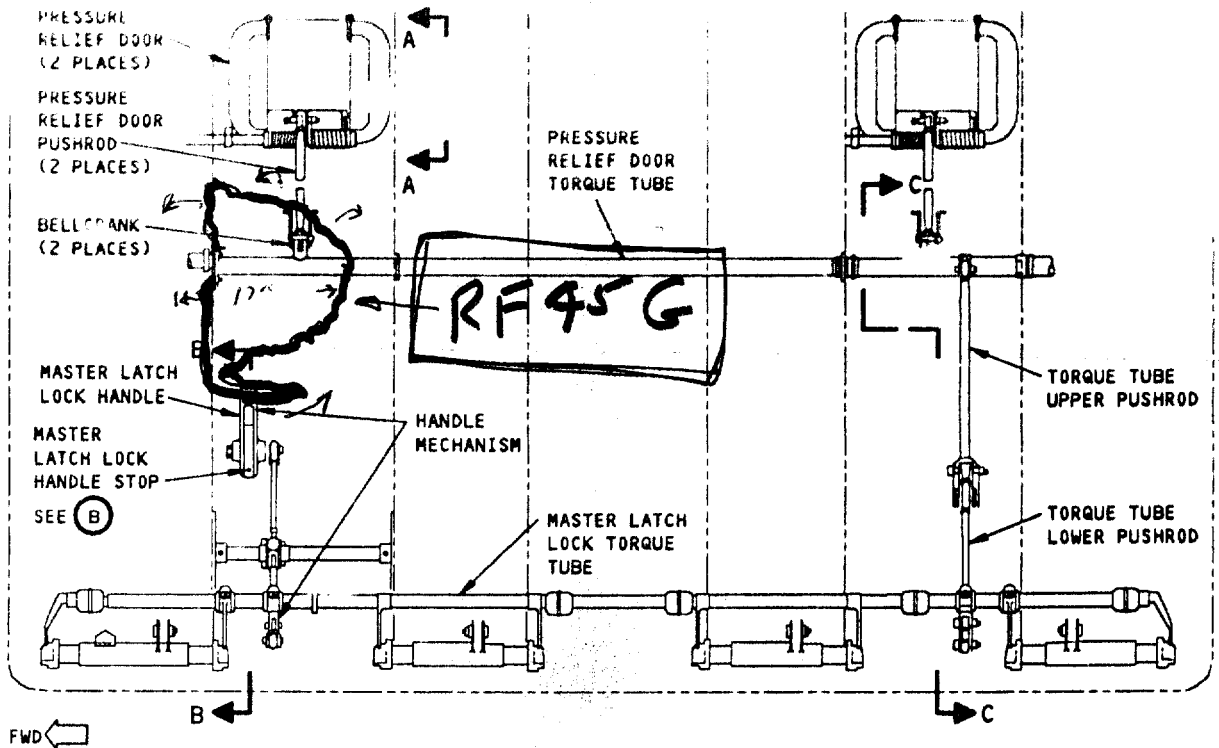

MASTER LATCH LOCK MECHANISM

(A)

S. Klapach  
FAA  
9-18-96

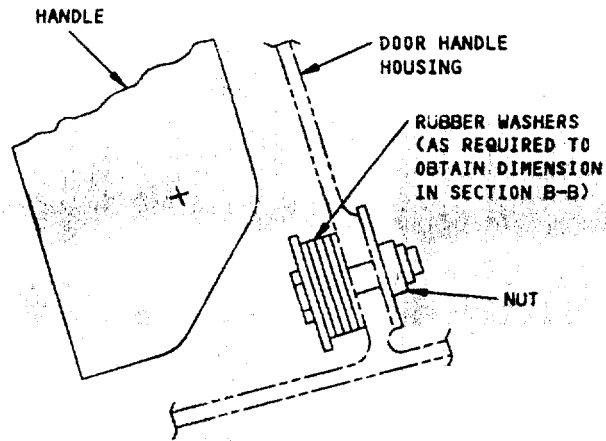

MASTER LATCH LOCK HANDLE STOP

(B)

Master Latch Lock Mechanism  
Figure 501 (Sheet 2)


12/15

EFFECTIVITY	
	ALL

52-34-00


02.1

3

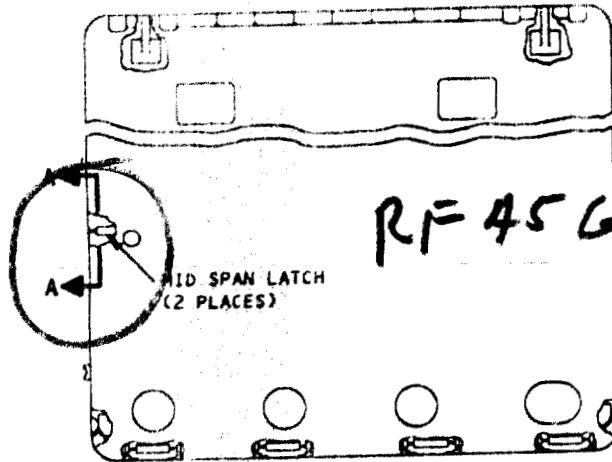

← FWD

S. Klapach  
FAA  
9-18-96

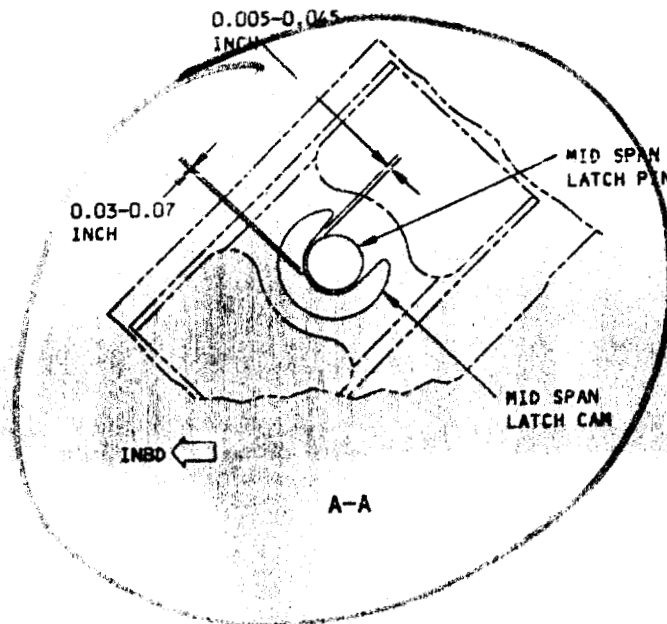

13/15

Midspan Latch Adjustment  
Figure 409

EFFECTIVITY 

ALL
-----

52-34-01

01.101

✚