

ian or Repair

Turned

Agnes

Flight

YEAR:

RECORDING
TACH
TIME

TODAY'S
FLIGHT

TOTAL
TIME IN
SERVICE

Description of Inspections, Tests, Repairs and Alterations
Entries must be endorsed with Name, Rating and Certificate No.

DATE

N7665S
Tach: 1040.0
T.T. : 2300.8
05/02/18

Performed Annual inspection. Cleaned & lubed aircraft.
Checked ELT IAW FAR 91.207(d). Replaced 6 ea. Cowling nut plates.
Lubed tail wheel & checked bearings.
C/W AD 2000-25-02R1 inspection of wood spar.
C/W AD2009-22-02 Inspection of rear seat. All Ad's checked.

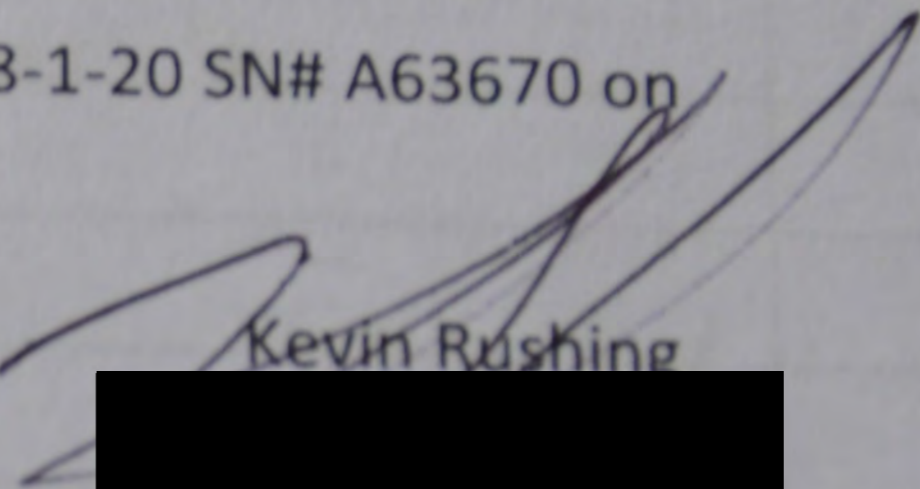
I certify that this aircraft N7665S has been inspected in accordance with
An Annual Inspection and was determined to be in an airworthy condition.

Rushing Aviation
[Redacted]
Marks, MS 38646

Kevin Rushing
[Redacted]

n or Repair

DESCRIPTION OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS

DATE	TACH TIME	DESCRIPTION OF WORK	SIGNATURE
	N7665S Tach: 1082.9 TSPN 0.0 01/30/19	Installed this Propeller PN# 74DM6S8-1-20 SN# A63670 on N7665S. Run up operation normal.	 Kevin Rushing
	Rushing Aviation [REDACTED]		[REDACTED]
	Marks, MS 38646		

ENG. SER.

AIRWORTHINESS DIRECTIVES

NC

DATE
19__

DIRECTIVE

GIVE A BRIEF DESCRIPTION

SIGNATURE AND CERTIFICATE NO.
QUALITY

N7665S

Tach: 1040.0

TSOH: 1040.0

05/02/18

Performed Annual inspection. Comp 80/ 1/79 2/77 3/77 4/78
Changed Oil & filter CH48108-1 & aeroshell 15W50. Cut open filter no discrepancies found.
Checked timing, Cleaned & gapped spark plugs. Cleaned fuel screen.
Replaced intake air filter BA8103-1. Run up no leaks noted. All Ad's C/W.

I certify that this Engine has been inspected in accordance with
An Annual Inspection and was determined to be in an airworthy condition.

Rushing Aviation

Marks, MS 38646

Kevin Rushing

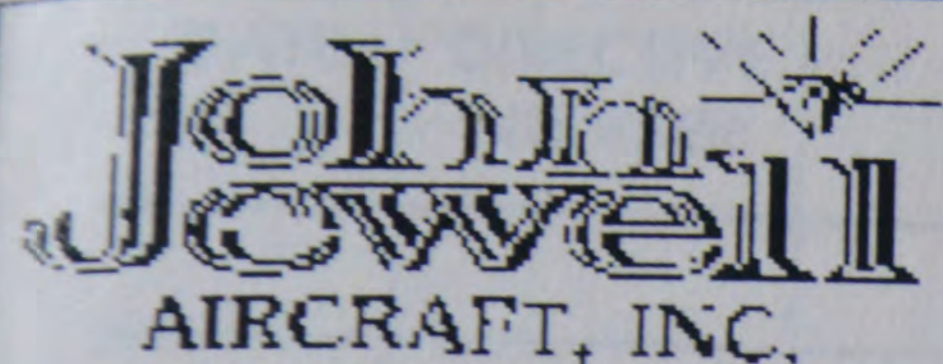
ENG. SER.

John Jewell AIRCRAFT

Engine Overhaul
model IO-320
standards as per
following parts
bearing; 8 #9
#SL12186; 1
#72970 Serv
Superior Cyl
#SL-STD119
harness set;
cylinder nut
#STD2213
1 #SL6875
Continued c

ENG. SER.

AIRWORTHINESS DIRECTIVES



Holly Springs Marshall Co. Airport

Holly Springs, MS 38635

DATE NO.
FACILITY

Page 1

Engine Overhauled by JOHN JEWELL AIRCRAFT, INC., Holly Springs, Mississippi W/O# J7161 engine model IO-320-E2A engine s/n L-4984-55A, engine disassembled, all steel parts magnafluxed checked standards as per LYCOMING Overhaul Manual. 1 Crankcase S/N 2377. Engine reassembled using following parts: 4 #SL11020M03 bearing; 2 #SL13884A-M03 front main bearing; 8 #SL61662A-M06 rod bearing; 8 #SL78027 rod bolt; 1 #13S19646 crank gear; 4 #71577 sludge tube; 1 #STD1211 plug; 8 #72970 Serviceable vacuum pump gear; 1 #149-12XLT Starter S/N H-S073062; 4 #SL32006W-A21P Superior Cylinder Kits S/N 326W-L18-19817, 326W-L18-19807, 326W-L18-19805 & 326W-L18-19819; 4 #SL-STD1196 intake hose; 4 #STD2180 hose; 8 #SL74637 bushing; 1 #REM40E spark plug; 1 #M2364 harness set; 1 #69371-1 gasket set; 1 #AEL77808 oil relief valve; 16 #STD2090 cylinder nut; 16 #SL383B cylinder nut; 1 #SL1028B ball; 1 #61084 spring; 6 #STD2013 thru bolt o-ring; 8 #LW25-1.50 bolt; 1 #STD2213 bolt; 2 #73413 Serviceable push rods; 4 #STD1727 mag washer; 24 #STD1925 valve cover screw; 1 #SL68759 oil drain tube; 1 #CL1107 Oil Filter Adapter Gasket - Casper Labs; 1 #76098 Camshaft

Continued on page 2

PERIODIC INSPECTION RECORD



Holly Springs Marshall Co. Airport

Holly Springs, MS 38635

Certified by A/C Specialties W/O# 252143. 8 #72877 Lifters Certified by A/C Specialties W/O# 251743. 4 #78030 Rods rebushed by A/C Specialties W/O# 251879. 1 #10-51360-37 Magneto S/N 2010579 O/H by A/C Accessories W/O# 30337. 1 #10-51360-29 Magneto S/N 836302 O/H by A/C Accessories W/O# 30338. 1 #2524232-2 Flow Divider S/N M660 & 1 #2524723-8 Servo S/N 42009 O/H by Mike's A/C Fuel Metering W/O# 29894. (1) Certified Crankcase Out-right by Divco W/O# 123078. Crankshaft installed dowel pin per SB475C by A/C Specialties W/O# 252112. Accessory Case modified to C/W one piece cam. MSB524 "Oil Pump" P/C/W. C/W AD2004-10-14C "Crankshaft" by replacement of bolt and dowel pin. C/W AD2015-19-07 "Fuel Injector Lines" by inspection. Engine Run On Test Cell.

MAINTENANCE RELEASE

MAKE LYCOMING SERIAL NO. L-4984-55A MODEL IO-320-E2A TOTAL TIME UNKN

THE ENGINE IDENTIFIED ABOVE WAS REPAIRED AND INSPECTED IN ACCORDANCE WITH CURRENT FEDERAL AVIATION REGULATIONS AND WAS FOUND AIRWORTHY FOR RETURN TO SERVICE. PERTINENT DETAILS OF THE REPAIR ARE ON FILE AT THIS AGENCY UNDER WORK ORDER NO. J7161 DATE: 01-11-2019

SIGN: [Redacted] FOR REPAIR STATION NO. [Redacted]

WARRANTY VOID IF AUTO FUEL IS USED!!!

ENG. SER.

PERIODIC INSPECTION RECORD

NC

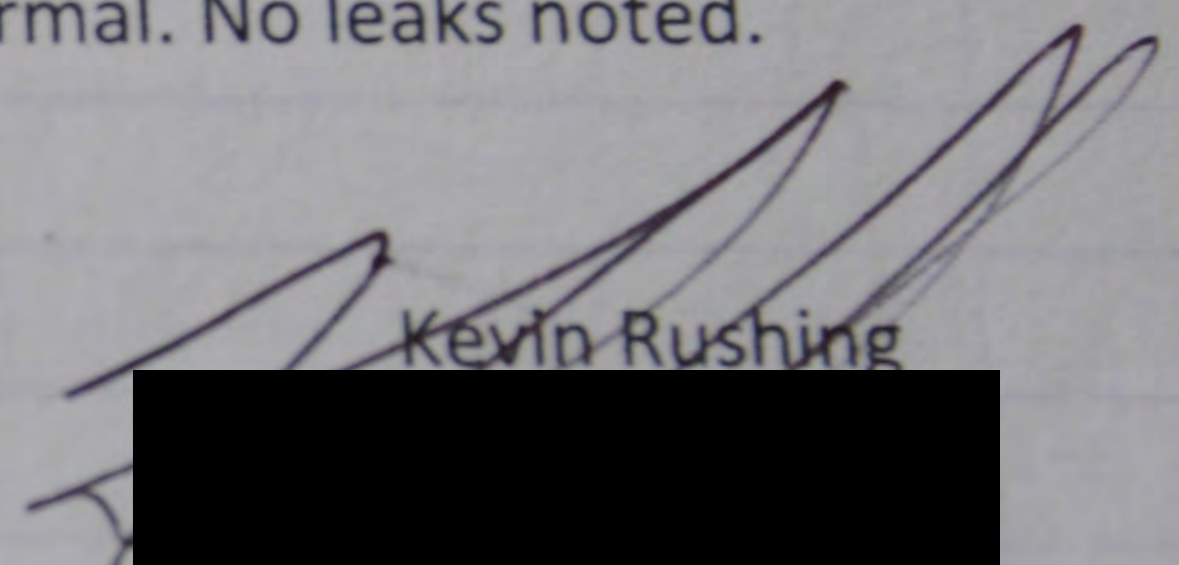
DATE	TOTAL TIME	COMPLIANCE CONDITION, REPAIR, REPLACEMENT, ETC.	SIGNATURE AND CERTIFICATE NO OF MECHANIC OR REPAIR FACILITY
------	------------	--	--

N7665S
Tach: 1082.9
TSMOH: 0.0
01/30/19

Installed engine after overhaul by John Jewell Aircraft.
Pre-oiled engine. Serviced with Aeroshell100. Installed with new
Engine shock mounts PN#J-6230-1. Replaced oil temperture probe.
Replaced Aternator bracket & alternator belt. Performed runs
Adjusted idle & idle mixture. Operation normal. No leaks noted.

Rushing Aviation

[REDACTED]
Marks, MS 38646


[REDACTED]
Kevin Rushing

284.6 HRS