


*Week. 44. 2001 Dry Dock Bremerhaven*

1. WORKERS FROM THE YARD START DISMANTLING EVAP.# 11 -12
2. CHANGE GASKET ON LEAK FLANGE , RETURN FROM ST-ST.GEN. AFT.ENG.ROOM.
3. CHANGE GASKET ON LEAK STEAM VALVES TOP DEAREATOR.
4. START CLEANING LP. FEED WATER TANK FORWARD ENGINE ROOM.
5. HOTEL WORKERS CLEANING IN FWD. AND AFT FUNNEL.
6. START OVERHAULING AND CHANGED GASKET ON STEAM VALVES ,AFT BOILER ROOM AND FORWARD ENGINE ROOM.
7. CLEANING AND REPAIR LEAK ON DRAIN TANK AFT ENGINE ROOM.
8. OVERHAULING AND CHANGE GASKET STEAM VALVES B-67 – B-59- F-68
9. CHANGE STEAM VALVE E-56 IN AFT ENGINE ROOM.
10. REPACKED STUFFING BOX ON DRAIN VALVES TG.LINE S/B-P/S AFT.ENG.ROOM.
11. CLEANING, CHECK OF VIBRATION DAMPERS AND CRANKSHAFT SEAL MAK.17/18
12. OVERHAULING OF STEAM VALVES, CLEANING AND MAINTENANCE, INCINERATOR.
13. YARD WORKERS AND ROSE START DISMANTLE S/B-P/S MANOEUVRE VALVES.
14. PRESSURE TEST OF INTERNAL DESUPER HEATER BOILER# 23 OK.
15. FILLED UP S/B-P/S MAIN CONDENSER STEAM SIDE FOR LEAKS ON THE FLANGE. PLUGGED TWO LEAK PIPES. S/B ONE PIPE ON P/S.
16. CLEANING OF FW. EXPANSION TANK FOR MAK, DIESEL.


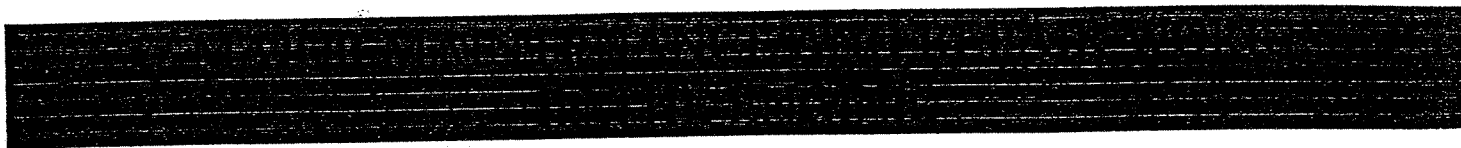


*Week .45. 2001 Dry Dock Bremerhaven*

- 1 YARD CONTINUING WORK WITH DISMANTLING OF EVAP.# 11-12
2. CONTINUING OVERHAUL, REPACK OF STEAM VALVES IN BOILER, FWD AND AFT ENG. ROOM.
3. FULL OVERHAULING OF DESUPER VALVES B-51 – B-52 BOILER #22
4. START CLEANING HEATERS FOR SEP. AND BOOSTER PUMPS MAK.# 17-18
5. HOTEL WORKERS CLEANING IN FWD. AND AFT FUNNEL.
6. OVERHAULING OF GEAR FOR TAKO.GEN.S/B-P/S MAIN TURBINE.
7. ROSE CONTINUING WITH OVERHAULING OF MANOEUVRE VALVES S/B-P/S.
8. FULL OVERHAULING OF FIRE PUMP. # 21
9. PLUGGED 3 PIPES ON P/S. MAIN CONDENSER.
10. PREFABRICATED PIPES FOR TRIMMING SYSTEM DISCHARGE AFT.
11. START CHANGE SHAFT COUPLING ON MAK # 16
12. SUBCONTRACTORS START WORKING WITH HIGH FOG IN THE ENGINE ROOM.
13. SKJØNHAUG DISMANTLING BEARINGS FW. S/B LP.TURBINE FW.ENGINE ROOM.
14. M.T.S. STARTED GRINDING, POLISHING OF CHAFT LP.TURBINE S/B-P/S.
15. PRESSURE TEST OF HEATING COILS FO.TANKS # 4-9 AND 4-13
16. REPAIR HOT WATER LINE FORWARD BOILER ROOM P/S.
17. YARD MOUNTED TWO EVAPORATORS IN FORWARD ENGINE ROOM.

*Week 46. 2001 Dry Dock Bremerhaven*

1. YARD CONTINUING WORK WITH EVAPORATOR # 11-12 IN FORWARD ENG.ROOM.
2. PREFABRICATED SW. PIPES FOR FRESH WATER COOLER MAK.# 12
3. CHANGE FUEL PUMPS CYL.# 2-6 MAK.#17
4. CLEANING NOZZLE COOLER FOR MAK.#17-18
5. HOTEL WORKERS CLEANING IN FWD. AND AFT FUNNEL.
6. CHANGING OF PENETRATION, FRESH WATER LINE BETWEEN FWD.ENGINE AND FWD. STAB.ROOM. P/S.
7. ROSE CONTINUING WITH OVERHAULING OF MANOEUVRE VALVES S/B-P/S.
8. OVERHAULED BOTTOM BLOW VALVES BOILER. # 23
9. MOUNTED NEW PIPE INLET ON DE SUPER HEATER BOILER. #23
10. YARD OVERHAULED FO. GATE VALVE S/B FORWARD BOILER ROOM.
11. FULL OVERHAULING OF S/B FWD. MAIN EJECTORS.
12. CLEANING AND CHECKING OF STARTING AIR TANKS FOR MAK. DIESEL.
13. OVERHAULED DRAIN VALVES ON HP. TURBINE S/B-P/S.
14. CHECKING OF BLEED VALVES ON MAIN TURBINE S/B- P/S.
15. OVERHAULED AND CHANGE GASKET ON LEAK FLANGE STEAM VALVE E-60
16. NEW COVER ON UPPER NON RETURN VALVE, MAIN SW. PUMP P/S.

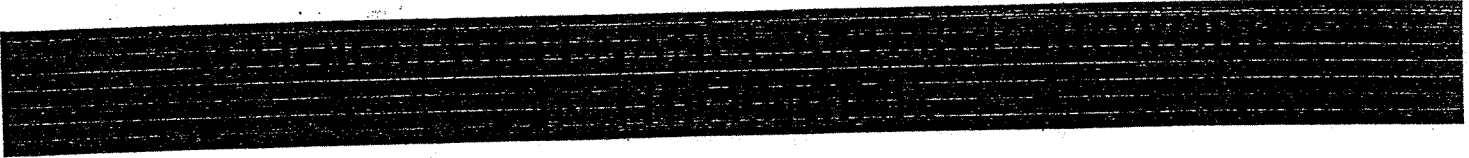

Nov 18 Week 47. 2001 Dry Dock Bremerhaven

1. YARD CONTINUING WORK WITH EVAPORATOR # 11-12 IN FORWARD ENG.ROOM.
2. FULL OVERHAULING OF EL.FEED WATER PUMP FOR MAIN BOILERS.
3. INTEC START REPAIR OF COVER FOR DEST.COOLER EVAP.# 21
4. REPAIR OF DRYER DRUM IN LAUNDRY.
5. HOTEL WORKERS CLEANING ON TANK TOP ENGINE ROOM.
6. TEST RUNNING STEERING GEAR. OK.
7. CHANGED FUEL GATE VALVE ON BUNKER LINE S/B IN ENGINE STORE.
8. REPAIR COOLING WATER LINE FOR MAIN BEARINGS S/B-P/S.
9. REPAIR LEAK HOT WATER HEATER P/S.
10. REPACKED STUFFING BOX ON DRAIN VALVES S/B HP.TURBINE.
11. FULL OVERHAULING OF P/S. FWD. MAIN EJECTORS.
12. REPAIR LEAK FLANGE ON SUPERHEATED STEAM LINE, FORWARD ENGINE ROOM.
13. PRESSURE TEST MAIN BOILER # 23 OK.