

DCA-08-MR-009
Metrolink – UP Collision
Chatsworth, CA
September 12, 2008

ATTACHMENT 7

Digicon Dispatch Logger Report

MARK-UP

Filter Title:

Position	Filter Type	Name	Norm/	Stdbby	A/B
_____	_____	_____	_____	_____	_____
_____	_____	_____	_____	_____	_____
_____	_____	_____	_____	_____	_____
_____	_____	_____	_____	_____	_____
_____	_____	_____	_____	_____	_____

User: _____

Mode: _____

Region: VENTURA _____

Location: DAVIS— TOPANG— BRNISON— _____

Train: _____

Device Number: _____

Message Type	Message Subtype
_____	_____
_____	_____
_____	_____
_____	_____
_____	_____

Date	Time	Position	ID	Mode	Reg.	Location	Dev.	Msg. Subtype	Msg. Type	ID
9/12/08	3:00:46P	WRK 2	MRZ	DISP	VENTURA	BRNSON	29	OFC TK LOCK	LOCKING	
9/12/08	3:00:46P	WRK 2	MRZ	DISP	VENTURA	BRNSON	29	TK UNOCCUPY	INDICATION	
9/12/08	3:00:51P	WRK 2	MRZ	DISP	VENTURA	BRNSON	29	OFC TK UNLOCK	LOCKING	
9/12/08	3:03:27P	WRK 2	MRZ	DISP	VENTURA	BRNSON	30	OFC TK LOCK	LOCKING	
9/12/08	3:03:27P	WRK 2	MRZ	DISP	VENTURA	BRNSON	30	TK UNOCCUPY	INDICATION	
9/12/08	3:03:32P	WRK 2	MRZ	DISP	VENTURA	BRNSON	30	OFC TK UNLOCK	LOCKING	
9/12/08	3:10:07P	WRK 2	MRZ	QKRT	VENTURA	BRNSON	16	SG CLEAR	CONTROL	
9/12/08	3:10:29P	WRK 2	MRZ	DISP	VENTURA	BRNSON	16	SG CLEAR	INDICATION	
9/12/08	3:29:33P	WRK 2	MRZ	DISP	VENTURA	TOPANG	14	SG CLEAR	CONTROL	
9/12/08	3:29:33P	WRK 2	MRZ	DISP	VENTURA	DAVIS	12	SG CLEAR	CONTROL	
9/12/08	3:29:40P	WRK 2	MRZ	DISP	VENTURA	DAVIS	6	ENTR STACK	REQUEST	
9/12/08	3:29:40P	WRK 2	MRZ	DISP	VENTURA	DAVIS	25	EXIT STACK	REQUEST	
9/12/08	3:29:40P	WRK 2	MRZ	DISP	VENTURA	DAVIS	6	STACKING ON	CONTROL	
9/12/08	3:29:40P	WRK 2	MRZ	DISP	VENTURA	DAVIS	12	SG CLEAR	INDICATION	
9/12/08	3:29:44P	WRK 2	MRZ	DISP	VENTURA	TOPANG	26	ENTR STACK	REQUEST	
9/12/08	3:29:44P	WRK 2	MRZ	DISP	VENTURA	TOPANG	50	EXIT STACK	REQUEST	
9/12/08	3:29:44P	WRK 2	MRZ	DISP	VENTURA	TOPANG	7	STACKING ON	CONTROL	
9/12/08	3:29:47P	WRK 2	MRZ	DISP	VENTURA	TOPANG	14	SG CLEAR	INDICATION	
9/12/08	3:29:48P	WRK 2	MRZ	DISP	VENTURA	BRNSON	28	ENTR STACK	REQUEST	
9/12/08	3:29:48P	WRK 2	MRZ	DISP	VENTURA	BRNSON	30	EXIT STACK	REQUEST	
9/12/08	3:29:48P	WRK 2	MRZ	DISP	VENTURA	BRNSON	8	STACKING ON	CONTROL	
9/12/08	3:32:54P	WRK 2	MRZ	DISP	VENTURA	BRNSON	30	TK OCCUPY	INDICATION	
9/12/08	3:32:54P	WRK 2	MRZ	DISP	VENTURA	BRNSON	30	OCCUPIED	TRAIN MOVED	A775 12
9/12/08	3:35:47P	WRK 2	MRZ	DISP	VENTURA	BRNSON	29	TK OCCUPY	INDICATION	
9/12/08	3:35:47P	WRK 2	MRZ	DISP	VENTURA	BRNSON	29	OCCUPIED	TRAIN MOVED	A775 12
9/12/08	3:38:31P	WRK 2	MRZ	DISP	VENTURA	BRNSON	28	TK OCCUPY	INDICATION	

Date	Time	Position	ID	Mode	Reg.	Location	Dev.	Msg. Subtype	Msg. Type	ID
9/12/08	3:38:31P	WRK 2	MRZ	DISP	VENTURA	BRNSON	28	OCCUPIED	TRAIN MOVED	A775 12
9/12/08	3:38:31P	WRK 2	MRZ	SLOT	VENTURA	BRNSON	16	SG STOP	CONTROL	
9/12/08	3:38:32P	WRK 2	MRZ	DISP	VENTURA	BRNSON	16	SG STOP	INDICATION	
9/12/08	3:38:41P	WRK 2	MRZ	DISP	VENTURA	TOPANG	50	TK OCCUPY	INDICATION	
9/12/08	3:38:41P	WRK 2	MRZ	DISP	VENTURA	TOPANG	50	OCCUPIED	TRAIN MOVED	A775 12
9/12/08	3:38:51P	WRK 2	MRZ	DISP	VENTURA	BRNSON	29	OFC TK LOCK	LOCKING	
9/12/08	3:38:51P	WRK 2	MRZ	DISP	VENTURA	BRNSON	29	TK UNOCCUPY	INDICATION	
9/12/08	3:38:56P	WRK 2	MRZ	DISP	VENTURA	BRNSON	29	OFC TK UNLOCK	LOCKING	
9/12/08	3:38:59P	WRK 2	MRZ	DISP	VENTURA	BRNSON	30	OFC TK LOCK	LOCKING	
9/12/08	3:38:59P	WRK 2	MRZ	DISP	VENTURA	BRNSON	30	TK UNOCCUPY	INDICATION	
9/12/08	3:39:03P	WRK 2	MRZ	DISP	VENTURA	BRNSON	28	OFC TK LOCK	LOCKING	
9/12/08	3:39:03P	WRK 2	MRZ	DISP	VENTURA	BRNSON	28	TK UNOCCUPY	INDICATION	
9/12/08	3:39:03P	WRK 2	MRZ	DISP	VENTURA	BRNSON	9	OFC SW LOCK	LOCKING	
9/12/08	3:39:04P	WRK 2	MRZ	DISP	VENTURA	BRNSON	30	OFC TK UNLOCK	LOCKING	
9/12/08	3:39:08P	WRK 2	MRZ	DISP	VENTURA	BRNSON	28	OFC TK UNLOCK	LOCKING	
9/12/08	3:39:08P	WRK 2	MRZ	DISP	VENTURA	BRNSON	9	OFC SW UNLOCK	LOCKING	
9/12/08	3:39:08P	WRK 2	MRZ	STCK	VENTURA	BRNSON	15	SG CLEAR	CONTROL	
9/12/08	3:39:08P	WRK 2	MRZ	STCK	VENTURA	BRNSON	8	STACKING OFF	CONTROL	
9/12/08	3:39:33P	WRK 2	MRZ	DISP	VENTURA	TOPANG	27	TK OCCUPY	INDICATION	
9/12/08	3:39:33P	WRK 2	MRZ	DISP	VENTURA	TOPANG	27	OCCUPIED	TRAIN MOVED	A775 12
9/12/08	3:39:35P	WRK 2	MRZ	DISP	VENTURA	BRNSON	15	SG CLEAR	INDICATION	
9/12/08	3:39:35P	WRK 2	MRZ	DISP	VENTURA	TOPANG	9	OFC TK LOCK	LOCKING	
9/12/08	3:39:53P	WRK 2	MRZ	DISP	VENTURA	TOPANG	50	TK UNOCCUPY	INDICATION	
9/12/08	3:39:53P	WRK 2	MRZ	DISP	VENTURA	TOPANG	50	OFC TK UNLOCK	LOCKING	
9/12/08	3:44:46P	WRK 2	MRZ	DISP	VENTURA	TOPANG	26	TK OCCUPY	INDICATION	
9/12/08	3:44:46P	WRK 2	MRZ	DISP	VENTURA	TOPANG	26	OCCUPIED	TRAIN MOVED	A775 12
9/12/08	3:44:46P	WRK 2	MRZ	SLOT	VENTURA	TOPANG	14	SG STOP	CONTROL	
9/12/08	3:44:46P	WRK 2	MRZ	DISP	VENTURA	TOPANG	14	SG STOP	INDICATION	

Date	Time	Position	ID	Mode	Reg.	Location	Dev.	Msg. Subtype	Msg. Type	ID
9/12/08	3:45:05P	WRK 2	MRZ DISP	VENTURA	DAVIS	25 TK OCCUPY		INDICATION		
9/12/08	3:45:05P	WRK 2	MRZ DISP	VENTURA	DAVIS	25 OCCUPIED		TRAIN MOVED	A775	12
9/12/08	3:45:13P	WRK 2	MRZ DISP	VENTURA	TOPANG	27 OFC TK LOCK		LOCKING		
9/12/08	3:45:13P	WRK 2	MRZ DISP	VENTURA	TOPANG	27 TK UNOCCUPY		INDICATION		
9/12/08	3:45:18P	WRK 2	MRZ DISP	VENTURA	TOPANG	27 OFC TK UNLOCK		LOCKING		
9/12/08	3:45:18P	WRK 2	MRZ DISP	VENTURA	TOPANG	26 OFC TK LOCK		LOCKING		
9/12/08	3:45:18P	WRK 2	MRZ DISP	VENTURA	TOPANG	26 TK UNOCCUPY		INDICATION		
9/12/08	3:45:18P	WRK 2	MRZ DISP	VENTURA	TOPANG	8 OFC SW LOCK		LOCKING		
9/12/08	3:45:23P	WRK 2	MRZ DISP	VENTURA	TOPANG	26 OFC TK UNLOCK		LOCKING		
9/12/08	3:45:23P	WRK 2	MRZ DISP	VENTURA	TOPANG	8 OFC SW UNLOCK		LOCKING		
9/12/08	3:45:23P	WRK 2	MRZ STCK	VENTURA	TOPANG	13 SG CLEAR		CONTROL		
9/12/08	3:45:23P	WRK 2	MRZ STCK	VENTURA	TOPANG	7 STACKING OFF		CONTROL		
9/12/08	3:45:47P	WRK 2	MRZ DISP	VENTURA	TOPANG	13 SG CLEAR		INDICATION		
9/12/08	3:47:40P	WRK 2	MRZ DISP	VENTURA	DAVIS	17 TK OCCUPY		INDICATION		
9/12/08	3:47:40P	WRK 2	MRZ DISP	VENTURA	DAVIS	17 OCCUPIED		TRAIN MOVED	A775	12
9/12/08	3:47:49P	WRK 2	MRZ DISP	VENTURA	DAVIS	25 OFC TK LOCK		LOCKING		
9/12/08	3:47:49P	WRK 2	MRZ DISP	VENTURA	DAVIS	25 TK UNOCCUPY		INDICATION		
9/12/08	3:47:54P	WRK 2	MRZ DISP	VENTURA	DAVIS	25 OFC TK UNLOCK		LOCKING		
9/12/08	3:49:47P	WRK 2	MRZ DISP	VENTURA	DAVIS	6 TK OCCUPY		INDICATION		
9/12/08	3:49:47P	WRK 2	MRZ DISP	VENTURA	DAVIS	6 OCCUPIED		TRAIN MOVED	A775	12
9/12/08	3:49:47P	WRK 2	MRZ SLOT	VENTURA	DAVIS	12 SG STOP		CONTROL		
9/12/08	3:49:47P	WRK 2	MRZ DISP	VENTURA	DAVIS	12 SG STOP		INDICATION		
9/12/08	3:50:04P	WRK 2	MRZ DISP	VENTURA	DAVIS	17 OFC TK LOCK		LOCKING		
9/12/08	3:50:09P	WRK 2	MRZ DISP	VENTURA	DAVIS	17 OFC TK UNLOCK		LOCKING		
9/12/08	3:50:12P	WRK 2	MRZ DISP	VENTURA	DAVIS	6 OFC TK LOCK		LOCKING		
9/12/08	3:50:12P	WRK 2	MRZ DISP	VENTURA	DAVIS	6 TK UNOCCUPY		INDICATION		

Date	Time	Position	ID	Mode	Reg.	Location	Dev.	Msg. Subtype	Msg. Type	ID
9/12/08	3:50:12P	WRK 2	MRZ	DISP	VENTURA	DAVIS	6	OFC SW LOCK	LOCKING	
9/12/08	3:50:17P	WRK 2	MRZ	DISP	VENTURA	DAVIS	6	OFC TK UNLOCK	LOCKING	
9/12/08	3:50:17P	WRK 2	MRZ	DISP	VENTURA	DAVIS	6	OFC SW UNLOCK	LOCKING	
9/12/08	3:50:17P	WRK 2	MRZ	STCK	VENTURA	DAVIS	6	SW REVERSE	CONTROL	
9/12/08	3:50:17P	WRK 2	MRZ	STCK	VENTURA	DAVIS	11	SG CLEAR	REQUEST	
9/12/08	3:50:17P	WRK 2	MRZ	STCK	VENTURA	DAVIS	6	STACKING OFF	CONTROL	
9/12/08	3:50:26P	WRK 2	MRZ	DISP	VENTURA	DAVIS	6	SW OUT-OF-CORR	INDICATION	
9/12/08	3:50:28P	WRK 2	MRZ	DISP	VENTURA	DAVIS	6	SW REVERSE	INDICATION	
9/12/08	3:50:28P	WRK 2	MRZ	DISP	VENTURA	DAVIS	11	SG CLEAR	CONTROL	
9/12/08	3:50:49P	WRK 2	MRZ	DISP	VENTURA	DAVIS	11	SG CLEAR	INDICATION	
9/12/08	3:51:43P	WRK 2	MRZ	DISP	VENTURA	DAVIS	6	TK OCCUPY	INDICATION	
9/12/08	3:51:43P	WRK 2	MRZ	DISP	VENTURA	DAVIS	6	OCCUPIED	TRAIN MOVED	A784 12
9/12/08	3:51:43P	WRK 2	MRZ	SLOT	VENTURA	DAVIS	11	SG STOP	CONTROL	
9/12/08	3:51:44P	WRK 2	MRZ	DISP	VENTURA	DAVIS	11	SG STOP	INDICATION	
9/12/08	3:52:03P	WRK 2	MRZ	DISP	VENTURA	DAVIS	17	TK OCCUPY	INDICATION	
9/12/08	3:52:03P	WRK 2	MRZ	DISP	VENTURA	DAVIS	17	OCCUPIED	TRAIN MOVED	A784 12
9/12/08	3:52:23P	WRK 2	MRZ	DISP	VENTURA	DAVIS	6	OFC TK LOCK	LOCKING	
9/12/08	3:52:23P	WRK 2	MRZ	DISP	VENTURA	DAVIS	6	TK UNOCCUPY	INDICATION	
9/12/08	3:52:23P	WRK 2	MRZ	DISP	VENTURA	DAVIS	6	OFC SW LOCK	LOCKING	
9/12/08	3:52:28P	WRK 2	MRZ	DISP	VENTURA	DAVIS	6	OFC TK UNLOCK	LOCKING	
9/12/08	3:52:28P	WRK 2	MRZ	DISP	VENTURA	DAVIS	6	OFC SW UNLOCK	LOCKING	
9/12/08	3:52:31P	WRK 2	MRZ	DISP	VENTURA	DAVIS	6	SW NORMAL	CONTROL	
9/12/08	3:52:34P	WRK 2	MRZ	DISP	VENTURA	DAVIS	6	SW OUT-OF-CORR	INDICATION	
9/12/08	3:52:40P	WRK 2	MRZ	DISP	VENTURA	DAVIS	6	SW NORMAL	INDICATION	
9/12/08	3:54:50P	WRK 2	MRZ	DISP	VENTURA	DAVIS	25	TK OCCUPY	INDICATION	
9/12/08	3:54:50P	WRK 2	MRZ	DISP	VENTURA	DAVIS	25	OCCUPIED	TRAIN MOVED	A784 12
9/12/08	3:55:20P	WRK 2	MRZ	DISP	VENTURA	DAVIS	17	OFC TK LOCK	LOCKING	
9/12/08	3:55:20P	WRK 2	MRZ	DISP	VENTURA	DAVIS	17	TK UNOCCUPY	INDICATION	

Date	Time	Position	ID	Mode	Reg.	Location	Dev.	Msg. Subtype	Msg. Type	ID
9/12/08	3:55:25P	WRK 2		MRZ DISP	VENTURA	DAVIS	17 OFC TK	UNLOCK	LOCKING	
9/12/08	3:57:16P	WRK 2		MRZ DISP	VENTURA	TOPANG	26 TK	OCCUPY	INDICATION	
9/12/08	3:57:16P	WRK 2		MRZ DISP	VENTURA	TOPANG	26 OCCUPIED		TRAIN MOVED	A784 12
9/12/08	3:57:16P	WRK 2		MRZ SLOT	VENTURA	TOPANG	13 SG	STOP	CONTROL	
9/12/08	3:57:16P	WRK 2		MRZ DISP	VENTURA	TOPANG	13 SG	STOP	INDICATION	
9/12/08	3:57:35P	WRK 2		MRZ DISP	VENTURA	TOPANG	27 TK	OCCUPY	INDICATION	
9/12/08	3:57:35P	WRK 2		MRZ DISP	VENTURA	TOPANG	27 OCCUPIED		TRAIN MOVED	A784 12
9/12/08	3:57:43P	WRK 2		MRZ DISP	VENTURA	DAVIS	25 OFC TK	LOCK	LOCKING	
9/12/08	3:57:43P	WRK 2		MRZ DISP	VENTURA	DAVIS	25 TK	UNOCCUPY	INDICATION	
9/12/08	3:57:48P	WRK 2		MRZ DISP	VENTURA	DAVIS	25 OFC TK	UNLOCK	LOCKING	
9/12/08	3:57:50P	WRK 2		MRZ DISP	VENTURA	TOPANG	26 OFC TK	LOCK	LOCKING	
9/12/08	3:57:50P	WRK 2		MRZ DISP	VENTURA	TOPANG	26 TK	UNOCCUPY	INDICATION	
9/12/08	3:57:50P	WRK 2		MRZ DISP	VENTURA	TOPANG	8 OFC SW	LOCK	LOCKING	
9/12/08	3:57:55P	WRK 2		MRZ DISP	VENTURA	TOPANG	26 OFC TK	UNLOCK	LOCKING	
9/12/08	3:57:55P	WRK 2		MRZ DISP	VENTURA	TOPANG	8 OFC SW	UNLOCK	LOCKING	
9/12/08	4:01:32P	WRK 2		MRZ DISP	VENTURA	TOPANG	50 TK	OCCUPY	INDICATION	
9/12/08	4:01:32P	WRK 2		MRZ DISP	VENTURA	TOPANG	50 OCCUPIED		TRAIN MOVED	A784 12
9/12/08	4:01:55P	WRK 2		MRZ DISP	VENTURA	TOPANG	27 OFC TK	LOCK	LOCKING	
9/12/08	4:01:55P	WRK 2		MRZ DISP	VENTURA	TOPANG	27 TK	UNOCCUPY	INDICATION	
9/12/08	4:02:00P	WRK 2		MRZ DISP	VENTURA	TOPANG	27 OFC TK	UNLOCK	LOCKING	
9/12/08	4:02:32P	WRK 2		MRZ DISP	VENTURA	BRNISON	28 TK	OCCUPY	INDICATION	
9/12/08	4:02:32P	WRK 2		MRZ DISP	VENTURA	BRNISON	28 OCCUPIED		TRAIN MOVED	A784 12
9/12/08	4:02:32P	WRK 2		MRZ SLOT	VENTURA	BRNISON	15 SG	STOP	CONTROL	
9/12/08	4:02:52P	WRK 2		MRZ DISP	VENTURA	BRNISON	29 TK	OCCUPY	INDICATION	
9/12/08	4:02:52P	WRK 2		MRZ DISP	VENTURA	BRNISON	29 OCCUPIED		TRAIN MOVED	A784 12
9/12/08	4:02:55P	WRK 2		MRZ DISP	VENTURA	TOPANG	50 OFC TK	LOCK	LOCKING	

Date	Time	Position	ID	Mode	Reg.	Location	Dev.	Msg. Subtype	Msg. Type	ID
9/12/08	4:02:55P	WRK 2	MRZ	DISP	VENTURA	TOPANG	50	TK UNOCCUPY	INDICATION	
9/12/08	4:03:00P	WRK 2	MRZ	DISP	VENTURA	TOPANG	50	OFC TK UNLOCK	LOCKING	
9/12/08	4:03:04P	WRK 2	MRZ	DISP	VENTURA	BRNSON	28	OFC TK LOCK	LOCKING	
9/12/08	4:03:04P	WRK 2	MRZ	DISP	VENTURA	BRNSON	28	TK UNOCCUPY	INDICATION	
9/12/08	4:03:04P	WRK 2	MRZ	DISP	VENTURA	BRNSON	9	OFC SW LOCK	LOCKING	
9/12/08	4:03:05P	WRK 2	MRZ	DISP	VENTURA	BRNSON	30	TK OCCUPY	INDICATION	
9/12/08	4:03:05P	WRK 2	MRZ	DISP	VENTURA	BRNSON	30	OCCUPIED	TRAIN MOVED	A784 12
9/12/08	4:03:09P	WRK 2	MRZ	DISP	VENTURA	BRNSON	28	OFC TK UNLOCK	LOCKING	
9/12/08	4:03:09P	WRK 2	MRZ	DISP	VENTURA	BRNSON	9	OFC SW UNLOCK	LOCKING	
9/12/08	4:05:16P	WRK 2	MRZ	DISP	VENTURA	BRNSON	16	SG CLEAR	CONTROL	
9/12/08	4:05:30P	WRK 2	MRZ	DISP	VENTURA	BRNSON	16	SG CLEAR	INDICATION	
9/12/08	4:06:06P	WRK 2	MRZ	DISP	VENTURA	BRNSON	29	OFC TK LOCK	LOCKING	
9/12/08	4:06:06P	WRK 2	MRZ	DISP	VENTURA	BRNSON	29	TK UNOCCUPY	INDICATION	
9/12/08	4:06:11P	WRK 2	MRZ	DISP	VENTURA	BRNSON	29	OFC TK UNLOCK	LOCKING	
9/12/08	4:08:41P	WRK 2	MRZ	DISP	VENTURA	BRNSON	30	OFC TK LOCK	LOCKING	
9/12/08	4:08:41P	WRK 2	MRZ	DISP	VENTURA	BRNSON	30	TK UNOCCUPY	INDICATION	
9/12/08	4:08:46P	WRK 2	MRZ	DISP	VENTURA	BRNSON	30	OFC TK UNLOCK	LOCKING	
9/12/08	4:10:34P	WRK 2	MRZ	DISP	VENTURA	BRNSON	30	TK OCCUPY	INDICATION	<i>EASTBOUND APPROACH © CP RAYNER</i>
9/12/08	4:10:34P	WRK 2	MRZ	DISP	VENTURA	BRNSON	30	OCCUPIED	TRAIN MOVED	M111 12
9/12/08	4:10:54P	WRK 2	MRZ	DISP	VENTURA	DAVIS	6	ENTR STACK	REQUEST	<i>STACKED Route From CP DAVIS THROUGH</i>
9/12/08	4:10:54P	WRK 2	MRZ	DISP	VENTURA	DAVIS	51	EXIT STACK	REQUEST	<i>SIDING TO CP BERSON</i>
9/12/08	4:10:54P	WRK 2	MRZ	STCK	VENTURA	DAVIS	11	SG CLEAR	CONTROL	<i>EASTBOUND SIGNAL</i>
9/12/08	4:10:54P	WRK 2	MRZ	STCK	VENTURA	TOPANG	8	SW REVERSE	CONTROL	<i>Reverse for UP</i>
9/12/08	4:10:54P	WRK 2	MRZ	STCK	VENTURA	TOPANG	13	SG CLEAR	REQUEST	<i>EASTBOUND SIGNAL</i>
9/12/08	4:10:54P	WRK 2	MRZ	STCK	VENTURA	DAVIS	6	STACKING OFF	CONTROL	<i>Ready to Process</i>
9/12/08	4:10:56P	WRK 2	MRZ	DISP	VENTURA	TOPANG	25	ENTR STACK	REQUEST	<i>111 Stack to</i>
9/12/08	4:10:56P	WRK 2	MRZ	DISP	VENTURA	TOPANG	17	EXIT STACK	REQUEST	<i>Davis</i>
9/12/08	4:10:56P	WRK 2	MRZ	DISP	VENTURA	TOPANG	7	STACKING OFF	CONTROL	<i>Loc Pass</i>

Date	Time	Position	ID	Mode	Reg.	Location	Dev.	Msg. Subtype	Msg. Type	ID
9/12/08	4:10:59P	WRK 2	MRZ DISP	VENTURA	DAVIS	11 SG CLEAR		INDICATION		EAST BOUND SIGNAL CLEAR CP DAVIS
9/12/08	4:10:59P	WRK 2	MRZ DISP	VENTURA	DAVIS	6 ENTR STACK		REQUEST		11 Stack to
9/12/08	4:10:59P	WRK 2	MRZ DISP	VENTURA	DAVIS	14 EXIT STACK		REQUEST		Stack to
9/12/08	4:10:59P	WRK 2	MRZ DISP	VENTURA	DAVIS	6 STACKING ON		CONTROL		Ready to Process
9/12/08	4:11:02P	WRK 2	MRZ DISP	VENTURA	TOPANG	8 SW OUT-OF-CORR		INDICATION		
9/12/08	4:11:18P	WRK 2	MRZ DISP	VENTURA	TOPANG	8 SW REVERSE		INDICATION		CP TOPANGA SW.. FULL REVERSE
9/12/08	4:11:18P	WRK 2	MRZ DISP	VENTURA	TOPANG	13 SG CLEAR		CONTROL		EASTBOUND SIGNAL CP TOPANGA
9/12/08	4:11:29P	WRK 2	MRZ DISP	VENTURA	TOPANG	13 SG CLEAR		INDICATION		EASTBOUND SIGNAL CLEAR CP TOPANGA
9/12/08	4:13:13P	WRK 2	MRZ DISP	VENTURA	BRNSON	29 TK OCCUPY		INDICATION		WESTBOUND APPROACH to CP BERNSON
9/12/08	4:13:13P	WRK 2	MRZ DISP	VENTURA	BRNSON	29 OCCUPIED		TRAIN MOVED		M111 12
9/12/08	4:17:43P	WRK 2	MRZ DISP	VENTURA	DAVIS	6 TK OCCUPY		INDICATION		DETECTOR SECTION @ CP DAVIS OCCUPIED
9/12/08	4:17:43P	WRK 2	MRZ DISP	VENTURA	DAVIS	6 OCCUPIED		TRAIN MOVED		LOF65 12
9/12/08	4:17:43P	WRK 2	MRZ SLOT	VENTURA	DAVIS	11 SG STOP		CONTROL		
9/12/08	4:17:43P	WRK 2	MRZ DISP	VENTURA	DAVIS	11 SG STOP		INDICATION		EAST BOUND SIGNAL CP DAVIS AT STOP
9/12/08	4:17:47P	WRK 2	MRZ DISP	VENTURA	BRNSON	28 TK OCCUPY		INDICATION		DETECTOR SECTION @ CP BERNSON OCCUPIED
9/12/08	4:17:47P	WRK 2	MRZ DISP	VENTURA	BRNSON	28 OCCUPIED		TRAIN MOVED		M111 12
9/12/08	4:17:47P	WRK 2	MRZ SLOT	VENTURA	BRNSON	16 SG STOP		CONTROL		
9/12/08	4:17:47P	WRK 2	MRZ DISP	VENTURA	BRNSON	16 SG STOP		INDICATION		WESTBOUND SIGNAL CP BERNSON AT STOP
9/12/08	4:17:54P	WRK 2	MRZ DISP	VENTURA	DAVIS	17 TK OCCUPY		INDICATION		WESTBOUND APPROACH TRAC @ CP DAVIS OCCUPIED
9/12/08	4:17:54P	WRK 2	MRZ DISP	VENTURA	DAVIS	17 OCCUPIED		TRAIN MOVED		LOF65 12
9/12/08	4:18:10P	WRK 2	MRZ DISP	VENTURA	TOPANG	50 TK OCCUPY		INDICATION		EASTBOUND APPROACH MT. OCCUPIED INDICATION
9/12/08	4:18:10P	WRK 2	MRZ DISP	VENTURA	TOPANG	50 OCCUPIED		TRAIN MOVED		M111 12
9/12/08	4:18:17P	WRK 2	MRZ DISP	VENTURA	DAVIS	6 OFC TK LOCK		LOCKING		
9/12/08	4:18:17P	WRK 2	MRZ DISP	VENTURA	DAVIS	6 TK UNOCCUPY		INDICATION		DETECTOR SECTION @ CP DAVIS UNOCCUPIED
9/12/08	4:18:17P	WRK 2	MRZ DISP	VENTURA	DAVIS	6 OFC SW LOCK		LOCKING		
9/12/08	4:18:22P	WRK 2	MRZ DISP	VENTURA	DAVIS	6 OFC TK UNLOCK		LOCKING		
9/12/08	4:18:22P	WRK 2	MRZ DISP	VENTURA	DAVIS	6 OFC SW UNLOCK		LOCKING		

Date	Time	Position	ID	Mode	Reg.	Location	Dev.	Msg. Subtype	Msg. Type	ID
9/12/08	4:18:24P	WRK 2	MRZ DISP	VENTURA	BRNSON	29 OFC TK LOCK		LOCKING		
9/12/08	4:18:24P	WRK 2	MRZ DISP	VENTURA	BRNSON	29 TK UNOCCUPY		INDICATION	WESTBOUND APPROACH CP BRNSON UNOCCUPIED END	
9/12/08	4:18:25P	WRK 2	MRZ STCK	VENTURA	DAVIS	12 SG CLEAR		CONTROL		
9/12/08	4:18:25P	WRK 2	MRZ STCK	VENTURA	DAVIS	6 STACKING OFF		CONTROL		
9/12/08	4:18:25P	WRK 2	MRZ DISP	VENTURA	BRNSON	30 OFC TK LOCK		LOCKING		
9/12/08	4:18:25P	WRK 2	MRZ DISP	VENTURA	BRNSON	30 TK UNOCCUPY		INDICATION	EASTBOUND APPROACH @ CP RAYMER END UNOCCUPIED	
9/12/08	4:18:27P	WRK 2	MRZ DISP	VENTURA	BRNSON	28 OFC TK LOCK		LOCKING		
9/12/08	4:18:27P	WRK 2	MRZ DISP	VENTURA	BRNSON	28 TK UNOCCUPY		INDICATION	DETECTOR SECTION CP BRNSON END UNOCCUPIED	
9/12/08	4:18:27P	WRK 2	MRZ DISP	VENTURA	BRNSON	9 OFC SW LOCK		LOCKING		
9/12/08	4:18:29P	WRK 2	MRZ DISP	VENTURA	BRNSON	29 OFC TK UNLOCK		LOCKING		
9/12/08	4:18:30P	WRK 2	MRZ DISP	VENTURA	DAVIS	12 SG CLEAR		INDICATION	WESTBOUND SIGNAL CP DAVIS CLEAR END.	
9/12/08	4:18:30P	WRK 2	MRZ DISP	VENTURA	BRNSON	30 OFC TK UNLOCK		LOCKING		
9/12/08	4:18:32P	WRK 2	MRZ DISP	VENTURA	BRNSON	28 OFC TK UNLOCK		LOCKING		
9/12/08	4:18:32P	WRK 2	MRZ DISP	VENTURA	BRNSON	9 OFC SW UNLOCK		LOCKING		
9/12/08	4:18:49P	WRK 2	MRZ DISP	VENTURA	TOPANG	27 TK OCCUPY		INDICATION	WESTBOUND APPROACH MT to CP TOPANG OCCUPIED END	
9/12/08	4:18:49P	WRK 2	MRZ DISP	VENTURA	TOPANG	27 OCCUPIED		TRAIN MOVED	M111	12
9/12/08	4:19:01P	WRK 2	MRZ DISP	VENTURA	TOPANG	50 OFC TK LOCK		LOCKING		
9/12/08	4:19:01P	WRK 2	MRZ DISP	VENTURA	TOPANG	50 TK UNOCCUPY		INDICATION	EASTBOUND MT APPROACH to CP BRNSON UNOCCUPIED INDICATION	
9/12/08	4:19:06P	WRK 2	MRZ DISP	VENTURA	TOPANG	50 OFC TK UNLOCK		LOCKING		
9/12/08	4:20:22P	WRK 2	MRZ DISP	VENTURA	DAVIS	25 TK OCCUPY		INDICATION	EASTBOUND APPROACH TRACK @ CP TOPANG OCCUPIED END.	
9/12/08	4:20:22P	WRK 2	MRZ DISP	VENTURA	DAVIS	25 OCCUPIED		TRAIN MOVED	LOF65	12
9/12/08	4:20:23P	WRK 2	MRZ OKRT	VENTURA	BRNSON	9 SW REVERSE		CONTROL		
9/12/08	4:20:23P	WRK 2	MRZ OKRT	VENTURA	BRNSON	15 SG CLEAR		REQUEST		
9/12/08	4:20:26P	WRK 2	MRZ DISP	VENTURA	BRNSON	9 SW OUT-OF-CORR		INDICATION		
9/12/08	4:20:41P	WRK 2	MRZ DISP	VENTURA	BRNSON	9 SW REVERSE		INDICATION	Reverse SW. of CP BRNSON	
9/12/08	4:20:41P	WRK 2	MRZ DISP	VENTURA	BRNSON	15 SG CLEAR		CONTROL		
9/12/08	4:21:01P	WRK 2	MRZ DISP	VENTURA	DAVIS	17 OFC TK LOCK		LOCKING		
9/12/08	4:21:01P	WRK 2	MRZ DISP	VENTURA	DAVIS	17 TK UNOCCUPY		INDICATION	WESTBOUND APPROACH TRACK @ CP DAVIS UNOCCUPIED INDICATION	





Date	Time	Position	ID	Mode	Reg.	Location	Dev.	Msg. Subtype	Msg. Type	ID
9/12/08	4:21:06P	WRK 2	MRZ	DISP	VENTURA	DAVIS	17	OFC TK UNLOCK	LOCKING	
9/12/08	4:21:09P	WRK 2	MRZ	DISP	VENTURA	BRNSON	15	SG CLEAR	INDICATION	EASTBOUND SIGNAL CLEAR INDICATION @ CP BRNSON
9/12/08	4:22:00P	WRK 2	MRZ	DISP	VENTURA	TOPANG	26	TK OCCUPY	INDICATION	DETECTOR SECTION @ CP TOPANGA OCCUPIED INDICATION
9/12/08	4:22:00P	WRK 2	MRZ	DISP	VENTURA	TOPANG	26	OCCUPIED	TRAIN MOVED	LOF65 12 (MTL111)
9/12/08	4:22:00P	WRK 2	MRZ	SLOT	VENTURA	TOPANG	13	SG STOP	CONTROL	
9/12/08	4:22:00P	WRK 2	MRZ	DISP	VENTURA	TOPANG	13	SG STOP	INDICATION	EASTBOUND SIGNAL @ CP TOPANGA AT STOP
9/12/08	4:22:05P	WRK 2	MRZ	DISP	VENTURA	TOPANG	8	SW OUT-OF-CORR	INDICATION	CP TOPANGA SW. IND. OUT-OF-CORRESPONDENCE
9/12/08	4:22:05P	WRK 2	MRZ	DISP	VENTURA	TOPANG		PROCIND	SMOOC	
Switch 8 out-of-correspondence with track occupied at TOPANG (Was reverse)										
9/12/08	4:22:16P	WRK 2	MRZ	DISP	VENTURA	TOPANG	27	OFC TK LOCK	LOCKING	
9/12/08	4:22:16P	WRK 2	MRZ	DISP	VENTURA	TOPANG	27	TK UNOCCUPY	INDICATION	WESTBOUND APPROACH MT INDICATING UNOCCUPIED
9/12/08	4:22:21P	WRK 2	MRZ	DISP	VENTURA	TOPANG	27	OFC TK UNLOCK	LOCKING	
9/12/08	4:22:27P	WRK 2	MRZ	DISP	VENTURA	TOPANG	26	OFC TK LOCK	LOCKING	
9/12/08	4:22:27P	WRK 2	MRZ	DISP	VENTURA	TOPANG	26	TK UNOCCUPY	INDICATION	DETECTOR SECTION @ CP TOPANGA END UNOCCUPIED
9/12/08	4:22:27P	WRK 2	MRZ	DISP	VENTURA	TOPANG	8	OFC SW LOCK	LOCKING	
9/12/08	4:22:27P	WRK 2	MRZ	DISP	VENTURA	TOPANG	13	SG IN-TIME ON	INDICATION	EASTBOUND SIGNAL @ CP TOPANGA IN-TIME
9/12/08	4:22:32P	WRK 2	MRZ	DISP	VENTURA	TOPANG	26	OFC TK UNLOCK	LOCKING	
9/12/08	4:22:32P	WRK 2	MRZ	DISP	VENTURA	TOPANG	8	OFC SW UNLOCK	LOCKING	
9/12/08	4:22:34P	WRK 2	MRZ	DISP	VENTURA	TOPANG	7	STACK CANCEL	REQUEST	
9/12/08	4:22:34P	WRK 2	MRZ	DISP	VENTURA	TOPANG	7	STACKING OFF	CONTROL	
9/12/08	4:22:34P	WRK 2	MRZ	DISP	VENTURA	TOPANG	7	STACKING OFF	CONTROL	
9/12/08	4:26:39P	WRK 2	MRZ	DISP	VENTURA	BRNSON	15	SG STOP	CONTROL	
9/12/08	4:26:42P	WRK 2	MRZ	DISP	VENTURA	BRNSON	15	SG IN-TIME ON	INDICATION	
9/12/08	4:28:28P	WRK 2	MRZ	DISP	VENTURA	TOPANG	13	SG STOP	INDICATION	TOPANGA
9/12/08	4:29:26P	WRK 2	MRZ	DISP	VENTURA	DAVIS	12	SG STOP	CONTROL	
9/12/08	4:29:33P	WRK 2	MRZ	DISP	VENTURA	DAVIS	12	SG IN-TIME ON	INDICATION	
9/12/08	4:32:42P	WRK 2	MRZ	DISP	VENTURA	BRNSON	15	SG STOP	INDICATION	EASTBOUND @ BRNSON

Date	Time	Position	ID	Mode	Reg.	Location	Dev.	Msg. Subtype	Msg. Type	ID
9/12/08	4:35:30P	WRK 2	MRZ DISP	VENTURA	DAVIS	12 SG STOP	INDICATION			WESBOUNA AT CP DAVIS
9/12/08	4:54:39P	WRK 2	MRZ AUTO	VENTURA	BRNSON	8 RECALL	CONTROL			
9/12/08	4:54:39P	WRK 2	MRZ DISP	VENTURA	BRNSON	9 SW BLOCK	CONTROL			
9/12/08	4:54:43P	WRK 2	MRZ DISP	VENTURA	BRNSON	28 TK UNOCCUPY	INDICATION			
9/12/08	4:54:43P	WRK 2	MRZ DISP	VENTURA	TOPANG	50 TK UNOCCUPY	INDICATION			
9/12/08	4:54:43P	WRK 2	MRZ DISP	VENTURA	BRNSON	29 TK UNOCCUPY	INDICATION			
9/12/08	4:54:43P	WRK 2	MRZ DISP	VENTURA	TOPANG	51 TK UNOCCUPY	INDICATION			
9/12/08	4:54:43P	WRK 2	MRZ DISP	VENTURA	BRNSON	9 SW REVERSE	INDICATION			
9/12/08	4:54:43P	WRK 2	MRZ DISP	VENTURA	BRNSON	15 SG STOP	INDICATION			
9/12/08	4:54:43P	WRK 2	MRZ DISP	VENTURA	BRNSON	15 OFC IN-TIME OFF	LOCKING			
9/12/08	4:54:43P	WRK 2	MRZ DISP	VENTURA	BRNSON	16 SG STOP	INDICATION			
9/12/08	4:54:43P	WRK 2	MRZ DISP	VENTURA	BRNSON	16 OFC IN-TIME OFF	LOCKING			
9/12/08	4:54:43P	WRK 2	MRZ DISP	VENTURA	BRNSON	8 POWER ON	INDICATION			
9/12/08	4:54:43P	WRK 2	MRZ DISP	VENTURA	BRNSON	8 LOCAL CTL OFF	INDICATION			
9/12/08	4:54:43P	WRK 2	MRZ DISP	VENTURA	BRNSON	8 DOOR CLOSE	INDICATION			
9/12/08	4:54:43P	WRK 2	MRZ DISP	VENTURA	BRNSON	8 LIGHT ON	INDICATION			
9/12/08	4:55:02P	WRK 2	MRZ AUTO	VENTURA	DAVIS	12 SG STOP	CONTROL			
9/12/08	4:55:02P	WRK 2	MRZ AUTO	VENTURA	DAVIS	6 RECALL	CONTROL			
9/12/08	4:55:02P	WRK 2	MRZ DISP	VENTURA	DAVIS	12 SG BLOCK	CONTROL			
9/12/08	4:55:02P	WRK 2	MRZ AUTO	VENTURA	DAVIS	11 SG STOP	CONTROL			
9/12/08	4:55:02P	WRK 2	MRZ AUTO	VENTURA	DAVIS	6 RECALL	CONTROL			
9/12/08	4:55:02P	WRK 2	MRZ DISP	VENTURA	DAVIS	11 SG BLOCK	CONTROL			
9/12/08	4:55:02P	WRK 2	MRZ AUTO	VENTURA	BRNSON	15 SG STOP	CONTROL			
9/12/08	4:55:02P	WRK 2	MRZ AUTO	VENTURA	BRNSON	8 RECALL	CONTROL			
9/12/08	4:55:02P	WRK 2	MRZ DISP	VENTURA	BRNSON	15 SG BLOCK	CONTROL			
9/12/08	4:55:02P	WRK 2	MRZ AUTO	VENTURA	BRNSON	16 SG STOP	CONTROL			
9/12/08	4:55:02P	WRK 2	MRZ AUTO	VENTURA	BRNSON	8 RECALL	CONTROL			
9/12/08	4:55:02P	WRK 2	MRZ DISP	VENTURA	BRNSON	16 SG BLOCK	CONTROL			

Date	Time	Position	ID	Mode	Reg.	Location	Dev.	Msg. Subtype	Msg. Type	ID
9/12/08	4:55:12P	WRK 2	MRZ DISP	VENTURA	DAVIS	6 TK UNOCCUPY		INDICATION		
9/12/08	4:55:12P	WRK 2	MRZ DISP	VENTURA	DAVIS	17 TK UNOCCUPY		INDICATION		
9/12/08	4:55:12P	WRK 2	MRZ DISP	VENTURA	DAVIS	6 SW NORMAL		INDICATION		
9/12/08	4:55:12P	WRK 2	MRZ DISP	VENTURA	DAVIS	11 SG STOP		INDICATION		
9/12/08	4:55:12P	WRK 2	MRZ DISP	VENTURA	DAVIS	11 OFC IN-TIME OFF		LOCKING		
9/12/08	4:55:12P	WRK 2	MRZ DISP	VENTURA	DAVIS	12 SG STOP		INDICATION		
9/12/08	4:55:12P	WRK 2	MRZ DISP	VENTURA	DAVIS	12 OFC IN-TIME OFF		LOCKING		
9/12/08	4:55:12P	WRK 2	MRZ DISP	VENTURA	DAVIS	6 POWER ON		INDICATION		
9/12/08	4:55:12P	WRK 2	MRZ DISP	VENTURA	DAVIS	6 LOCAL CTL OFF		INDICATION		
9/12/08	4:55:12P	WRK 2	MRZ DISP	VENTURA	DAVIS	6 DOOR CLOSE		INDICATION		
9/12/08	4:55:12P	WRK 2	MRZ DISP	VENTURA	DAVIS	6 LIGHT ON		INDICATION		
9/12/08	4:55:12P	WRK 2	MRZ DISP	VENTURA	DAVIS	11 MISC OFF		INDICATION		ETL
9/12/08	4:55:14P	WRK 2	MRZ DISP	VENTURA	BRNSON	28 TK UNOCCUPY		INDICATION		
9/12/08	4:55:14P	WRK 2	MRZ DISP	VENTURA	TOPANG	50 TK UNOCCUPY		INDICATION		
9/12/08	4:55:14P	WRK 2	MRZ DISP	VENTURA	BRNSON	29 TK UNOCCUPY		INDICATION		
9/12/08	4:55:14P	WRK 2	MRZ DISP	VENTURA	TOPANG	51 TK UNOCCUPY		INDICATION		
9/12/08	4:55:14P	WRK 2	MRZ DISP	VENTURA	BRNSON	9 SW REVERSE		INDICATION		
9/12/08	4:55:14P	WRK 2	MRZ DISP	VENTURA	BRNSON	15 SG STOP		INDICATION		
9/12/08	4:55:14P	WRK 2	MRZ DISP	VENTURA	BRNSON	15 OFC IN-TIME OFF		LOCKING		
9/12/08	4:55:14P	WRK 2	MRZ DISP	VENTURA	BRNSON	16 SG STOP		INDICATION		
9/12/08	4:55:14P	WRK 2	MRZ DISP	VENTURA	BRNSON	16 OFC IN-TIME OFF		LOCKING		
9/12/08	4:55:14P	WRK 2	MRZ DISP	VENTURA	BRNSON	8 POWER ON		INDICATION		
9/12/08	4:55:14P	WRK 2	MRZ DISP	VENTURA	BRNSON	8 LOCAL CTL OFF		INDICATION		
9/12/08	4:55:14P	WRK 2	MRZ DISP	VENTURA	BRNSON	8 DOOR CLOSE		INDICATION		
9/12/08	4:55:14P	WRK 2	MRZ DISP	VENTURA	BRNSON	8 LIGHT ON		INDICATION		





Total Records Reported: 298

CP SANTA SUSANA

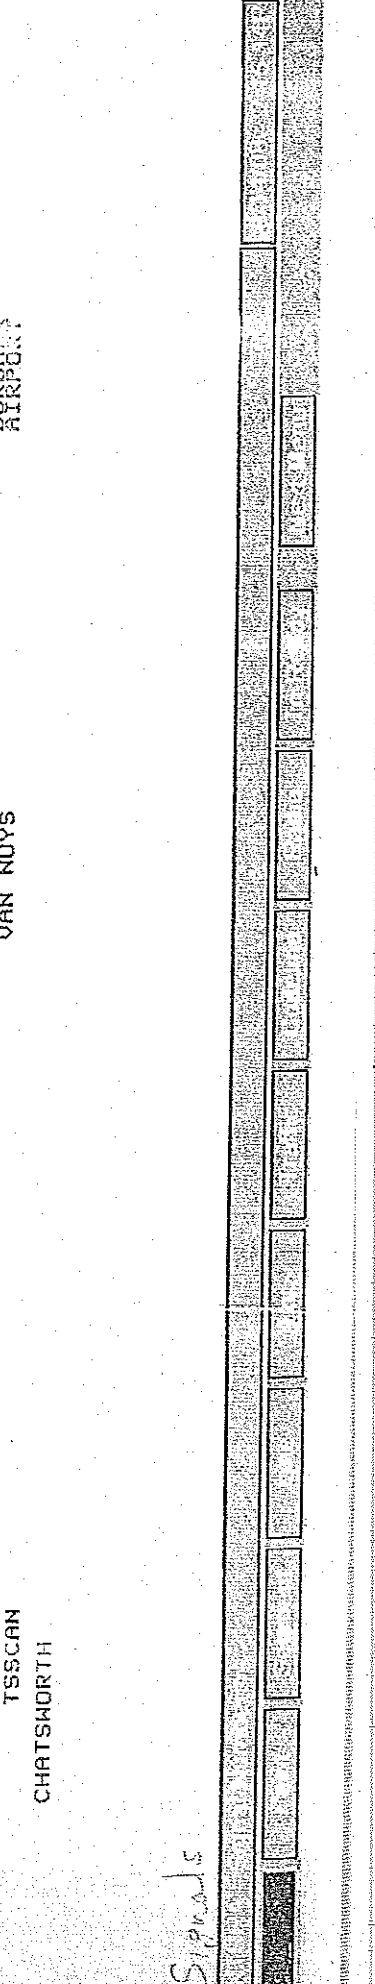
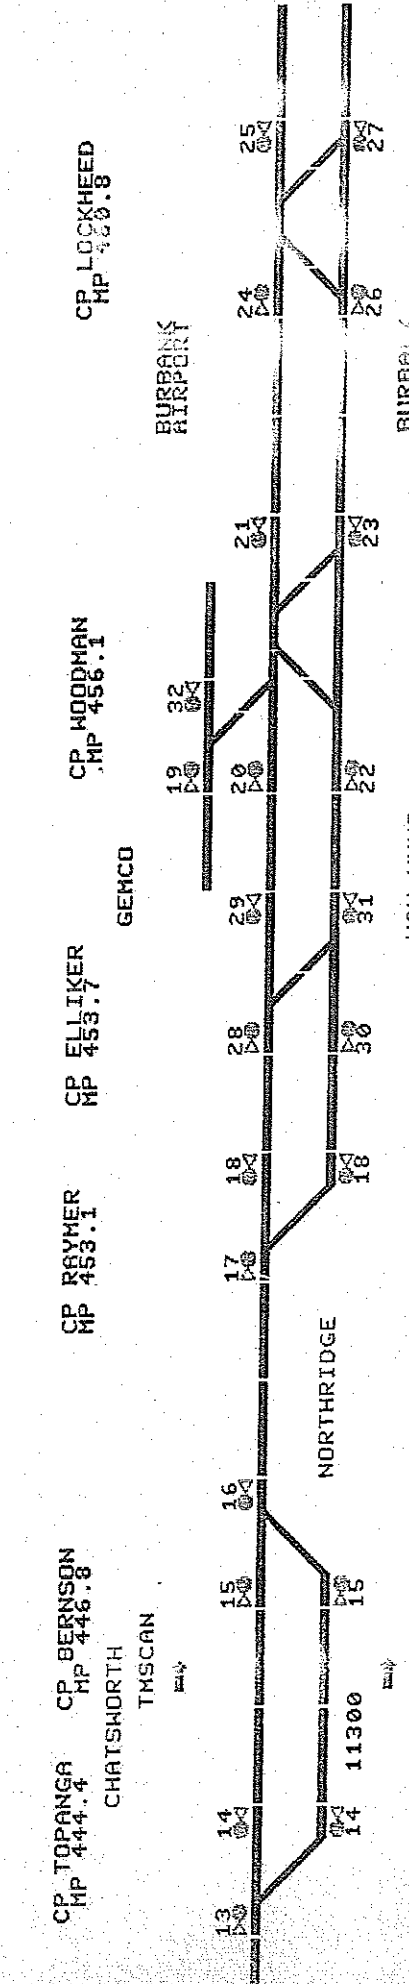
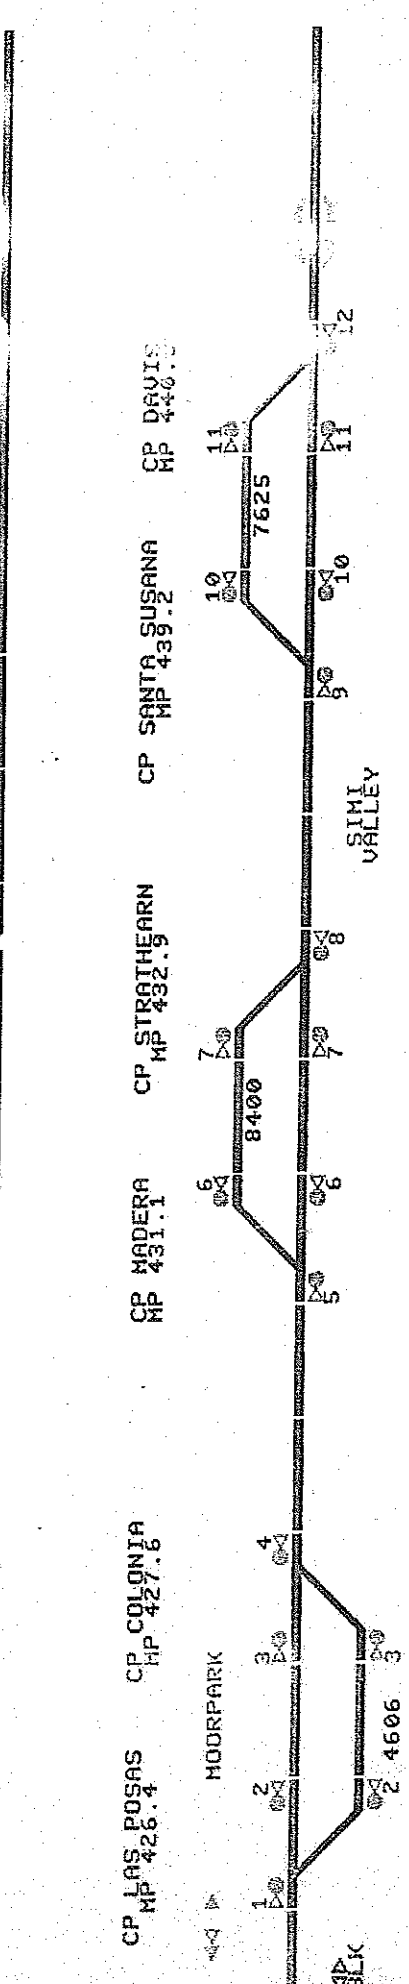
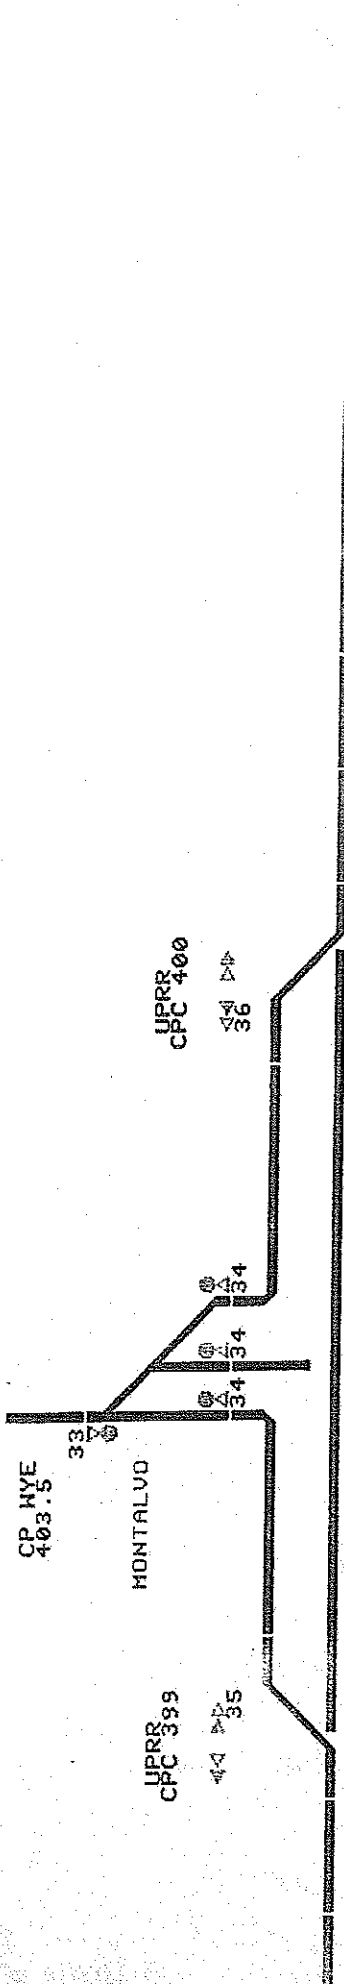


Signals

100 500000 1000000

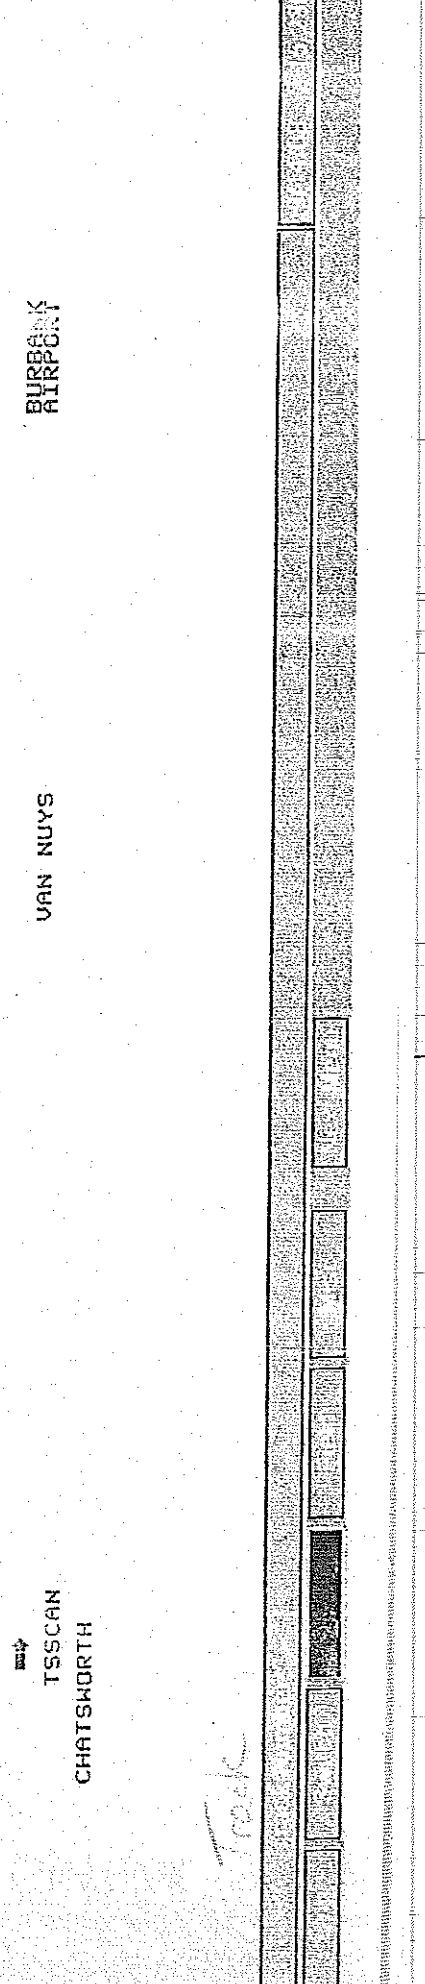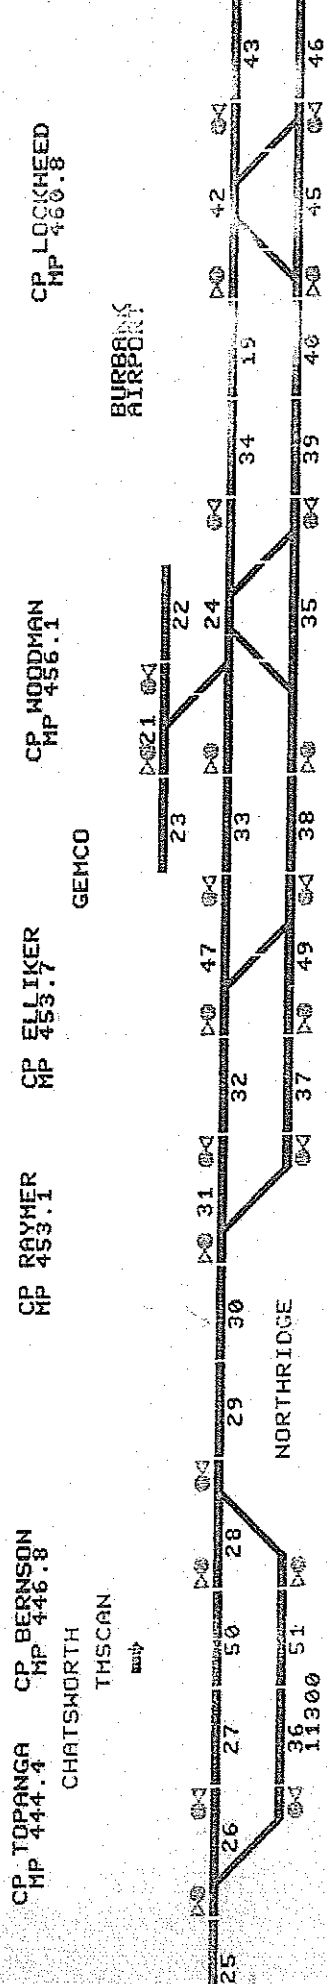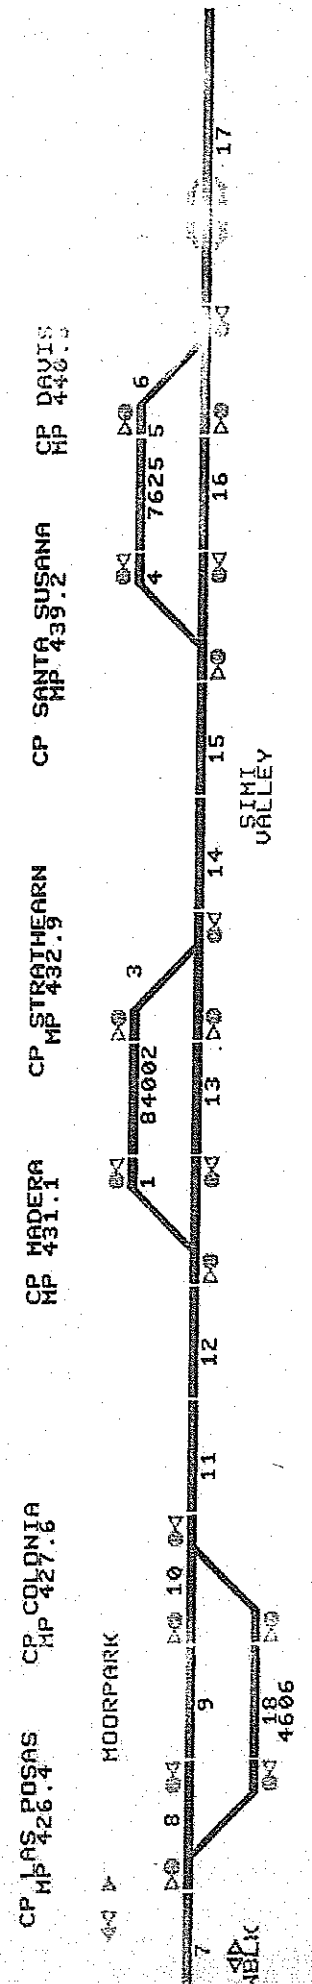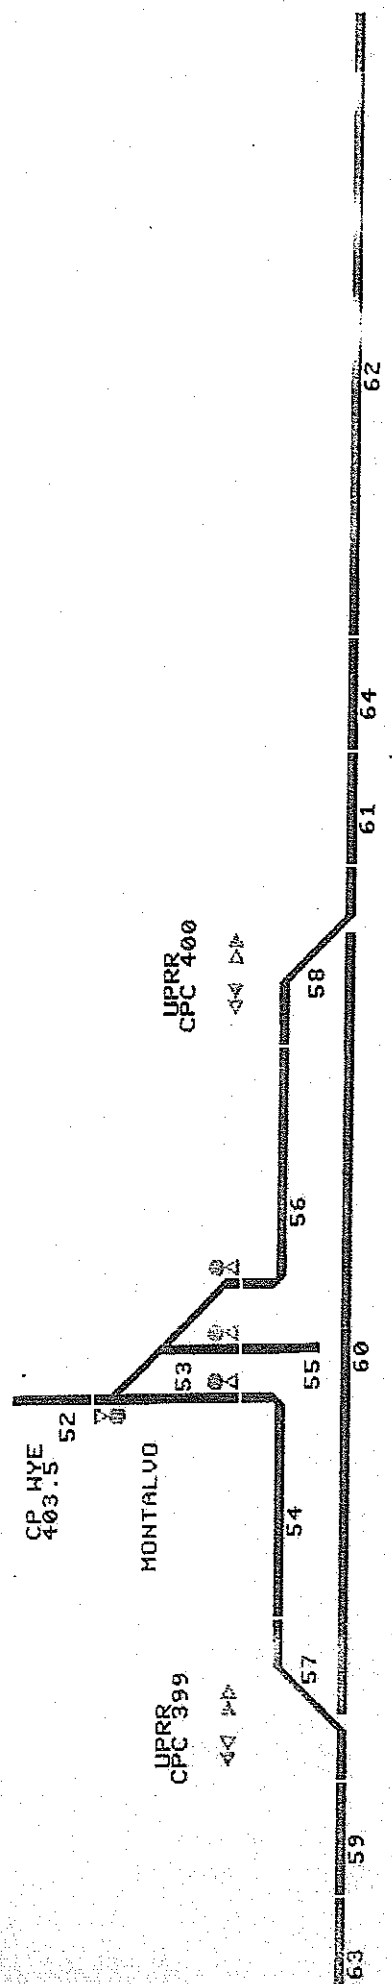

Track

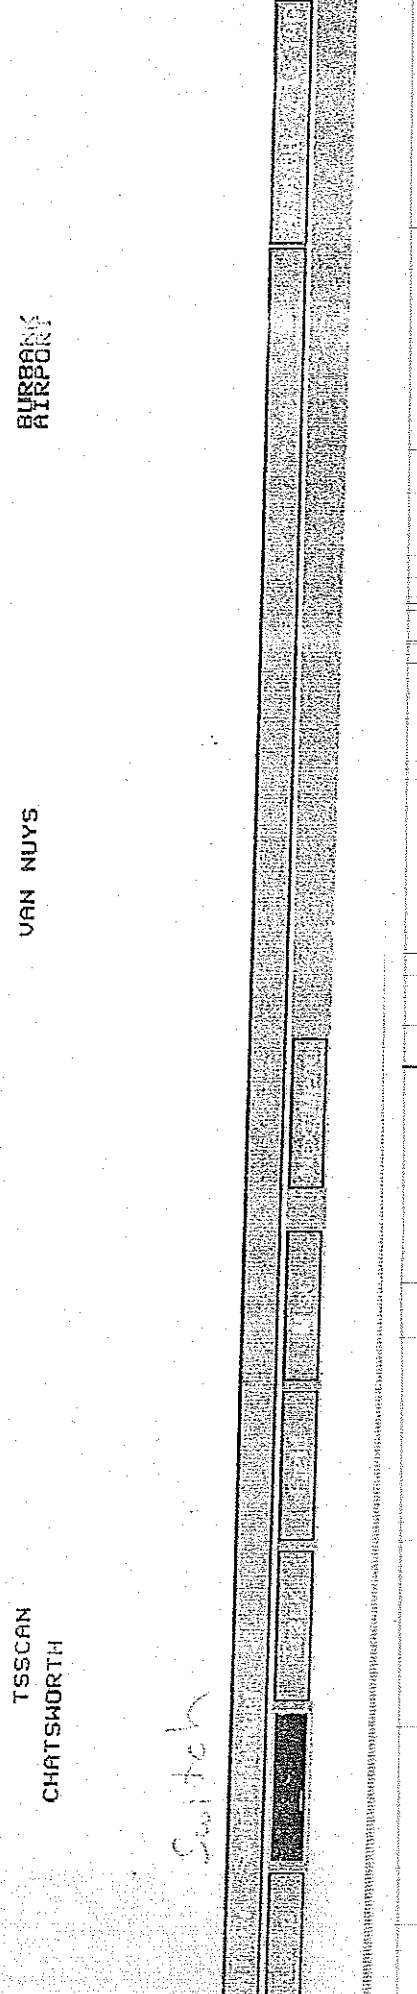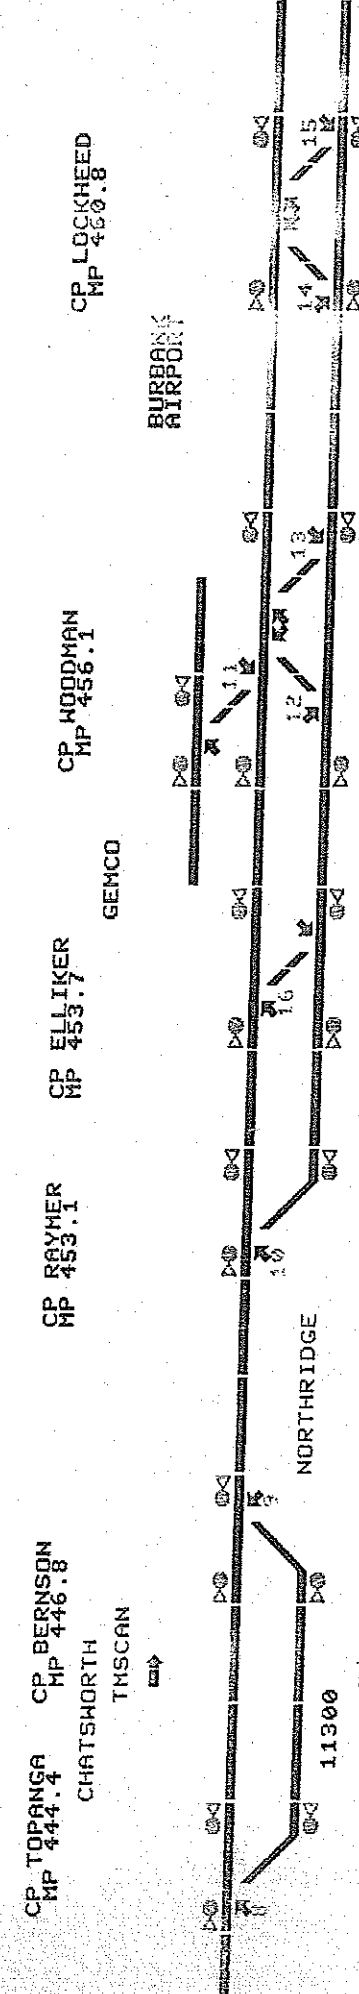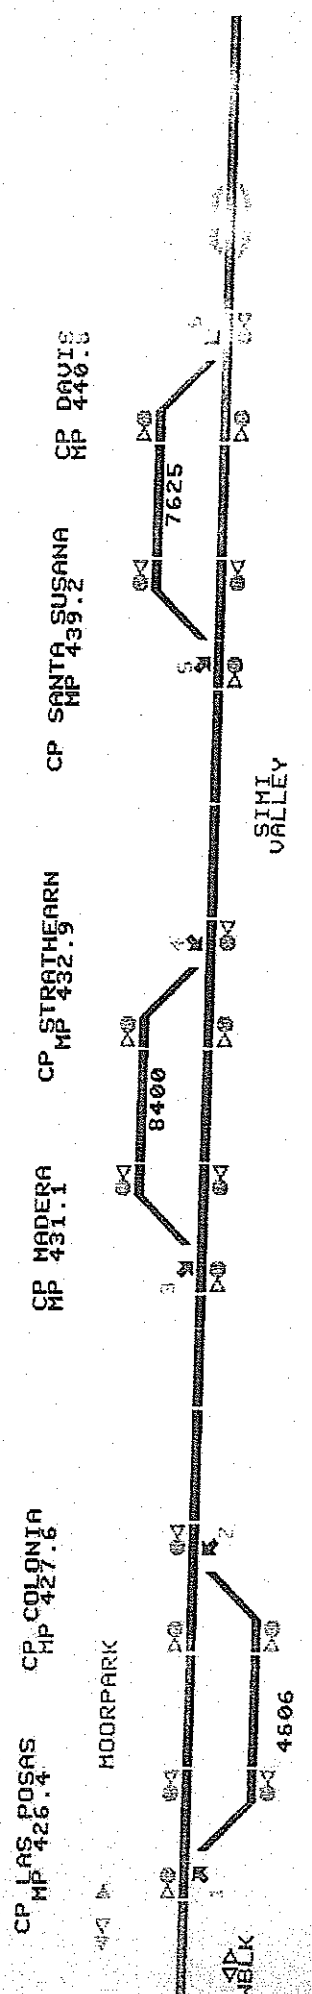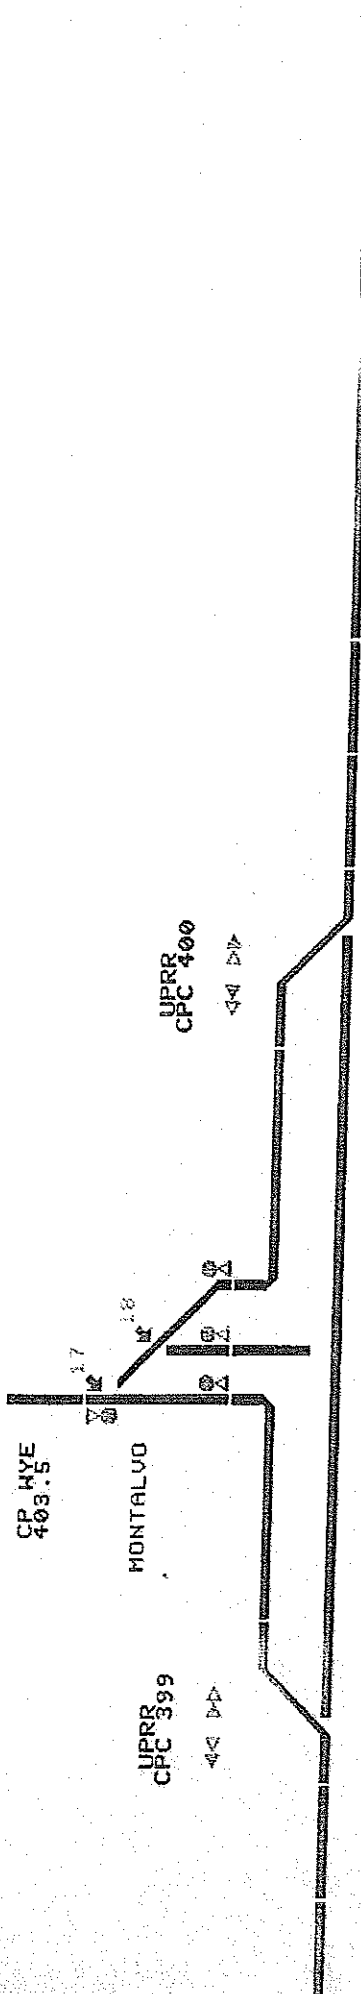

Switch