


CW 239  
 Lot # 11-11-96-70  
 Dredged Green Area  
 Tag # Z 4007

Wing Center Section  
 Lower skin Panel  
 RBL 80 to 98, Mid SPAR aft chord with 5" of skin

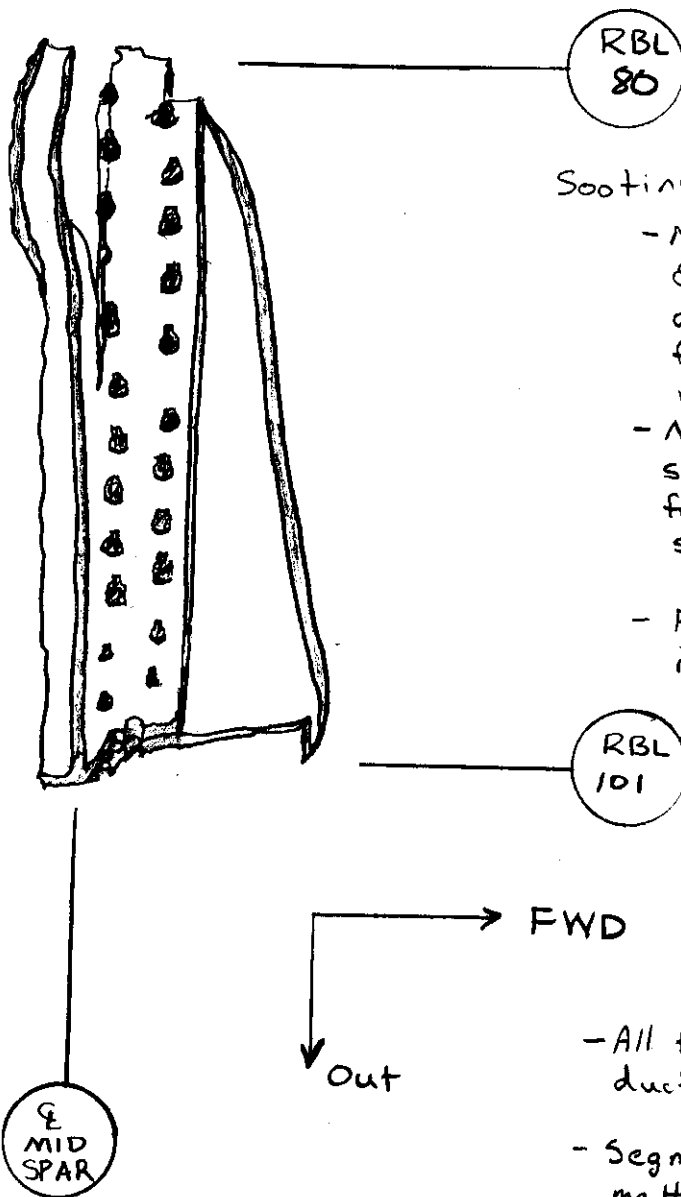

Sooting:

- Medium soot on exterior surface and interior surface forward of Mid spar vertical flange.
- No soot on fracture surfaces except the forward surface. On this surface I cannot tell if it is oxidized or sooted.
- Fastener collars on interior surface have soot trails going forward and inboard.

- All fractures appear to be ductile fractures

- Segment matches all mating parts except the inboard fracture. At this time that part has not been found.

Jim Powers  
 11-14-96  
 Boeing

Brandenburg Foster Tarr

Keith D. Johnson - ALPA  
 3-20-97

Stephen F. Klepachuk  
 FAA 01-15-97  
 9 04-22-97

Dennis L. Tarr - IAM  
 3-25-97