


CW-242
Z-3381
GREEN TAG

WING CENTER SECTION
LOWER PANEL STRINGER S-1

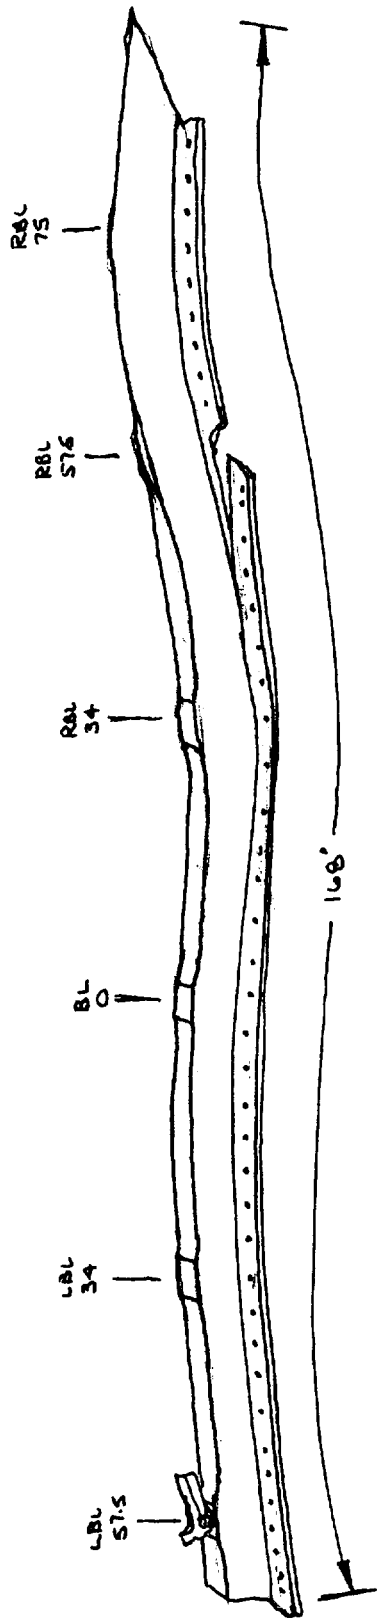

- SMALL PORTION OF LBL 57.5 INTERCOSTAL STUW ATTACHED
- BOLT AND RADIUS FILLER FOR RBL75 INTERCOSTAL STUW ATTACHED
- REMAINING BUEJETS FOR ATTACHMENT TO SKIN PANEL EXHIBIT SHEAR FAILURES EXCEPT FOR 2 LOCATIONS NEAR RBL14 AND ONE LOCATION NEAR RBL 57.5 WHICH EXHIBIT TENSION FAILURES
- HEAVILY SOOTED ON PORTIONS OF STRINGER

W. Stuyant Boeing 3/26/97

[Signature] FAA 4-H-97

Dennis Hartge IAM / Coice
3-27-97 ALPA 3/27/97
Tom Tidmore
FAA 3-25-97