

S.O.B. RIB STIFFENER CW-315

P/N 65B16613-2

Z-2685  
GREEN

A. REIMER  
10/14/96

SEGMENT IS 36" LONG, TWISTED

UP AND BENT FWD

AS SHOWN. EXCEPT

FOR UPR 6", ALL

FASTENERS FAILED

IN TENSION OR

STRIPPED OFF NUTS.

UPR 6" FAILED IN

SHEAR. CLEAN - NO SOOT.


THIS IS FIRST STIFFENER  
AFT OF FRONT SPAR.

Stephen F Klapeck on 12-12-96 FAN

W. Mello 12-14-96 WJA

C. H. Hale 12-16-96 IAM

SO GREEN 12-17-96 ALPA

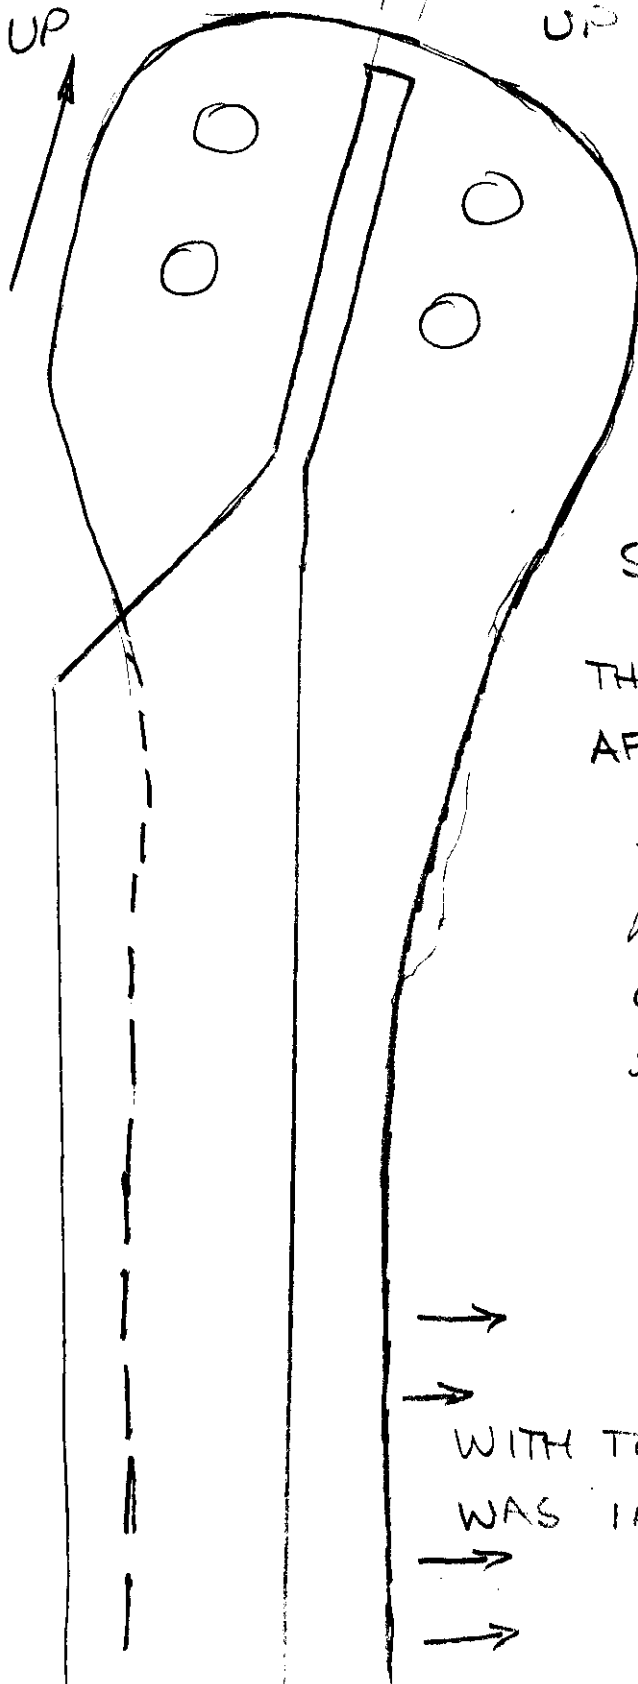

WITH TOP FIXED, MOVEMENT  
WAS IN → DIRECTION.