

SPANWISE BEAM # 3

CW-607

Z-2506

GREEN

This item is the lower 40" of the RBL 75.90 stiffener with a width of 4" to 11" of web attached for its entire length. The lower end has the shear tie intact. The web is torn and slightly bent both fwd and aft.

See FIRE AND EXPLOSION NOTES, TCT.

~~No fire damage or sooting is observed.~~

AD Perry 10/20/96

BOEING

TOM Todino


FAA 10-29-96

SD GREEN 10-29-96

ALPA

J. M. Kelly 11-26-96 TWA


C. J. Hall 11-27-96 IAM

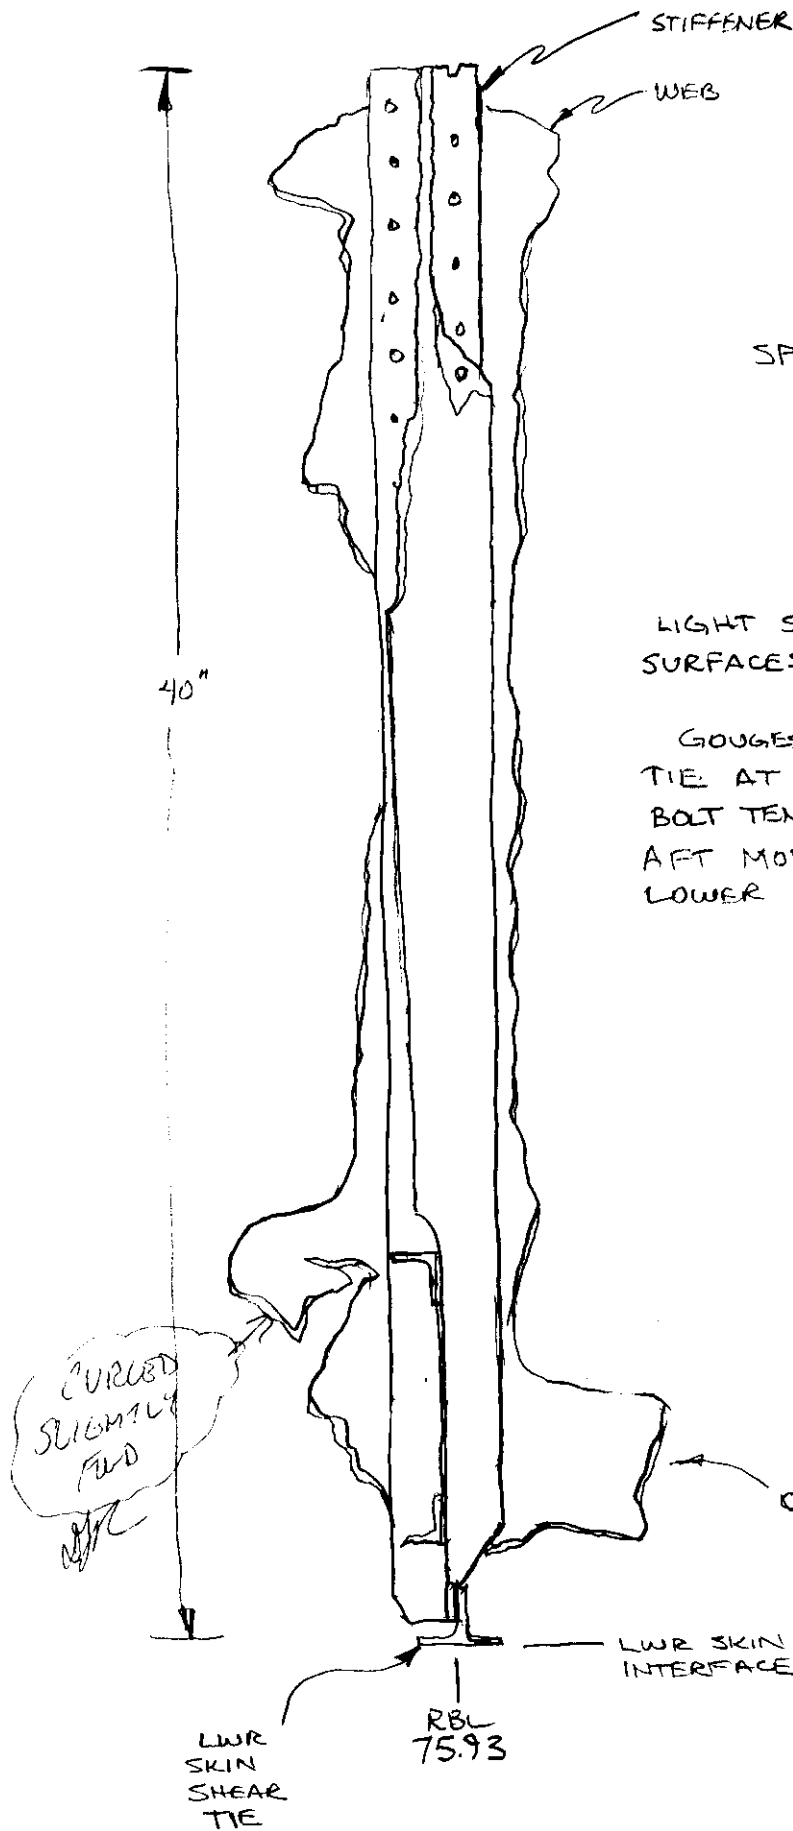

CW-607
 Z-2506
 GREEN TAG

SPANWISE BEAM # 3 STIFFENER

VIEW LOOKING FWD

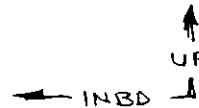

LIGHT SOOT PREDOMINANTLY ON AFT SURFACES (SIMILAR TO CW602)

GOUGES IN LWR SURFACE OF SHEAR TIE AT LWR SKIN INTERFACE INDICATES BOLT TENSION FAILURE WITH SUBSEQUENT AFT MOVEMENT RELATIVE TO THE LOWER PANEL

Warr Stewart 9/16/96

CURLED SLIGHTLY FWD

CURLED SLIGHTLY AFT

LWR SKIN SHEAR TIE

LWR SKIN INTERFACE

RBL 75.93