


CW 633

Id No: 9-8-96-2

Tag No: Z-2871 Green


Spanwise Beam 3 - Top portion,  
RBL 75.9 stiffener

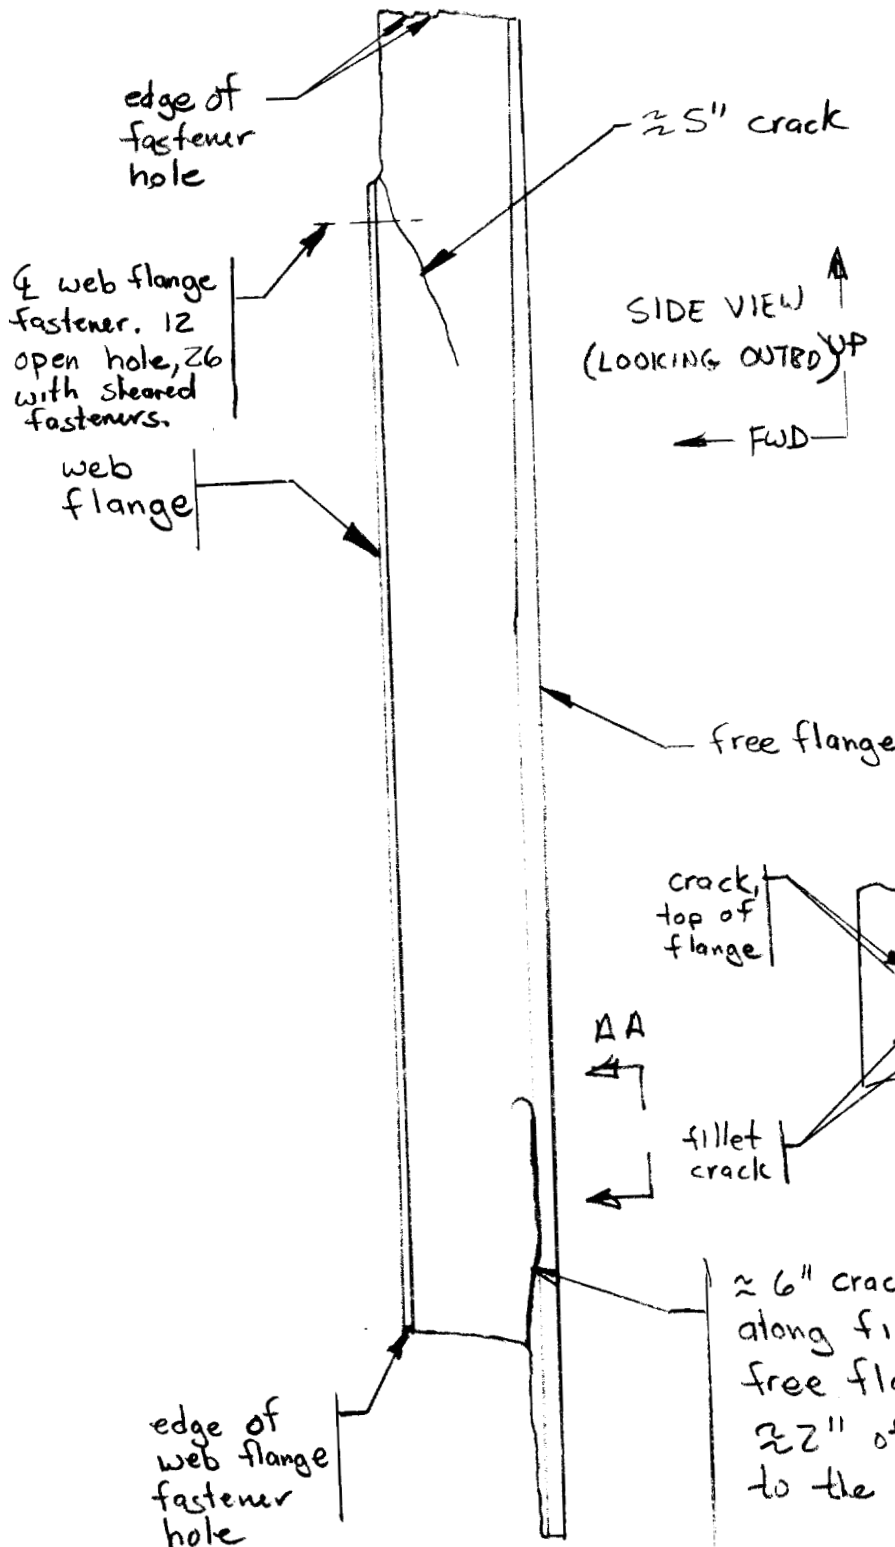

Segment is 240" in length

Stiffener segment does not appear to be bent or distorted.

Possible light sooting of part.

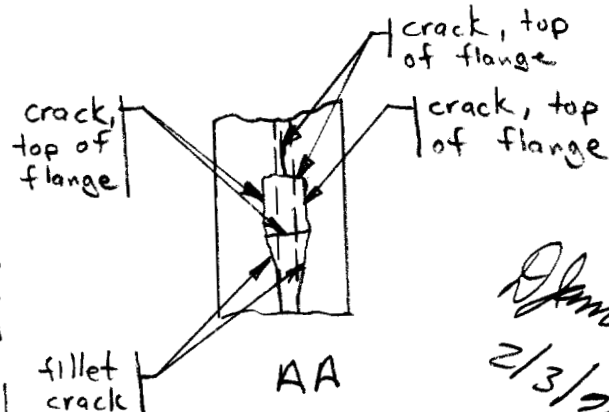

*James*  
2/3/96

≈ 6" crack extending along fillet of stiffener free flange. Last ≈ 2" of crack transitions to the free flange.

Heigh Johnson - ALPA  
3-21-97

Diemur Santiago IAM  
4-2-97

Bhandarkar  
TWA 3/24/97

*[Faint signature]*