

LOG # LF 84

TARGET # _____

COORD: LAT _____

LONG _____

SKIN STA 460-480

S-39L TO S 44L

DEBRIS FIELD YELLOW ?

SKIN UPPER & LOWER ENDS FRACTURED PREDOMINANTLY
THRU SPLICE FASTENERS (TENSION TYPE)

FWD & AFT FRACTURES ARE NOT THRU
FRAME ATTACH FASTENERS STRINGERS STILL
ATTACHED, FRAMES GONE. BEND DIAG. FROM


FWD LOWER TO AFT UPPER $\approx 30^\circ$ LARGE
RADIUS.

Neil Scoville
TWA-10-19-96

B Smith 10/26/96

Tom Todman
10-23-96
FAA

REFER FIRE AND EXPLOSION GROUP NOTES FOR FIRE DAMAGE

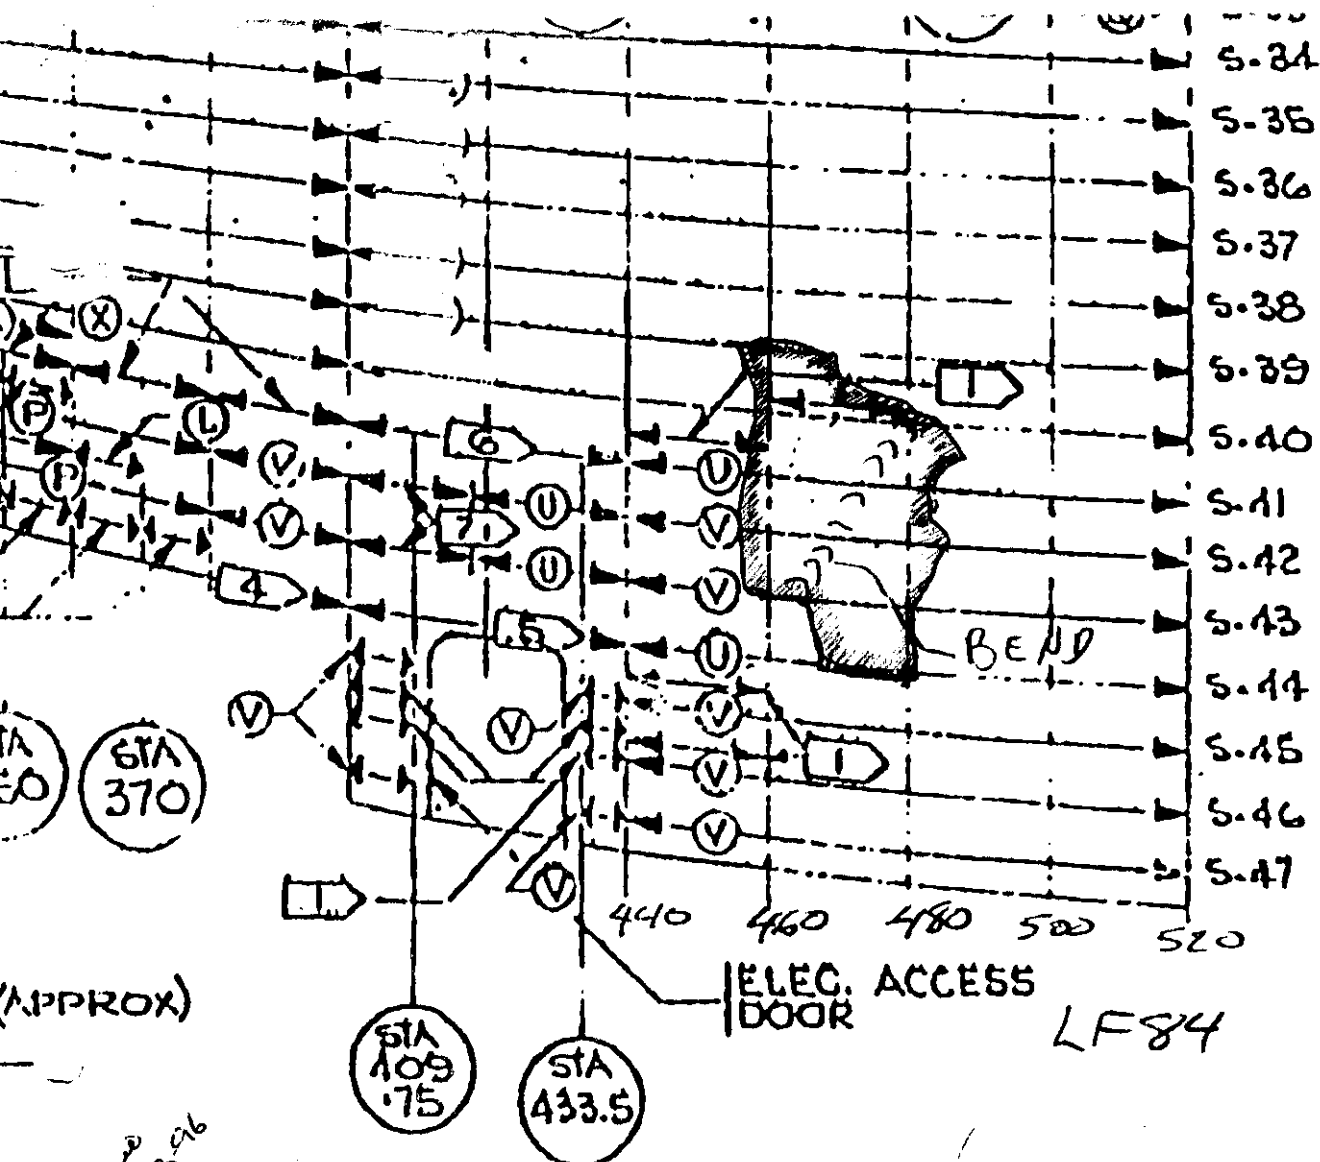

(APPROX)

Tom Todman
FAX 10-23-96

