

LOG # LW 32
TARGET # 443
COORD: LAT _____
LONG _____

DEBRIS FIELD Green C428

OUT BOARD AILERON INBOARD SECTION. APPROX
5ft x 5ft EXCESSIVE ^{BA}TAIRING IMPACT DAMAGE
LIGHT ~~NO~~ SOOTING AND HAS SLIGHT FIRE DAMAGE ON
THE OUT BOARD END OF THIS PIECE, UPPER SURFACE
HAS CRACKING TO COMPOSIT AND SEVERAL HOLE
PUNCTURE.

REF TO FILE NOTES.

PAMAROTTE FAA


L. Thomson - BOEING
10-3-96

S. Green - ALPA
11-16-96

D. Santiago - IAM
11-7-96

Mike Kinney 10/13/96

Louybbw - FAA
10-28-96

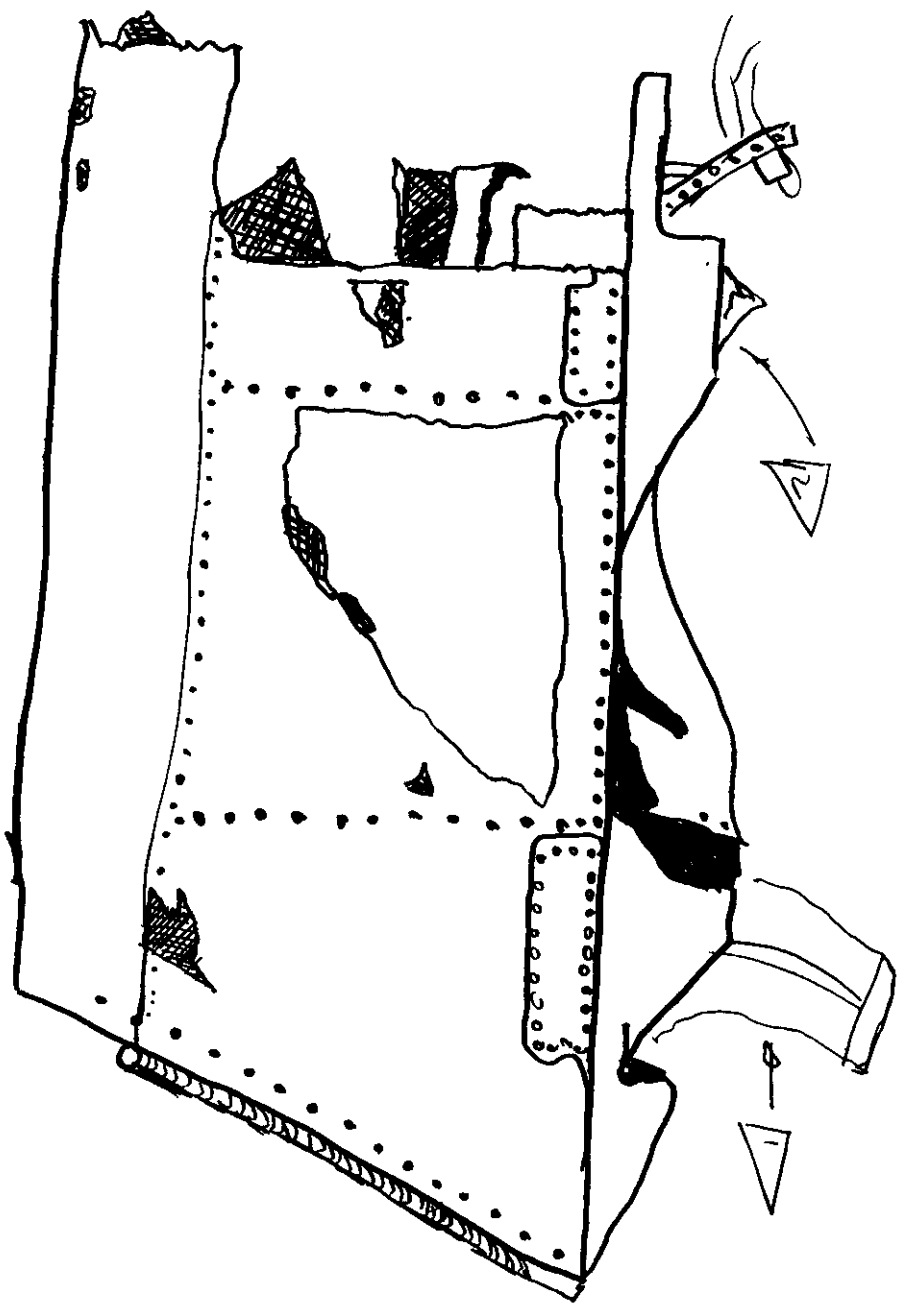

LW 32.

UPPER SURFACE VIEW

→ I/B



1 I/B BALANCE TOWER IN-PLACE, BENT I/B BALANCE WEIGHT INCLUDED

2 Balance Tower Fractured off 8" End of Aikou span

LThomas

LEFT WING

LEFT WING 32

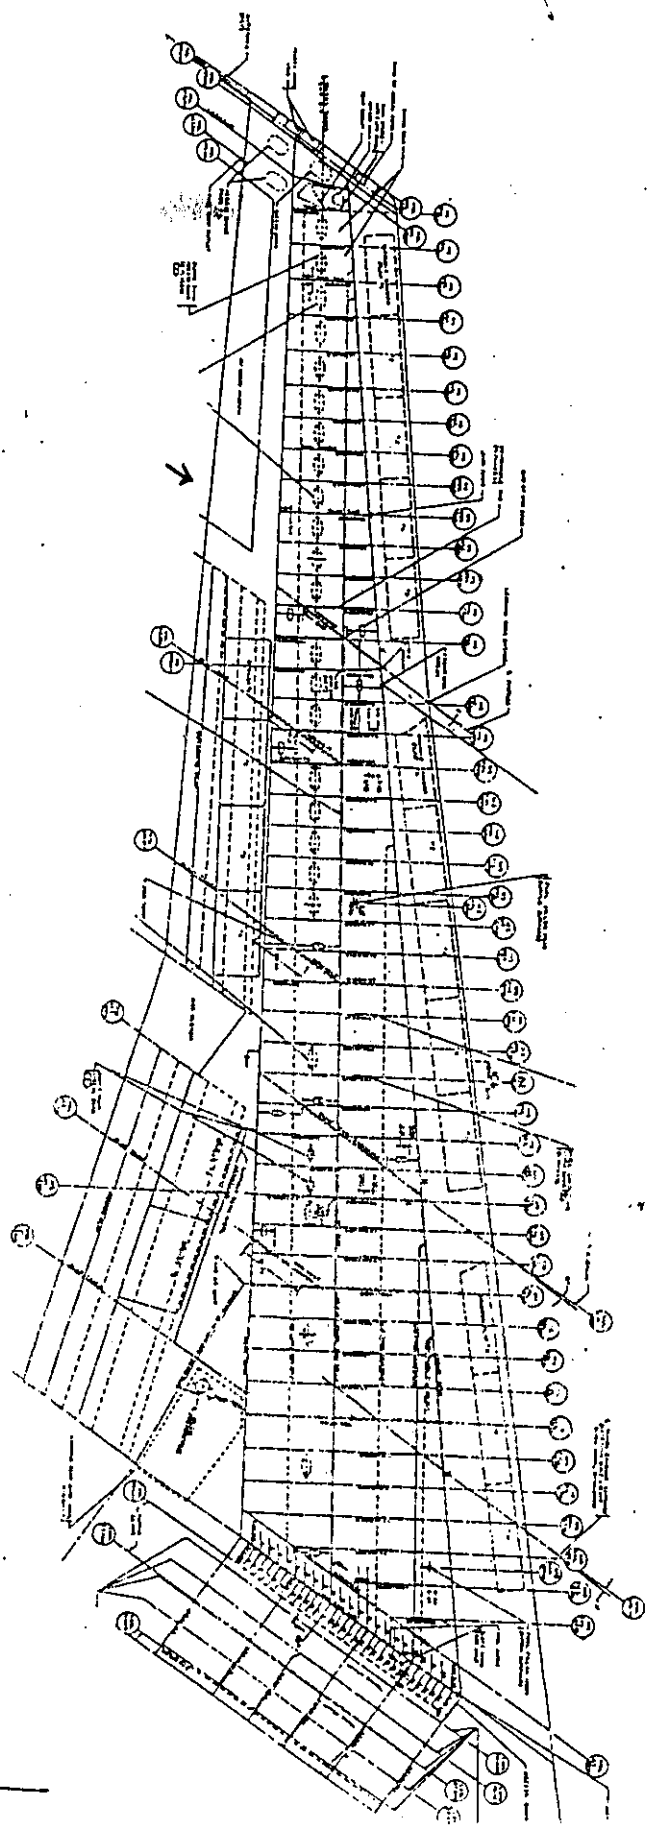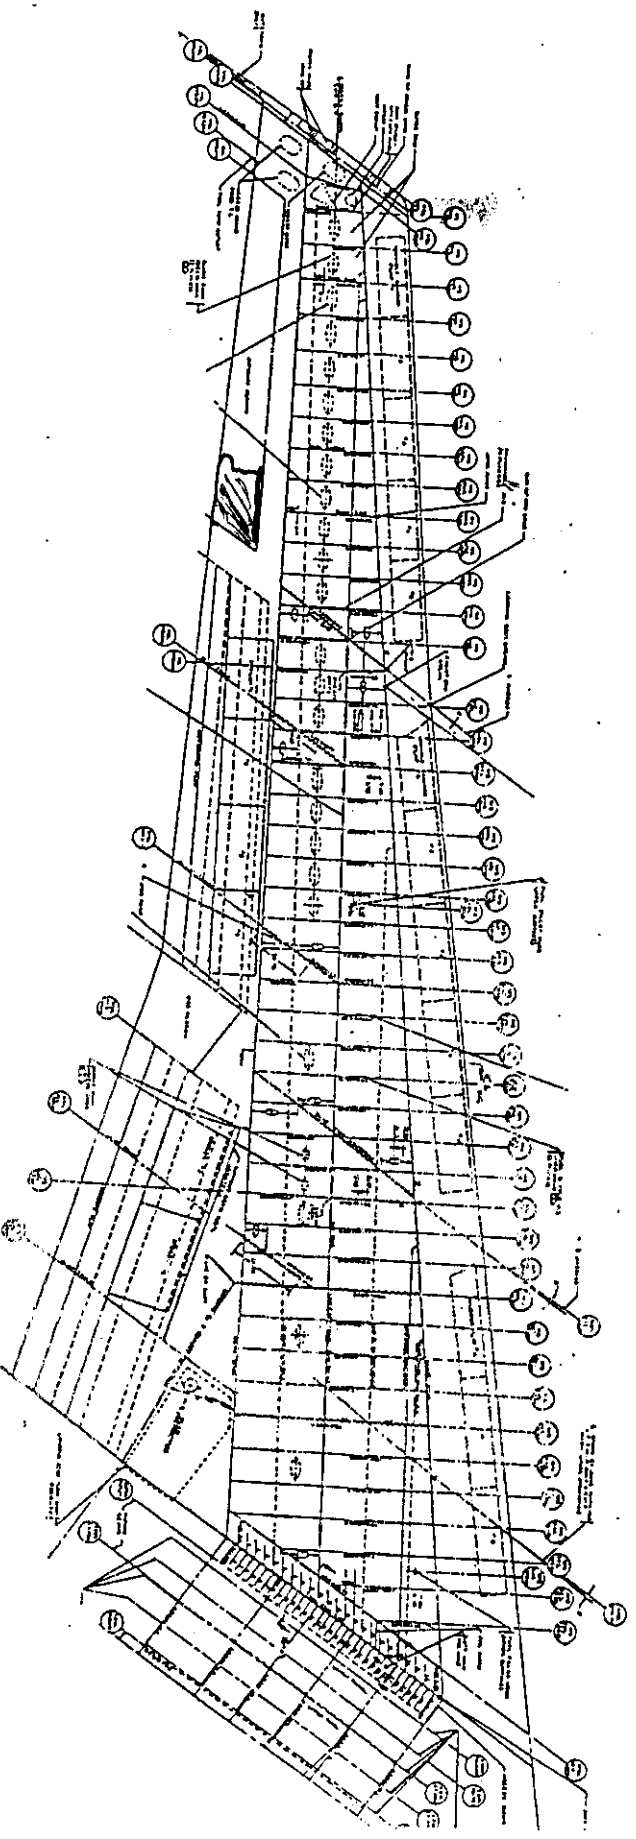

3