

LOG # RF137

TARGET # Z2883

COORD: LAT _____
LONG _____



RF137 CONSISTS OF

WEB AND LOWER CHORD OF RBL DEBRIS FIELD GREEN
33.99 FLOOR BEAM SECTION FROM STA. 1440 TO 1480.

THE VERTICAL FLANGE OF THE SEAT TRACK IS STILL ATTACHED.
A 12 INCH PORTION OF UPPER CROWN IS STILL ATTACHED.
THE LOWER CHORD HAS FAILED ALL ALONG THE
FLANGE RADIUS AND IS HELD TO THE WEB WITH A
HEAVY FITTING / CLIP AT STA. 1460. WEB HAS A

WAVE TYPE BENDING IN THE LEFT-RIGHT DIRECTION.

THE LOWER CHORD STILL HAS A PORTION OF THE
PRESSURE DECK SKIN ATTACHED.

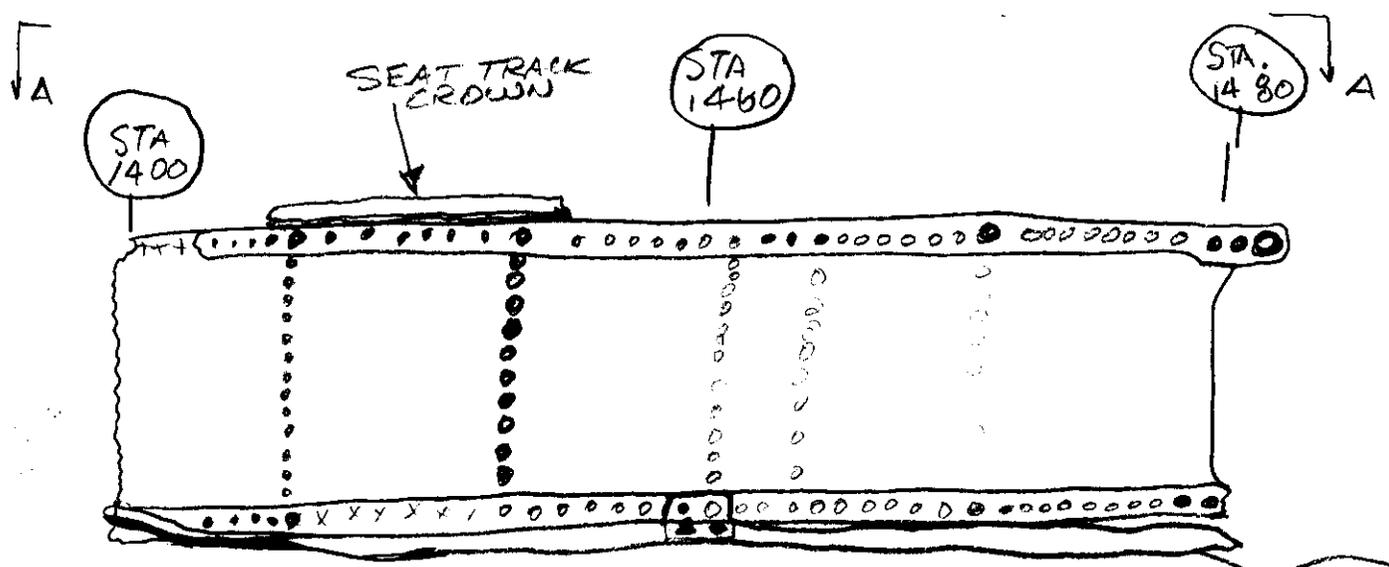

LOWER CHORD

Dennis Santiago SAM
3-7-97

Robert D. [unclear] TWA 2/2/97
Stephen F. Klupackon
02-05-97
R Hanauer 3/23/97 Boeing

Leigh D. Johnson
3-17-97

65B133 55


65B133 55

FOR REWORK SEE
65B023926-1-2
65B023978-101 THRU-108
-91, 92, 167, 4-170

Not Valid After 03 17 1997
Frame: 3 of 5

Boeing Proprietary
SH: 0001
REV: R
Window Print

Order: 28563
DWG: 65B07999
Commercial Data

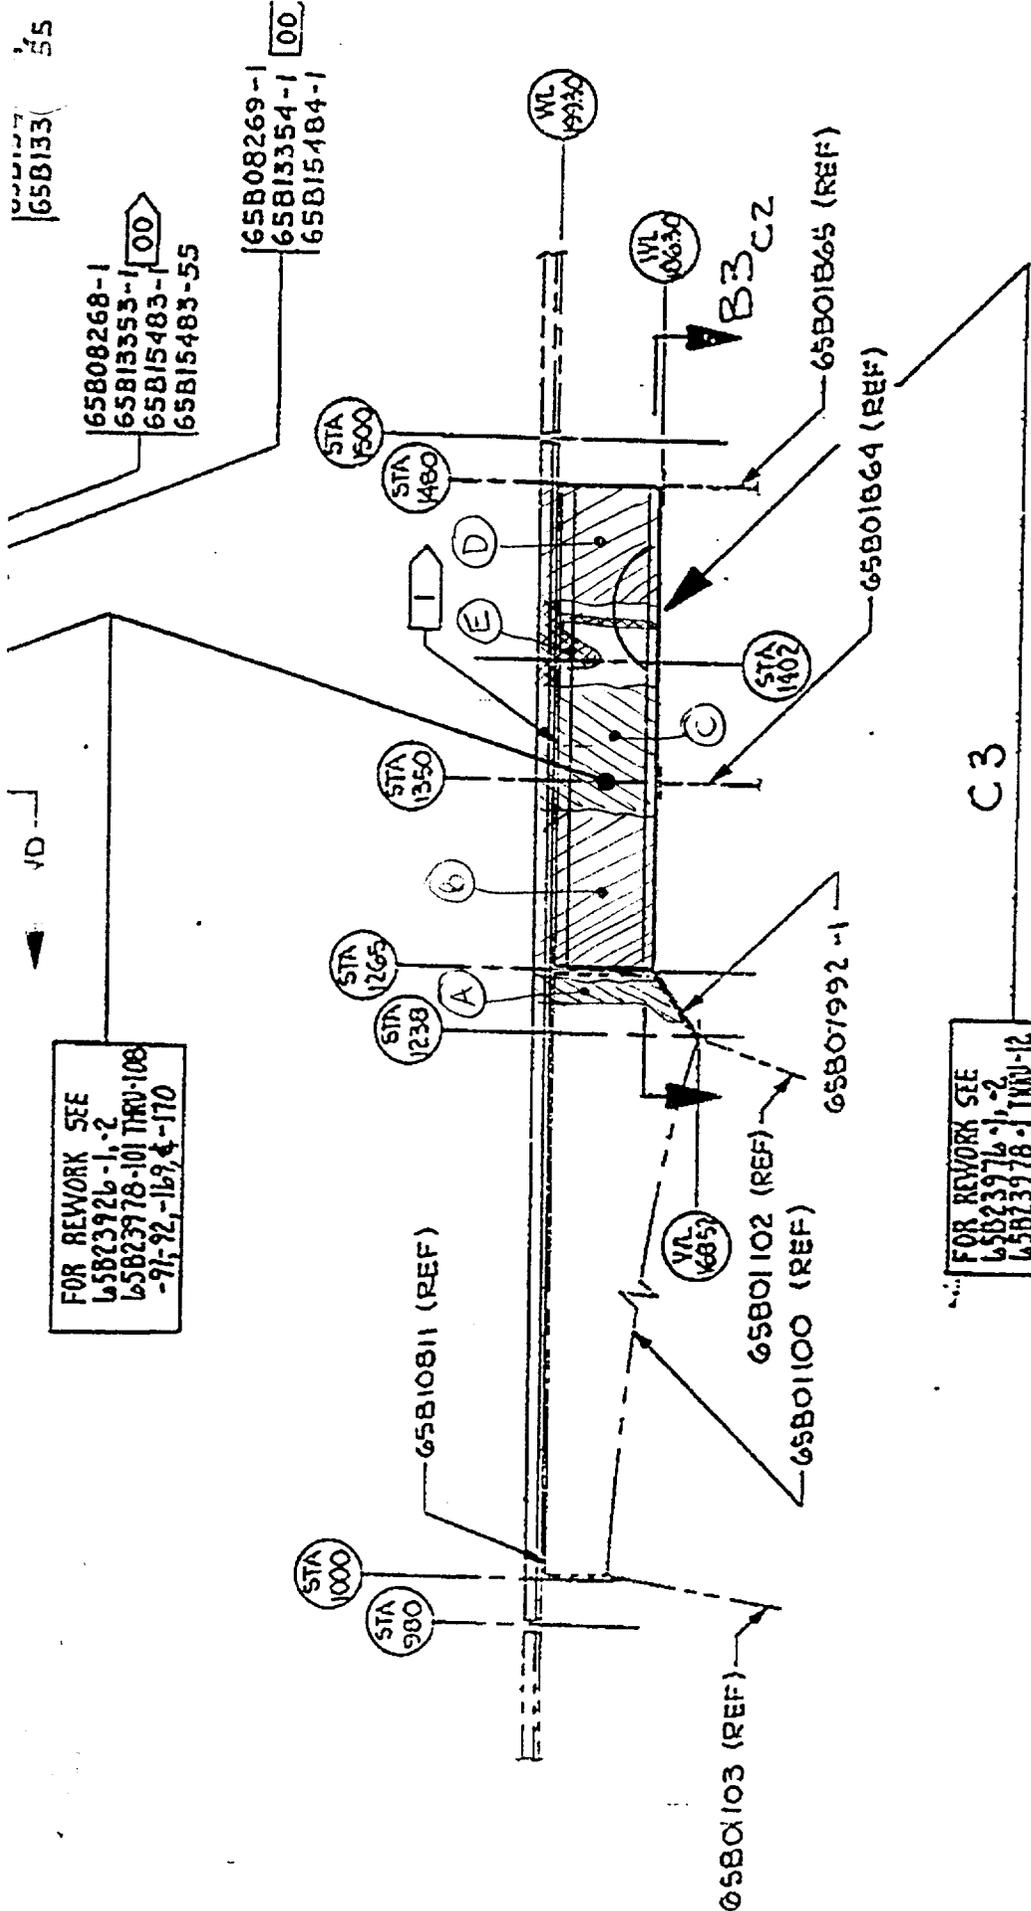

FOR REWORK SEE
65B023976-1-2
65B023978-1 THRU-12
65B024706-1-2-3-4

ITEM	LOG #
A	LF16A*
B	RF126*
C	RF136
D	RF137
E	RF143

UP
FWD
SCALE: NONE

RBL 33.99
FLR BM

* PART OF