

Z2505

LOG # RF77 ^{M/S} _{10/96}

TARGET # RS-3274

COORD: LAT 40-39:46.4

LONG 72-37:10.20

DEBRIS FIELD GREEN

RF77

RIGHT SIDE FUSELAGE SKIN BETWEEN
STA 1120 + STA 1146 FROM S23R AND S27R.

PIECE IS NEARLY A PERFECT RECTANGLE
WITH NO STRINGERS OR FRAMES ATTACHED.

ALL RIVETS FRACTURED IN TENSION LEAVING
STUBS ON MATING STRINGERS + FRAMES.

PART IS EVENLY LIGHTLY SOOTED AND
SHOWS NO SIGNS OF MECHANICAL DAMAGE.

PLEASE NOTE THAT RF17 DIRECTLY BEHIND
THIS WAS BURNED BADLY AND RF36 DIRECTLY
IN FRONT WAS HEAVILY SOOTED.

PART CAME FROM GREEN ZONE

WHITTINGTON 9/11/96
BOEING

Louy (u) FAA

10.24.96

Dennis Denting IAM


10/25/96

D. J. [Signature] 2-12-97
TWA


REFER FIRE AND EXPLOSION GROUP NOTES FOR FIRE DAMAGE

2

RF 77

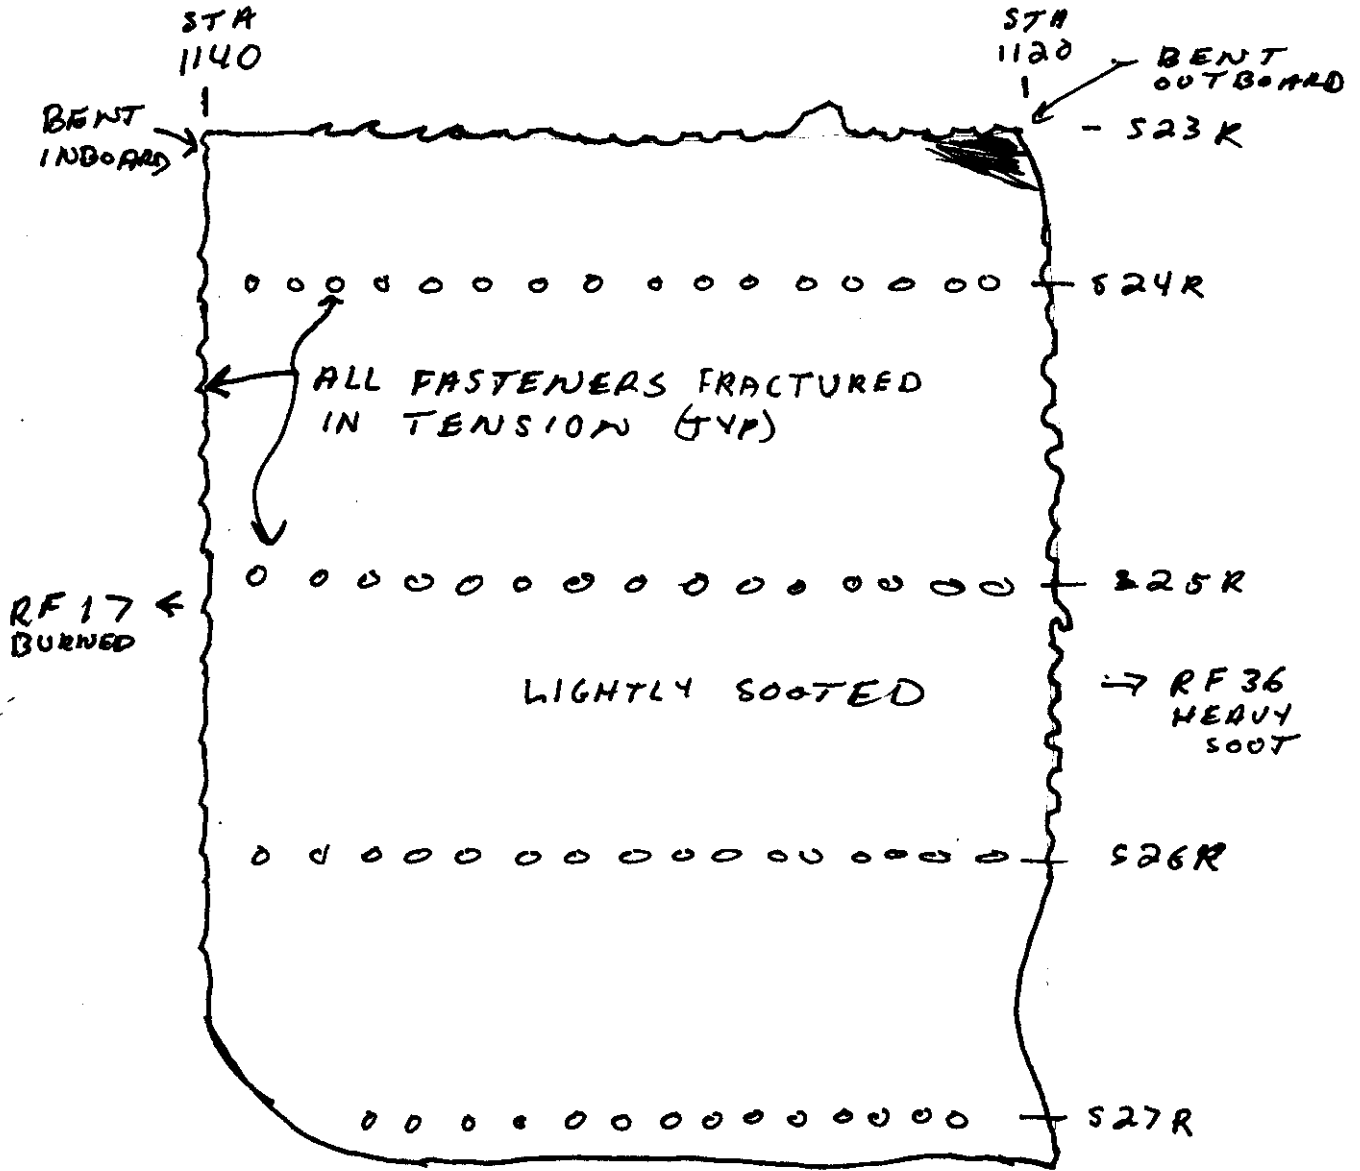

VIEW LOOKING IN BD

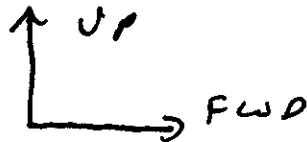

WHITTINGTON / BOEING 9/11/96
TMO King TWA 10-10-96
Lou Sabhu 10-24-96 **3**