

64 B  
64 D



**SS NORWAY**

**2001**

**DRYDOCK**

**SEPTEMBER 23**

**///**

**OCTOBER 14**

**(TENTATIVE)**

NCL 0063477



# S/S NORWAY

---

## DRY-DOCK 2001

NCL 0063861

US REPRESENTATIVE SHIP OR LAND OPERATIONS AGENCY INC.  
469 N.E. 189TH STREET MIAMI, FL 33179  
PHONE: (305) 655-0515/655-1318 FAX: (305) 655-0644



JULY 11<sup>TH</sup>, 2001

MR. KNUT KRINGSTAD  
C/O STAR CRUISES & NORWEGIAN CRUISE LINE  
7665 CORPORATE CENTER DRIVE  
MIAMI, FLORIDA 33126

---


REFERENCE: SS NORWAY DRY- DOCK ADDITIONAL WORK

DEAR MR. KRINGSTAD

WE ARE PLEASED TO SUBMIT TO YOU THE FOLLOWING PROPOSAL FOR  
THE VARIOUS ADDITIONAL WORK ONBOARD THE SS NORWAY

IF YOU HAVE ANY QUESTIONS CONCERNING THIS PROPOSAL PLEASE FEEL  
FREE TO CONTACT US AT 305-655-0515. IF YOU FIND THIS PROPOSAL  
SATISFACTORY PLEASE SEND YOUR ACCEPTENCE IN THE FORM OF A  
PURCHASE ORDER

SINCERELY,

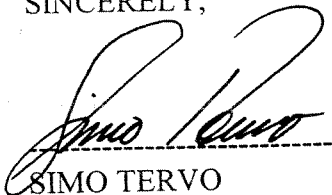

SIMO TERVO

NCL 0063862

US REPRESENTATIVE SHIP OR LAND OPERATIONS AGENCY INC.  
469 N.E. 189TH STREET MIAMI, FL 33179  
PHONE: (305) 655-0515/655-1318 FAX: (305) 655-0644



## S/S NORWAY DRYDOCK 2001

**SPEC ITEM:** 223.01

**JOB LOCATION:** FWD ENG ROOM P/S CENTER FRAME 192

---

**JOB DESCRIPTION:** RENEWAL OF SUPPORT COLUMN

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

1. 6 MTR 1/2" x 10" C/S FLAT BAR
2. 1 PKG 3.25mm WELDING RODS

**MATERIAL COST:** \$ 160.00

**INSTALLATION COST:** \$ 1,400.00

NCL 0063863

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 223.01	OF
Date: 10.01.01	To be performed by : Yard <input type="checkbox"/> Specialist <input type="checkbox"/>		DEPARTMENT:	Engine	X Deck
Sign.: kk	Sub Contr. <input checked="" type="checkbox"/> Ship crew <input type="checkbox"/>			Electr.	Hotel
Job Description RENEWAL OF SUPPORT COLUMN			TO BE INCLUDED:		
Location: Fwd engine room, port center. frame 192			<input type="checkbox"/> GAS FREE CERTIFICATE		
Component:			<input type="checkbox"/> LIGHT		
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:			<input type="checkbox"/> VENTILATION		
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.			<input type="checkbox"/> STAGING - MTRS.		
223.01 RENEWAL OF SUPPORT COLUMN			<input type="checkbox"/> CLEANING BEFORE		
Furnish labor and material to renew section of column, from tanktop for permanent ballast tank 6,4 and up 1500 mm			<input type="checkbox"/> CLEANING AFTER		
Tank 6.4 to be ventilated and gas freed by others			<input type="checkbox"/> CRANE		
Size: 250 x 250 mm			<input type="checkbox"/> INTERNAL TRANSPORT		
Steel thickness: 12,5 mm			<input type="checkbox"/> TRANSPORT OUTSIDE YARD		
			<input type="checkbox"/> ACCESS		
			<input type="checkbox"/> PRESSURE TESTING		
			<input type="checkbox"/> CORROSION PROTECTION		
			<input type="checkbox"/> PAINTWORK		
			<input type="checkbox"/> LAGGING/INSULATION		
			<input type="checkbox"/> OIL COLLECTION		
			<input type="checkbox"/> DISPOSAL		
			<input type="checkbox"/> MATERIAL/SPARE PARTS YARD SUPPLY		
			X MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY		
			<input type="checkbox"/> MATERIAL/SPARE PARTS OWNER'S SUPPLY		
			<input type="checkbox"/> MATERIAL / SPARE PARTS VESSEL SUPPLY		
			ENCLOSED:		
			<input type="checkbox"/> DRAWING		
			<input type="checkbox"/> PHOTO		
			<input type="checkbox"/> SKETCH		
			<input type="checkbox"/> INSTRUCTION BOOK		
			<input type="checkbox"/> SAMPLE		
			THE WORK TO BE SURVEYED BY:		
			<input type="checkbox"/> FLAGSTATE		
			<input type="checkbox"/> CLASS		
			<input type="checkbox"/> MARITIME AUTHORITIES		
			<input type="checkbox"/> MANUFACTURER		
			<input type="checkbox"/> SERVICE REPRESENTATIVE		
			<input type="checkbox"/> SUPERINTENDENT		
			x VESSEL		
PURCHASE ORDER (S):					
ACKNOWLEDGED DELIVERY DATE:					
DATE RECEIVED ON BOARD					
REMARKS:					
PRICE FOR ABOVE WORK:					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					

NCL 0063864



## S/S NORWAY DRYDOCK 2001

**SPEC ITEM:** 226.02

**JOB LOCATION:** OLYMPIC DECK P/S & STB/S ACCORDING TO LIST

**JOB DESCRIPTION:** RENEWAL OF STEEL IN LIFE BOAT DAVITS

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

1. 15 PCS 1/2" x 90 x 400mm C/S PLATE
2. 2 PKG 3.25mm WELDING RODS

**MATERIAL COST:**

\$ 220.00

**INSTALLATION COST:**

\$ 4.200.00

NCL 0063865

Star Cruises SS Norway <b>SPECIFICATION OF REPAIR</b>		SPEC NO. AMOS NO. YARD NO.		Page: 1 OF 1
Date: 12.10.00	To be Performed by:			Engine X Deck X
Sign.: kk	YARD <input type="checkbox"/>	SPECIALIST <input type="checkbox"/>	DEPARTMENT:	Electr. Hotel
	SUB CONTR. <input type="checkbox"/>	SHIPS CREW <input type="checkbox"/>		HVAC/R Club
Job Description RENEWAL OF STEEL ON LIFE BOAT DAVITS				<b>TO BE INCLUDED:</b>
Location: Olympic Deck port and starboard, according to list				GAS FREE CERTIFICATE
Component:				LIGHT
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:				VENTILATION
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.				STAGING - MTRS.
226.02	RENEWAL OF STEEL IN LIFE BOAT DAVITS			CLEANING BEFORE
The frame for the davits, which roll down in this frame, are built up of two heavy U shaped beams facing each other. In certain parts, the steel is worn down by the rollers.				CLEANING AFTER
Subcontractor to furnish labor and material to cut out worn sections and welds in new steel. Each section is approx. 90 mm wide, 400 mm long and 12 mm thick				CRANE
Total of 15 sections to be repaired				INTERNAL TRANSPORT
Repair to be approved by Class.				TRANSPORT OUTSIDE YARD
				ACCESS
				PRESSURE TESTING
				CORROSION PROTECTION
				PAINTWORK
				LAGGING/INSULATION
				OIL COLLECTION
				DISPOSAL
				MATERIAL/SPARE PARTS YARD SUPPLY
				X MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY
				MATERIAL/SPARE PARTS OWNER'S SUPPLY
				MATERIAL / SPARE PARTS VESSEL SUPPLY
				<b>ENCLOSED:</b>
				DRAWING
				PHOTO
				SKETCH
				INSTRUCTION BOOK
				SAMPLE
				<b>THE WORK TO BE SURVEYED BY:</b>
				FLAGSTATE
				X CLASS
				MARITIME AUTHORITIES
				MANUFACTURER
				SERVICE REPRESENTATIVE
				SUPERINTENDENT
				X VESSEL
PURCHASE ORDER (S):				
ACKNOWLEDGED DELIVERY DATE:				
DATE RECEIVED ON BOARD				
REMARKS:				
PRICE FOR ABOVE WORK:				
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488				

NCL 0063866



## S/S NORWAY DRYDOCK 2001

**SPEC ITEM:** 226.03

**JOB LOCATION:** FWD ENG ROOM FRAME 196 CENTER-STB

---

**JOB DESCRIPTION:** REPAIR OF BULKHEAD

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

1. 1/2 m2 1/2" C/S PLATE
2. 1 PKG 3.25mm WELDING RODS

**MATERIAL COST:** \$ 120.00

**INSTALLATION COST:** \$ 3,800.00

NCL 0063867



Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 226.03	OF
Date: 10.01.01	To be performed by : Yard <input type="checkbox"/> Specialist <input type="checkbox"/>		DEPARTMENT:	Engine	X Deck
Sign.: kk	Sub Contr. <input checked="" type="checkbox"/> Ship crew <input type="checkbox"/>			Electr.	Hotel
Job Description REPAIR OF BULKHEAD			TO BE INCLUDED:		
Location: Fwd eng. room, frame 196, center starboard			GAS FREE CERTIFICATE		
Component:			LIGHT		
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:			VENTILATION		
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.			STAGING - MTRS.		
226.03 REPAIR OF BULKHEAD			CLEANING BEFORE		
Subcontractor to furnish labor and material to remove one cement box, cut out a corroded section of bulkhead, approximately 700 x 400 mm and weld inn new 12,5 mm steel plate.			CLEANING AFTER		
Welding on top of fuel tank 6.1 and 5,3 is necessary, therefor tanks involved to be gas freed and certified safe for men and hotwork..			CRANE		
Gas freeing of tanks to be carried out by others			INTERNAL TRANSPORT		
			TRANSPORT OUTSIDE YARD		
			ACCESS		
			PRESSURE TESTING		
			CORROSION PROTECTION		
			PAINTWORK		
			LAGGING/INSULATION		
			OIL COLLECTION		
			DISPOSAL		
			MATERIAL/SPARE PARTS YARD SUPPLY		
			X MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY		
			MATERIAL/SPARE PARTS OWNER'S SUPPLY		
			MATERIAL / SPARE PARTS VESSEL SUPPLY		
			ENCLOSED:		
			DRAWING		
			PHOTO		
			SKETCH		
			INSTRUCTION BOOK		
			SAMPLE		
			THE WORK TO BE SURVEYED BY:		
			FLAGSTATE		
			CLASS		
			MARITIME AUTHORITIES		
			MANUFACTURER		
			SERVICE REPRESENTATIVE		
			SUPERINTENDENT		
			x VESSEL		
PURCHASE ORDER (S):					
ACKNOWLEDGED DELIVERY DATE:					
DATE RECEIVED ON BOARD					
REMARKS:					
PRICE FOR ABOVE WORK:					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					

NCL 0063868



## **S/S NORWAY DRYDOCK 2001**

**SPEC ITEM: 252.01**

**JOB LOCATION: SUN & SKY DECK P/S & STB/S**

---

**JOB DESCRIPTION: RENEWAL OF INSULATION ON AIR INTAKE**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

- 1. 293 m2 50mm ROCKWOOL INSULATION DNV APPROVED**
- 2. 30 PCS TAPE**
- 3. 2 GAL MASTIC**
- 5. 3000 PCS WELD PINS & WASHERS**

**MATERIAL COST: \$ 5,400.00**

**INSTALLATION COST: \$ 19,800.00**

**NCL 0063869**

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMQS NO. YARD NO.		Page: 252.01	OF
Date: 10.01.01	To be performed by :		DEPARTMENT:		
Sign.: kk	Yard <input type="checkbox"/>	Specialist <input type="checkbox"/>	Engine	Deck	
	Sub Contr. <input checked="" type="checkbox"/>	Ship crew <input type="checkbox"/>	Electr.	Hotel	
Job Description	RENEWAL OF INSULATION IN AIR INTAKE		HVAC/R	X	Club
Location:	Sun and Sky deck, port and starboard side.		<b>TO BE INCLUDED:</b>		
Component:				GAS FREE CERTIFICATE	
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:				LIGHT	
Detailed Specification:	Including: Size, Amount, Dimension, Material, Etc.			VENTILATION	
252.01	RENEWAL OF INSULATION ON AIR INTAKE		X	STAGING - MTRS.	
	Subcontractor to furnish labor and material to re-insulate air intake for fwd engine room. Existing insulation is covered with thin plates, yard to remove this and replace with suitable insulation mats where thin plate is not needed			CLEANING BEFORE	
	Total area for both sides is approximately 293 M2			CLEANING AFTER	
	Subcontractor to cover fan suction to protect fan from old insulation			CRANE	
	Some staging is necessary			INTERNAL TRANSPORT	
				TRANSPORT OUTSIDE YARD	
				ACCESS	
				PRESSURE TESTING	
				CORROSION PROTECTION	
			X	PAINTWORK	
				LAGGING/INSULATION	
			X	OIL COLLECTION	
				DISPOSAL	
				MATERIAL/SPARE PARTS YARD SUPPLY	
			X	MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY	
				MATERIAL/SPARE PARTS OWNER'S SUPPLY	
				MATERIAL / SPARE PARTS VESSEL SUPPLY	
			<b>ENCLOSED:</b>		
				DRAWING	
				PHOTO	
				SKETCH	
				INSTRUCTION BOOK	
				SAMPLE	
			<b>THE WORK TO BE SURVEYED BY:</b>		
				FLAGSTATE	
				CLASS	
				MARITIME AUTHORITIES	
				MANUFACTURER	
				SERVICE REPRESENTATIVE	
				SUPERINTENDENT	
			x	VESSEL	
<b>PURCHASE ORDER (S):</b>					
<b>ACKNOWLEDGED DELIVERY DATE:</b>					
<b>DATE RECEIVED ON BOARD</b>					
<b>REMARKS:</b>					
<b>PRICE FOR ABOVE WORK:</b>					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					

NCL 0063870



## S/S NORWAY DRYDOCK 2001

**SPEC ITEM:** 252.03

**JOB LOCATION:** AFT FUNNEL P/S & STB/S

---

**JOB DESCRIPTION:** RENEWAL OF INSULATION ON AIR INTAKE

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

1. 15 m2 50mm ROCKWOLL INSULATION
2. 3 PCS TAPE
3. 1 QT MASTIC
4. 300 PCS WELD PINS & WASHESR

**MATERIAL COST:** \$ 500.00

**INSTALLATION COST:** \$ 4,400.00

NCL 0063871

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 252.03	OF
Date: 10.01.01	To be performed by : Yard <input type="checkbox"/> Specialist <input type="checkbox"/>		DEPARTMENT:	Engine	Deck
Sign.: kk	Sub Contr. <input checked="" type="checkbox"/> Ship crew <input type="checkbox"/>			Electr.	Hotel
Job Description RENEWAL OF INSULATION			TO BE INCLUDED:		
Location: Aft funnel port and starboard side			<input type="checkbox"/> GAS FREE CERTIFICATE		
Component:			<input type="checkbox"/> LIGHT		
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:			<input type="checkbox"/> VENTILATION		
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.			<input type="checkbox"/> STAGING - MTRS.		
252.03 RENEWAL OF INSULATION.			<input type="checkbox"/> CLEANING BEFORE		
Subcontractor to furnish labor and material to remove and renew insulation for air intake for aft aux engine room, port and stb. side.			<input type="checkbox"/> CLEANING AFTER		
Total area 15 m2			<input type="checkbox"/> CRANE		
Old insulation have sheet metal covering, new insulation to be suitable mats where sheet metal is not necessary			<input checked="" type="checkbox"/> INTERNAL TRANSPORT		
			<input type="checkbox"/> TRANSPORT OUTSIDE YARD		
			<input type="checkbox"/> ACCESS		
			<input type="checkbox"/> PRESSURE TESTING		
			<input type="checkbox"/> CORROSION PROTECTION		
			<input type="checkbox"/> PAINTWORK		
			<input checked="" type="checkbox"/> LAGGING/INSULATION		
			<input type="checkbox"/> OIL COLLECTION		
			<input checked="" type="checkbox"/> DISPOSAL		
			<input type="checkbox"/> MATERIAL/SPARE PARTS YARD SUPPLY		
			<input checked="" type="checkbox"/> MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY		
			<input type="checkbox"/> MATERIAL/SPARE PARTS OWNER'S SUPPLY		
			<input type="checkbox"/> MATERIAL / SPARE PARTS VESSEL SUPPLY		
ENCLOSED:					
<input type="checkbox"/> DRAWING					
<input type="checkbox"/> PHOTO					
<input type="checkbox"/> SKETCH					
<input type="checkbox"/> INSTRUCTION BOOK					
<input type="checkbox"/> SAMPLE					
THE WORK TO BE SURVEYED BY:					
<input type="checkbox"/> FLAGSTATE					
<input type="checkbox"/> CLASS					
<input type="checkbox"/> MARITIME AUTHORITIES					
<input type="checkbox"/> MANUFACTURER					
<input type="checkbox"/> SERVICE REPRESENTATIVE					
<input type="checkbox"/> SUPERINTENDENT					
<input checked="" type="checkbox"/> VESSEL					
PURCHASE ORDER (S):					
ACKNOWLEDGED DELIVERY DATE:					
DATE RECEIVED ON BOARD					
REMARKS:					
PRICE FOR ABOVE WORK:					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					

NCL 0063872



## S/S NORWAY DRYDOCK 2001

**SPEC ITEM:** 252.04

**JOB LOCATION:** SUP 6 VIKING DECK FRAME 97

---

**JOB DESCRIPTION:** REPAIR OF DECK IN VENTILATION ROOM

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

1. 0.5 m2 8mm STEEL PLATE
2. 1 PKG 3.25mm WELDING RODS

**MATERIAL COST:** \$ 120.00

**INSTALLATION COST:** \$ 1,400.00

NCL 0063873

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 252.04	OF
Date: 10.01.01	To be performed by : Yard <input type="checkbox"/> Specialist <input type="checkbox"/>		DEPARTMENT:	Engine	Deck
Sign.: kk	Sub Contr. <input checked="" type="checkbox"/> Ship crew <input type="checkbox"/>			Electr.	Hotel
Job Description REPAIR OF FLOOR IN VENTILATION ROOM			TO BE INCLUDED:		
Location: Sup 6, Viking deck , Frame 97			<input type="checkbox"/> GAS FREE CERTIFICATE		
Component:			<input type="checkbox"/> LIGHT		
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:			<input type="checkbox"/> VENTILATION		
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.			<input type="checkbox"/> STAGING - MTRS.		
252.04 REPAIR OF FLOOR IN VENTILATION ROOM			<input type="checkbox"/> CLEANING BEFORE		
Subcontractor to furnish labor and material to weld 8 mm doubler plate over corroded area on floor in fwd part of vent room Sup 6.			<input type="checkbox"/> CLEANING AFTER		
Total area; 0,5 m2			<input type="checkbox"/> CRANE		
			<input type="checkbox"/> INTERNAL TRANSPORT		
			<input type="checkbox"/> TRANSPORT OUTSIDE YARD		
			<input type="checkbox"/> ACCESS		
			<input type="checkbox"/> PRESSURE TESTING		
			<input type="checkbox"/> CORROSION PROTECTION		
			<input type="checkbox"/> PAINTWORK		
			<input type="checkbox"/> LAGGING/INSULATION		
			<input type="checkbox"/> OIL COLLECTION		
			<input type="checkbox"/> DISPOSAL		
			<input type="checkbox"/> MATERIAL/SPARE PARTS YARD SUPPLY		
			<input checked="" type="checkbox"/> MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY		
			<input type="checkbox"/> MATERIAL/SPARE PARTS OWNER'S SUPPLY		
			<input type="checkbox"/> MATERIAL / SPARE PARTS VESSEL SUPPLY		
			ENCLOSED:		
			<input type="checkbox"/> DRAWING		
			<input type="checkbox"/> PHOTO		
			<input type="checkbox"/> SKETCH		
			<input type="checkbox"/> INSTRUCTION BOOK		
			<input type="checkbox"/> SAMPLE		
			THE WORK TO BE SURVEYED BY:		
			<input type="checkbox"/> FLAGSTATE		
			<input type="checkbox"/> CLASS		
			<input type="checkbox"/> MARITIME AUTHORITIES		
			<input type="checkbox"/> MANUFACTURER		
			<input type="checkbox"/> SERVICE REPRESENTATIVE		
			<input type="checkbox"/> SUPERINTENDENT		
			<input checked="" type="checkbox"/> VESSEL		
PURCHASE ORDER (S):					
ACKNOWLEDGED DELIVERY DATE:					
DATE RECEIVED ON BOARD					
REMARKS:					
PRICE FOR ABOVE WORK:					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					

NCL 0063874



## S/S NORWAY DRYDOCK 2001

**SPEC ITEM: 252.05**

**JOB LOCATION: EMB4 OLYMPIC DECK FRAME 184**

**JOB DESCRIPTION: REPAIR OF DECK IN VENTILATION ROOM**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

1. 1 m2 8mm STEEL PLATE
2. 1 PKG 3.25mm WELDING RODS

**MATERIAL COST: \$ 160.00**

**INSTALLATION COST: \$ 1,800.00**

NCL 0063875



Star Cruises SS Norway <b>SPECIFICATION OF REPAIR</b>		SPEC NO.	Page: 252.05	OF
Date: 10.01.01		AMOS NO.		
To be performed by : Yard <input type="checkbox"/> Specialist <input type="checkbox"/>		YARD NO.		
Sign.: kk	Sub Contr. <input checked="" type="checkbox"/> Ship crew <input type="checkbox"/>	DEPARTMENT:	Engine	Deck
			Electr.	Hotel
			HVAC/R	X Club
Job Description	REPAIR OF FLOOR IN VENTILATION ROOM		<b>TO BE INCLUDED:</b>	
Location:	EMB4 Olympic deck, frame 184		GAS FREE CERTIFICATE	
Component:			LIGHT	
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:			VENTILATION	
Detailed Specification:	Including: Size, Amount, Dimension, Material, Etc.		STAGING - MTRS.	
252.05	REPAIR OF FLOOR IN VENTILATION ROOM		CLEANING BEFORE	
	Subcontractor to furnish labor and material to repair floor by weld in 8 mm doubler plate over corroded area.		CLEANING AFTER	
	Tatal area; 1 m2		CRANE	
	Subcontractor to remove and afterwards replace filter holder and collecting tray for pool.		INTERNAL TRANSPORT	
			TRANSPORT OUTSIDE YARD	
			ACCESS	
			PRESSURE TESTING	
			CORROSION PROTECTION	
			PAINTWORK	
			LAGGING/INSULATION	
			OIL COLLECTION	
			DISPOSAL	
			MATERIAL/SPARE PARTS YARD SUPPLY	
			X MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY	
			MATERIAL/SPARE PARTS OWNER'S SUPPLY	
			MATERIAL / SPARE PARTS VESSEL SUPPLY	
<b>ENCLOSED:</b>				
	DRAWING			
	PHOTO			
	SKETCH			
	INSTRUCTION BOOK			
	SAMPLE			
<b>THE WORK TO BE SURVEYED BY:</b>				
	FLAGSTATE			
	CLASS			
	MARITIME AUTHORITIES			
	MANUFACTURER			
	SERVICE REPRESENTATIVE			
	SUPERINTENDENT			
x	VESSEL			
PURCHASE ORDER (S):				
ACKNOWLEDGED DELIVERY DATE:				
DATE RECEIVED ON BOARD				
REMARKS:				
PRICE FOR ABOVE WORK:				
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488				

NCL 0063876



## **S/S NORWAY DRYDOCK 2001**

**SPEC ITEM: 252.06**

**JOB LOCATION: SUN 6 AR FJORD DECK FRAME 104**

---

**JOB DESCRIPTION: FLOOR REPAIR**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

- 1. 0.5 m2 8mm STEEL PLATE**
- 2. 1 PKG 3.25mm WELDING RODS**

**MATERIAL COST: \$ 120.00**

**INSTALLATION COST: \$ 1,400.00**

**NCL 0063877**

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 252.06	OF			
Date: 10.01.01	To be performed by:							
Sign.: kk	Yard	<input type="checkbox"/>	Specialist	<input type="checkbox"/>				
	Sub Contr.	<input checked="" type="checkbox"/>	Ship crew	<input type="checkbox"/>				
Job Description FLOOR REPAIR			DEPARTMENT:					
Location: Sun 6 AR Fjord deck, Frame 104			TO BE INCLUDED:					
Component:			<input type="checkbox"/> GAS FREE CERTIFICATE					
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:			<input type="checkbox"/> LIGHT					
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.			<input type="checkbox"/> VENTILATION					
252.06 FLOOR REPAIR			<input type="checkbox"/> STAGING - MTRS.					
Subcontractor to furnish labor and material to weld in 8 mm doubling plate over corroded area in fan room. Approximately 0,5 m2			<input type="checkbox"/> CLEANING BEFORE					
			<input type="checkbox"/> CLEANING AFTER					
			<input type="checkbox"/> CRANE					
			<input type="checkbox"/> INTERNAL TRANSPORT					
			<input type="checkbox"/> TRANSPORT OUTSIDE YARD					
			<input type="checkbox"/> ACCESS					
			<input type="checkbox"/> PRESSURE TESTING					
			<input type="checkbox"/> CORROSION PROTECTION					
			<input type="checkbox"/> PAINTWORK					
			<input type="checkbox"/> LAGGING/INSULATION					
			<input type="checkbox"/> OIL COLLECTION					
			<input type="checkbox"/> DISPOSAL					
			<input type="checkbox"/> MATERIAL/SPARE PARTS YARD SUPPLY					
			<input checked="" type="checkbox"/> MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY					
			<input type="checkbox"/> MATERIAL/SPARE PARTS OWNER'S SUPPLY					
			<input type="checkbox"/> MATERIAL / SPARE PARTS VESSEL SUPPLY					
			ENCLOSED:			<input type="checkbox"/> DRAWING		
						<input type="checkbox"/> PHOTO		
						<input type="checkbox"/> SKETCH		
						<input type="checkbox"/> INSTRUCTION BOOK		
			<input type="checkbox"/> SAMPLE					
THE WORK TO BE SURVEYED BY:			<input type="checkbox"/> FLAGSTATE					
			<input type="checkbox"/> CLASS					
			<input type="checkbox"/> MARITIME AUTHORITIES					
			<input type="checkbox"/> MANUFACTURER					
			<input type="checkbox"/> SERVICE REPRESENTATIVE					
			<input type="checkbox"/> SUPERINTENDENT					
			<input checked="" type="checkbox"/> VESSEL					
PURCHASE ORDER (S):								
ACKNOWLEDGED DELIVERY DATE:								
DATE RECEIVED ON BOARD								
REMARKS:								
PRICE FOR ABOVE WORK:								
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488								

NCL 0063878



## S/S NORWAY DRYDOCK 2001

**SPEC ITEM: 285.02**

**JOB LOCATION: DOUBLE BOTTOM FWD**

---

**JOB DESCRIPTION: RENEWAL OF STEEL IN BALLAST TANK 1.2**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

1. 4 m2 1/2" STEEL PLATE
2. 2 PKG 3.25mm WELDING RODS

**MATERIAL COST: \$ 470.00**

**INSTALLATION COST: \$ 6,000.00**

NCL 0063879

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 285.02	OF
Date: 13.10.00	To be performed by :		DEPARTMENT:		
Sign.: kk	Yard	<input type="checkbox"/>	Specialist	<input type="checkbox"/>	Engine
	Sub Contr.	<input checked="" type="checkbox"/>	Ship crew	<input type="checkbox"/>	Electr.
Job Description STEEL RENEWAL OF BALLAST TANK 1.2				Deck	x
Location: Double bottom fwd				Hotel	
Component: Tank 1.2				Club	
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:				<b>TO BE INCLUDED:</b>	
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.				GAS FREE CERTIFICATE	
285.02 STEEL RENEWAL OF BALLAST TANKS 1.2				X LIGHT	
Furnish labor and material to remove and renew approx 4 m2 of bulkhead towards tank 2.2				VENTILATION	
Corroded area is approximately 1 x 4 meter. Thickness 12.5 mm				STAGING - MTRS.	
The tanks 1.2 and 2.2 will be ventilated and certified safe for men and hot work, and carried out by others.				CLEANING BEFORE	
Upon completion of repair, tank to be presented to Class Surveyor for survey and test.				CLEANING AFTER	
				CRANE	
				INTERNAL TRANSPORT	
				TRANSPORT OUTSIDE YARD	
				ACCESS	
				PRESSURE TESTING	
				CORROSION PROTECTION	
				PAINTWORK	
				LAGGING/INSULATION	
				OIL COLLECTION	
				DISPOSAL	
				MATERIAL/SPARE PARTS YARD SUPPLY	
				X MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY	
				MATERIAL/SPARE PARTS OWNER'S SUPPLY	
				MATERIAL / SPARE PARTS VESSEL SUPPLY	
				<b>ENCLOSED:</b>	
				DRAWING	
				PHOTO	
				SKETCH	
				INSTRUCTION BOOK	
				SAMPLE	
				<b>THE WORK TO BE SURVEYED BY:</b>	
				FLAGSTATE	
				x CLASS	
				MARITIME AUTHORITIES	
				MANUFACTURER	
				SERVICE REPRESENTATIVE	
				SUPERINTENDENT	
				x VESSEL	
PURCHASE ORDER (S):					
ACKNOWLEDGED DELIVERY DATE:					
DATE RECEIVED ON BOARD					
REMARKS:					
PRICE FOR ABOVE WORK:					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					

NCL 0063880



## **S/S NORWAY DRYDOCK 2001**

**SPEC ITEM: 285.03**

**JOB LOCATION: DOUBLE BOTTOM FWD**

---

**JOB DESCRIPTION: RENEWAL OF STEEL IN BALLAST TANK 1.1**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

- 1. 4 m2 1/2" STEEL PLATE**
- 2. 2 PKG 3.25mm WELDING RODS**

**MATERIAL COST: \$ 470.00**

**INSTALLATION COST: \$ 6,000.00**

**NCL 0063881**

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 285.03	OF
Date: 13.10.00	To be performed by : Yard <input type="checkbox"/> Specialist <input type="checkbox"/>		DEPARTMENT:		Engine X Deck x
Sign.: kk	Sub Contr. <input checked="" type="checkbox"/> Ship-crew <input type="checkbox"/>				Electr. Hotel HVAC/R Club
Job Description STEEL RENEWAL OF BALLAST TANK 1.1			TO BE INCLUDED:		
Location: Double bottom fwd			GAS FREE CERTIFICATE		
Component: Tank 1.1			X LIGHT		
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:			VENTILATION		
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.			STAGING - MTRS.		
285.03 STEEL RENEWAL OF BALLAST TANKS 1.1			CLEANING BEFORE		
Furnish labor and material to remove and renew approx 4 m <sup>2</sup> of bulkhead towards tank 2.1			CLEANING AFTER		
The tank 1.1 and 2.1 will be ventilated and certified safe for men and hot work and be carried out by others.			CRANE		
Corroded area is approximately 1 x 4 meter. Thickness 12.5 mm			INTERNAL TRANSPORT		
Upon completion of repair, tank to be presented to Class Surveyor for survey and test.			TRANSPORT OUTSIDE YARD		
			ACCESS		
			PRESSURE TESTING		
			CORROSION PROTECTION		
			PAINTWORK		
			LAGGING/INSULATION		
			OIL COLLECTION		
			DISPOSAL		
			MATERIAL/SPARE PARTS YARD SUPPLY		
			X MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY		
			MATERIAL/SPARE PARTS OWNER'S SUPPLY		
			MATERIAL / SPARE PARTS VESSEL SUPPLY		
			ENCLOSED:		
			DRAWING		
			PHOTO		
			SKETCH		
			INSTRUCTION BOOK		
			SAMPLE		
			THE WORK TO BE SURVEYED BY:		
			FLAGSTATE		
			x CLASS		
			MARITIME AUTHORITIES		
			MANUFACTURER		
			SERVICE REPRESENTATIVE		
			SUPERINTENDENT		
			x VESSEL		
PURCHASE ORDER (S):					
ACKNOWLEDGED DELIVERY DATE:					
DATE RECEIVED ON BOARD					
REMARKS:					
PRICE FOR ABOVE WORK:					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					

NCL 0063882



## S/S NORWAY DRYDOCK 2001

**SPEC ITEM: 287.06**

**JOB LOCATION: FWD BOILER ROOM**

**JOB DESCRIPTION: REPAIR OF FUEL TANK 5.6**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

- |    |   |     |                     |
|----|---|-----|---------------------|
| 1. | 2 | m2  | 10mm STEEL PLATE    |
| 2. | 2 | PKG | 3.25mm WELDING RODS |
| 3. | 1 | PC  | 9" GRINDING DISC    |

**MATERIAL COST:**

**\$ 460.00**

**INSTALLATION COST:**

**\$ 4,800.00**

**NCL 0063883**

US REPRESENTATIVE SHIP OR LAND OPERATIONS AGENCY INC.  
469 N.E. 189TH STREET MIAMI, FL 33179  
PHONE: (305) 655-0515/655-1318 FAX: (305) 655-0644



Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 287.06	OF
Date: 10.01.01	To be performed by:				
	Yard	<input type="checkbox"/>	Specialist	<input type="checkbox"/>	
Sign.:	Sub Contr.	<input checked="" type="checkbox"/>	Ship crew	<input type="checkbox"/>	
Job Description			REPAIR OF FUEL TANK 5.6		
Location:			Fwd boiler room		
Component:					
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:					
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.					
287.06		REPAIR TO FUEL TANK 5.6			
Furnish labor and material to make necessary repair to tank top on fuel tank 5.6 by fitting in new plate or weld on 10 mm doubler plate.					
Total are approx. 2 M3					
Small cement box, locate on port side Mak 16, to be removed.					
The tank in way of repair will be gas freed and certified safe for man and fire by other than Subcontractor					
<b>TO BE INCLUDED:</b>					
<input type="checkbox"/>					
GAS FREE CERTIFICATE					
<input type="checkbox"/>					
LIGHT					
<input type="checkbox"/>					
VENTILATION					
<input type="checkbox"/>					
STAGING - MTRS.					
<input checked="" type="checkbox"/>					
CLEANING BEFORE					
<input type="checkbox"/>					
CLEANING AFTER					
<input type="checkbox"/>					
CRANE					
<input type="checkbox"/>					
INTERNAL TRANSPORT					
<input type="checkbox"/>					
TRANSPORT OUTSIDE YARD					
<input type="checkbox"/>					
ACCESS					
<input type="checkbox"/>					
PRESSURE TESTING					
<input type="checkbox"/>					
CORROSION PROTECTION					
<input type="checkbox"/>					
PAINTWORK					
<input type="checkbox"/>					
LAGGING/INSULATION					
<input type="checkbox"/>					
OIL COLLECTION					
<input type="checkbox"/>					
DISPOSAL					
<input type="checkbox"/>					
MATERIAL/SPARE PARTS YARD SUPPLY					
<input checked="" type="checkbox"/>					
MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY					
<input type="checkbox"/>					
MATERIAL/SPARE PARTS OWNER'S SUPPLY					
<input type="checkbox"/>					
MATERIAL / SPARE PARTS VESSEL SUPPLY					
<input type="checkbox"/>					
<b>ENCLOSED:</b>					
<input type="checkbox"/>					
DRAWING					
<input type="checkbox"/>					
PHOTO					
<input type="checkbox"/>					
SKETCH					
<input type="checkbox"/>					
INSTRUCTION BOOK					
<input type="checkbox"/>					
SAMPLE					
<b>THE WORK TO BE SURVEYED BY:</b>					
<input type="checkbox"/>					
FLAGSTATE					
<input type="checkbox"/>					
CLASS					
<input type="checkbox"/>					
MARITIME AUTHORITIES					
<input type="checkbox"/>					
MANUFACTURER					
<input type="checkbox"/>					
SERVICE REPRESENTATIVE					
<input type="checkbox"/>					
SUPERINTENDENT					
<input checked="" type="checkbox"/>					
VESSEL					
PURCHASE ORDER (S):					
ACKNOWLEDGED DELIVERY DATE:					
DATE RECEIVED ON BOARD					
REMARKS:					
PRICE FOR ABOVE WORK:					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					

NCL 0063884



## S/S NORWAY DRYDOCK 2001

**SPEC ITEM: 431.02**

**JOB LOCATION: FORECASTLE**

---

**JOB DESCRIPTION: REBUILDING OF PORT ANCHOR CAPILLAR**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

- 1. 3 PKG HIGH TENSILE WELDING RODS**
- 2. 2 PCS 5" GRINDING DISC**

**MATERIAL COST: \$ 180.00**

**INSTALLATION COST: \$ 2,000.00**

**NCL 0063885**

**US REPRESENTATIVE SHIP OR LAND OPERATIONS AGENCY INC.**

469 N.E. 189TH STREET MIAMI, FL 33179

PHONE: (305) 655-0515/655-1318 FAX: (305) 655-0644

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 431.02	OF
Date: 25.02.02	To be performed by : Yard <input type="checkbox"/> Specialist <input type="checkbox"/>		DEPARTMENT:	Engine	x Deck
Sign.: kk	Sub Contr. <input checked="" type="checkbox"/> Ship crew <input type="checkbox"/>			Electr.	Hotel
Job Description REBUILDING OF PORT ANCHOR CAPILLAR			TO BE INCLUDED:		
Location: Forcastle			GAS FREE CERTIFICATE		
Component:			LIGHT		
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:			VENTILATION		
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.			STAGING - MTRS.		
431.02 REBUILDING OF PORT ANCHOR CAPILLAR			CLEANING BEFORE		
Subcontractor to furnish labor, material and equipment to rebuild by welding, worn anchor capillar on port side			CLEANING AFTER		
			CRANE		
			INTERNAL TRANSPORT		
			TRANSPORT OUTSIDE YARD		
			ACCESS		
			PRESSURE TESTING		
			CORROSION PROTECTION		
			PAINTWORK		
			LAGGING/INSULATION		
			OIL COLLECTION		
			DISPOSAL		
			MATERIAL/SPARE PARTS YARD SUPPLY		
			x MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY		
			MATERIAL/SPARE PARTS OWNER'S SUPPLY		
			MATERIAL / SPARE PARTS VESSEL SUPPLY		
			ENCLOSED:		
			DRAWING		
			PHOTO		
			SKETCH		
			INSTRUCTION BOOK		
			SAMPLE		
			THE WORK TO BE SURVEYED BY:		
			FLAGSTATE		
			CLASS		
			MARITIME AUTHORITIES		
			MANUFACTURER		
			SERVICE REPRESENTATIVE		
			SUPERINTENDENT		
			x VESSEL		
PURCHASE ORDER (S):					
ACKNOWLEDGED DELIVERY DATE:					
DATE RECEIVED ON BOARD					
REMARKS:					
PRICE FOR ABOVE WORK:					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					



## S/S NORWAY DRYDOCK 2001

**SPEC ITEM:** 554.02

**JOB LOCATION:** AFT STAB ROOM STB/SIDE

**JOB DESCRIPTION:** CHANGE OF CONDENSER, PROVISION  
COMPRESSOR 21

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

- |     |    |     |                            |
|-----|----|-----|----------------------------|
| 1.  | 20 | PCS | 4" 90 DEG ELB SCH 80       |
| 2.  | 12 | PCS | 4" 45 DEG ELB SCH 80       |
| 3.  | 4  | PCS | 4" C/S TEE SCH 80          |
| 4.  | 64 | PCS | 4" C/S FLG S/O             |
| 5.  | 2  | PCS | 6" x 4" C/S REDUCER SCH 80 |
| 6.  | 4  | PCS | 4" x 3" C/S REDUCER SCH 80 |
| 7.  | 1  | PC  | 4" C/S CROSS TEE SCH 80    |
| 8.  | 60 | MTR | 4" C/S PIPE SCH 80         |
| 9.  | 6  | MTR | 3" C/S PIPE SCH 80         |
| 10. | 1  | PC  | 3" C/S FLG S/O             |
| 11. | 5  | PCS | 6" C/S FLG S/O             |
| 12. | 1  | PC  | 6" C/S 90 DEG ELB SCH 80   |
| 13. | 6  | MTR | 6" C/S PIPE SCH 80         |
| 14. | 4  | PCS | 3" THERMOMETER POCKETS     |

**MATERIAL COST:** \$ 4,750.00

**INSTALLATION COST:** \$ 12,000.00

NCL 0063887

US REPRESENTATIVE SHIP OR LAND OPERATIONS AGENCY INC.

469 N.E. 189TH STREET MIAMI, FL 33179

PHONE: (305) 655-0515/655-1318 FAX: (305) 655-0644

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.	Page: 554.02	OF
Date: 03.11.00	To be performed by : Yard <input type="checkbox"/> Specialist <input type="checkbox"/>		Engine	Deck
Sign.: kk	Sub Contr. <input checked="" type="checkbox"/> Ship crew <input type="checkbox"/>		Electr.	Hotel
Job Description CHANGE OF CONDENSER PROV. COMPRESSOR 21			HVAC/R	X Club
Location: aft stabilizer room, stb. side			<b>TO BE INCLUDED:</b>	
Component:			GAS FREE CERTIFICATE	
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:			LIGHT	
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.			VENTILATION	
554.02 CHANGE OF CONDENSER, PROVISION COMPRESSOR 21			STAGING - MTRS.	
Subcontractor to furnish labor and material to change condenser for provision compressor no 21 with Owner's supplied spare.			CLEANING BEFORE	
In connection with the above, sea water cooling pipe to be renewed with fittings and sizes as follows:			CLEANING AFTER	
ND 4" bend, 90 degree: 20 pcs			CRANE	
ND 4" bend, 45 degree: 3 pcs			X INTERNAL TRANSPORT	
ND 4" bend, 30 degree: 4 pcs			TRANSPORT OUTSIDE YARD	
ND 4" bend, 15 degree: 5 pcs			ACCESS	
ND 4" T-connections, 4 pcs			PRESSURE TESTING	
ND 4" flanges, 64 pcs			CORROSION PROTECTION	
ND 6" to 4" reducers, 2 pcs			PAINTWORK	
ND 4" to 3" reducers, 4 pcs			LAGGING/INSULATION	
ND 4" X connections, 1 pc.			OIL COLLECTION	
ND 4" black steel pipe sch 80 Length 60 meter			DISPOSAL	
ND 3" flanges, 1 pcs			MATERIAL/SPARE PARTS YARD SUPPLY	
ND 3" black steel pipe sch 80 Length 3 meter			X MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY	
ND 6" flanges: 5 pcs			MATERIAL/SPARE PARTS OWNER'S SUPPLY	
ND 6" bend, 90 degree: 1 pc.			MATERIAL / SPARE PARTS VESSEL SUPPLY	
ND 6" black steel pipe, sch 80: 7 meter			<b>ENCLOSED:</b>	
4 pcs manometer connections to be made.			DRAWING	
4 pcs ND 4" gate valves to be overhauled			PHOTO	
14 pcs ND 4" butterfly valves to be overhauled, spares Owner;s suppl.			SKETCH	
PURCHASE ORDER (S):			INSTRUCTION BOOK	
ACKNOWLEDGED DELIVERY DATE:			SAMPLE	
DATE RECEIVED ON BOARD			<b>THE WORK WO BE SURVEYED BY:</b>	
REMARKS:			FLAGSTATE	
PRICE FOR ABOVE WORK:			CLASS	
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia			MARITIME AUTHORITIES	
Tel: +603 301 1333, Fax: +603 301 1399/1488			MANUFACTURER	
			SERVICE REPRESENTATIVE	
			SUPERINTENDENT	
			x VESSEL	

NCL 0063888



## **S/S NORWAY DRYDOCK 2001**

**SPEC ITEM: 555.02**

**JOB LOCATION: E-DECK MIDSHIP**

---

**JOB DESCRIPTION: REMOVAL OF INSULATION IN FREEZER ROOMS**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

**1. CONSUMPTION MATERIAL**

**MATERIAL COST: \$ 2,500.00**

**INSTALLATION COST: \$ 19,800.00**

**NCL 0063889**

**US REPRESENTATIVE SHIP OR LAND OPERATIONS AGENCY INC.**

469 N.E. 189TH STREET MIAMI, FL 33179

PHONE: (305) 655-0515/655-1318 FAX: (305) 655-0644

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 555.02	OF
Date: 21.02.01	To be performed by : Yard <input type="checkbox"/> Specialist <input type="checkbox"/>		DEPARTMENT:	Engine	Deck
Sign.: kk	Sub Contr. <input checked="" type="checkbox"/> Ship crew <input type="checkbox"/>			Electr.	Hotel
Job Description REMOVAL OF INSULATION IN FREEZER ROOMS			TO BE INCLUDED:		
Location: E-deck midship			<input type="checkbox"/> GAS FREE CERTIFICATE		
Component:			<input type="checkbox"/> LIGHT		
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:			<input type="checkbox"/> VENTILATION		
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.			<input type="checkbox"/> STAGING - MTRS.		
555.02 REMOVAL OF INSULATION IN FREEZER ROOMS			<input type="checkbox"/> CLEANING BEFORE		
Subcontractor to furnish labor and equipment to strip insulation in four freezer room, located on E-deck midship			<input checked="" type="checkbox"/> CLEANING AFTER		
Coils in all rooms to be dismantled and put aside.			<input type="checkbox"/> CRANE		
All walls and ceilings have 12 mm glass fiber covering.			<input type="checkbox"/> INTERNAL TRANSPORT		
All floors have 200 mm cork insulation and 45 mm cement on top.			<input type="checkbox"/> TRANSPORT OUTSIDE YARD		
All ceilings have 300 mm cork insulation			<input type="checkbox"/> ACCESS		
80% of wall are have 140 mm cork insulation			<input type="checkbox"/> PRESSURE TESTING		
20% of wall insulation have 500 mm insulation (towards boiler room)			<input type="checkbox"/> CORROSION PROTECTION		
Box #3 L=7800 mm, W=4500 mm, H=2050 mm			<input type="checkbox"/> PAINTWORK		
Box #4 L=7800 mm, W=4500 mm, H=2050 mm			<input type="checkbox"/> LAGGING/INSULATION		
Box #5 L=1150 mm, W=3500 mm, H=2050 mm			<input type="checkbox"/> OIL COLLECTION		
Box #1 L=3800 mm, W=2150 mm, H=2050 mm			<input checked="" type="checkbox"/> DISPOSAL		
All boxes shall be scraped and completely free of all insulation.			<input type="checkbox"/> MATERIAL/SPARE PARTS YARD SUPPLY		
All old insulation and debris to be transported containers ashore.			<input type="checkbox"/> MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY		
			<input type="checkbox"/> MATERIAL/SPARE PARTS OWNER'S SUPPLY		
			<input type="checkbox"/> MATERIAL / SPARE PARTS VESSEL SUPPLY		
			ENCLOSED:		
			<input type="checkbox"/> DRAWING		
			<input type="checkbox"/> PHOTO		
			<input type="checkbox"/> SKETCH		
			<input type="checkbox"/> INSTRUCTION BOOK		
			<input type="checkbox"/> SAMPLE		
			THE WORK TO BE SURVEYED BY:		
			<input type="checkbox"/> FLAGSTATE		
			<input type="checkbox"/> CLASS		
			<input type="checkbox"/> MARITIME AUTHORITIES		
			<input type="checkbox"/> MANUFACTURER		
			<input type="checkbox"/> SERVICE REPRESENTATIVE		
			<input type="checkbox"/> SUPERINTENDENT		
			<input checked="" type="checkbox"/> VESSEL		
PURCHASE ORDER (S):					
ACKNOWLEDGED DELIVERY DATE:					
DATE RECEIVED ON BOARD					
REMARKS:					
PRICE FOR ABOVE WORK:					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					

---





## S/S NORWAY DRYDOCK 2001

**SPEC ITEM:** 555.04

**JOB LOCATION:** E-DECK MIDSHIP

---

**JOB DESCRIPTION:** REPAIRS IN FREEZER ROOMS

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

**MATERIAL COST:**

\$

**INSTALLATION COST:**

\$ \$25.00/H/MAN

NCL 0063891

US REPRESENTATIVE SHIP OR LAND OPERATIONS AGENCY INC.

469 N.E. 189TH STREET MIAMI, FL 33179

PHONE: (305) 655-0515/655-1318 FAX: (305) 655-0644

<b>Star Cruises</b> <b>SS Norway</b> <b>SPECIFICATION OF REPAIR</b>		SPEC NO. AMOS NO. YARD NO.		<b>Page:</b> 555.04	<b>OF</b> 
<b>Date:</b> 21.02.01	<b>To be performed by :</b> Yard <input type="checkbox"/> Specialist <input type="checkbox"/>		<b>DEPARTMENT:</b>	Engine	Deck
<b>Sign.:</b> kk	Sub Contr. <input checked="" type="checkbox"/> Ship crew <input type="checkbox"/>			Electr.	Hotel
<b>Job Description</b> <b>REPAIRS IN FREEZER ROOMS</b>			<b>TO BE INCLUDED:</b>		
<b>Location:</b> E-deck midship			<input type="checkbox"/> GAS FREE CERTIFICATE		
<b>Component:</b>			<input type="checkbox"/> LIGHT		
<b>Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:</b>			<input type="checkbox"/> VENTILATION		
<b>Detailed Specification:</b> <b>Including: Size, Amount, Dimension, Material, Etc.</b>			<input type="checkbox"/> STAGING – MTRS.		
555.04                    REPAIRS IN FREEZER ROOMS			<input type="checkbox"/> CLEANING BEFORE		
Subcontractor to furnish labor and equipment to carry out any steel work, such as drain pipe renewal and insert of steel in walls, as found necessary. On Time and Material			<input checked="" type="checkbox"/> CLEANING AFTER		
Priming of all walls, floors and ceilings to be carried out with Owner's supplied primer.			<input type="checkbox"/> CRANE		
			<input type="checkbox"/> INTERNAL TRANSPORT		
			<input type="checkbox"/> TRANSPORT OUTSIDE YARD		
			<input type="checkbox"/> ACCESS		
			<input type="checkbox"/> PRESSURE TESTING		
			<input type="checkbox"/> CORROSION PROTECTION		
			<input type="checkbox"/> PAINTWORK		
			<input type="checkbox"/> LAGGING/INSULATION		
			<input type="checkbox"/> OIL COLLECTION		
			<input type="checkbox"/> DISPOSAL		
			<input type="checkbox"/> MATERIAL/SPARE PARTS YARD SUPPLY		
			<input type="checkbox"/> MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY		
			<input checked="" type="checkbox"/> MATERIAL/SPARE PARTS OWNER'S SUPPLY		
			<input type="checkbox"/> MATERIAL / SPARE PARTS VESSEL SUPPLY		
			<b>ENCLOSED:</b>		
			<input type="checkbox"/> DRAWING		
			<input type="checkbox"/> PHOTO		
			<input type="checkbox"/> SKETCH		
			<input type="checkbox"/> INSTRUCTION BOOK		
			<input type="checkbox"/> SAMPLE		
			<b>THE WORK TO BE SURVEYED BY:</b>		
			<input type="checkbox"/> FLAGSTATE		
			<input type="checkbox"/> CLASS		
			<input type="checkbox"/> MARITIME AUTHORITIES		
			<input type="checkbox"/> MANUFACTURER		
			<input type="checkbox"/> SERVICE REPRESENTATIVE		
			<input type="checkbox"/> SUPERINTENDENT		
			<input checked="" type="checkbox"/> VESSEL		
<b>PURCHASE ORDER (S):</b>					
<b>ACKNOWLEDGED DELIVERY DATE:</b>					
<b>DATE RECEIVED ON BOARD</b>					
<b>REMARKS:</b>					
<b>PRICE FOR ABOVE WORK:</b>					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					



## S/S NORWAY DRYDOCK 2001

**SPEC ITEM: 571.03**

**JOB LOCATION: AC UNIT SKY 2,3, SUN DECK**

---

**JOB DESCRIPTION: RENEWAL OF DRIP PAN IN AC UNIT**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

- 1. WATER SEAL & PIPING MATERIAL**

**MATERIAL COST: \$ 350.00**

**INSTALLATION COST: \$ 1,400.00**

**NCL 0063893**

US REPRESENTATIVE SHIP OR LAND OPERATIONS AGENCY INC.  
469 N.E. 189TH STREET MIAMI, FL 33179  
PHONE: (305) 655-0515/655-1318 FAX: (305) 655-0644

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 571.03	OF
Date: 07.11.00	To be performed by : Yard <input type="checkbox"/> Specialist <input type="checkbox"/>		DEPARTMENT:	Engine	Deck
Sign.: kk	Sub Contr. <input checked="" type="checkbox"/> Ship crew <input type="checkbox"/>			Electr.	Hotel
Job Description Renewal of drip pan in AC unit			TO BE INCLUDED:		
Location: AC unit Sky 2,3, Sun Deck			<input type="checkbox"/> GAS FREE CERTIFICATE		
Component:			<input type="checkbox"/> LIGHT		
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:			<input type="checkbox"/> VENTILATION		
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.			<input type="checkbox"/> STAGING - MTRS.		
571.03 RENEWAL OF DRIP PAN IN AC UNIT			<input type="checkbox"/> CLEANING BEFORE		
Furnish labor and equipment to remove and renew drip- pan and drain pipe from AC unit on Sky Deck			<input type="checkbox"/> CLEANING AFTER		
Drip-pan is approx . 1,5 x 0.3 meter and is spot welded on frame			<input type="checkbox"/> CRANE		
Subcontractor to fabricate a water seal for drain: ND 150 mm wide and approx 300 mm deep. A hole in the floor to be cut and seal to be mounted so no more than 100 mm is above the floor level.			<input type="checkbox"/> INTERNAL TRANSPORT		
ND 50 mm drain pipe to be fabricated from drip pan to seal and from seal to drain collector, Total length approx. 1,5 meter, several bends			<input type="checkbox"/> TRANSPORT OUTSIDE YARD		
Drip-pan is Owner's supply			<input type="checkbox"/> ACCESS		
			<input type="checkbox"/> PRESSURE TESTING		
			<input type="checkbox"/> CORROSION PROTECTION		
			<input type="checkbox"/> PAINTWORK		
			<input type="checkbox"/> LAGGING/INSULATION		
			<input type="checkbox"/> OIL COLLECTION		
			<input type="checkbox"/> DISPOSAL		
			<input type="checkbox"/> MATERIAL/SPARE PARTS YARD SUPPLY		
			<input checked="" type="checkbox"/> MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY		
			<input type="checkbox"/> MATERIAL/SPARE PARTS OWNER'S SUPPLY		
			<input type="checkbox"/> MATERIAL / SPARE PARTS VESSEL SUPPLY		
			ENCLOSED:		
			<input type="checkbox"/> DRAWING		
			<input type="checkbox"/> PHOTO		
			<input type="checkbox"/> SKETCH		
			<input type="checkbox"/> INSTRUCTION BOOK		
			<input type="checkbox"/> SAMPLE		
			THE WORK TO BE SURVEYED BY:		
			<input type="checkbox"/> FLAGSTATE		
			<input type="checkbox"/> CLASS		
			<input type="checkbox"/> MARITIME AUTHORITIES		
			<input type="checkbox"/> MANUFACTURER		
			<input type="checkbox"/> SERVICE REPRESENTATIVE		
			<input type="checkbox"/> SUPERINTENDENT		
			<input checked="" type="checkbox"/> VESSEL		
PURCHASE ORDER (S):					
ACKNOWLEDGED DELIVERY DATE:					
DATE RECEIVED ON BOARD					
REMARKS:					
PRICE FOR ABOVE WORK:					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					

NCL 0063894



## S/S NORWAY DRYDOCK 2001

**SPEC ITEM: 571.04**

**JOB LOCATION: PAL 5 NORWAY DECK FRAME 142**

---

**JOB DESCRIPTION: OVERHAUL OF DAMPERS FOR GALLEY VENTILATION**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

- 1. 1 PCS 3/16" C/S PLATE**
- 2. 1 PKG 2.5 mm WELDING RODS**
- 3. 2 PCS LUBRICATION**

**MATERIAL COST: \$ 100.00**

**INSTALLATION COST: \$ 4,800.00**

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO.		Page:	OF
Date: 08.11.00		To be performed by :		571.4	
Sign.: kk		Yard <input type="checkbox"/> Specialist <input type="checkbox"/>		AMOS NO.	
Sub Contr. <input checked="" type="checkbox"/> Ship crew <input type="checkbox"/>				YARD NO.	
Job Description		OVERHAUL OF DAMPERS FOR GALLEY VENTILATION		DEPARTMENT:	
Location:		Pal 5 Norway deck, frame 142		Engine	
Component:				Electr.	
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:				HVAC/R	
Detailed Specification:		Including: Size, Amount, Dimension, Material, Etc.		X	
571.04		OVERHAUL OF DAMPERS FOR GALLEY VENTILATION.		Deck	
Furnish labor and material to dismantle and overhaul following dampers;				Hotel	
A6, 60 x 70 cm, 2 actuators				Club	
A5, 130 x 70 cm, 5 actuators					
A4, 130 x 70 cm, 5 actuators				TO BE INCLUDED:	
A3, 90 x 80 cm, 2 actuators				GAS FREE CERTIFICATE	
A2, 90 x 70 cm, 2 actuators				LIGHT	
A1, 90 x 80 cm, 2 actuators				VENTILATION	
E5 80 x 30 cm, 1 actuator				STAGING - MTRS.	
R2, 100 x 60 cm, 2 actuators				CLEANING BEFORE	
R1, 180 x 60 cm, 2 actuators.				CLEANING AFTER	
Actuators not to be overhauled.				CRANE	
Overhaul to cover cleaning, and freeing up parts. Estimate some thin plate renewal on some flaps.				INTERNAL TRANSPORT	
All to be closed up in good working order				TRANSPORT OUTSIDE YARD	
				ACCESS	
				PRESSURE TESTING	
				CORROSION PROTECTION	
				PAINTWORK	
				LAGGING/INSULATION	
				OIL COLLECTION	
				DISPOSAL	
				MATERIAL/SPARE PARTS YARD SUPPLY	
				MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY	
				MATERIAL/SPARE PARTS OWNER'S SUPPLY	
				x MATERIAL / SPARE PARTS VESSEL SUPPLY	
				ENCLOSED:	
				DRAWING	
				PHOTO	
				SKETCH	
				INSTRUCTION BOOK	
				SAMPLE	
				THE WORK TO BE SURVEYED BY:	
				FLAGSTATE	
				CLASS	
				MARITIME AUTHORITIES	
				MANUFACTURER	
				SERVICE REPRESENTATIVE	
				SUPERINTENDENT	
				x VESSEL	
PURCHASE ORDER (S):					
ACKNOWLEDGED DELIVERY DATE:					
DATE RECEIVED ON BOARD					
REMARKS:					
PRICE FOR ABOVE WORK:					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					

NCL 0063896



## S/S NORWAY DRYDOCK 2001

**SPEC ITEM: 571.06**

**JOB LOCATION: AFT AUX. ROOM P/S**

---

**JOB DESCRIPTION: CHANGE OF GATE VALVE ON CHILLED WATER  
PUMP # 26**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

**OWNER SUPPLY**

**MATERIAL COST:**

**\$**

**INSTALLATION COST:**

**\$ 1,800.00**

**NCL 0063897**

**US REPRESENTATIVE SHIP OR LAND OPERATIONS AGENCY INC.**  
469 N.E. 189TH STREET MIAMI, FL 33179  
PHONE: (305) 655-0515/655-1318 FAX: (305) 655-0644

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 571.06	OF
Date: 10.01.01	To be performed by : Yard <input type="checkbox"/> Specialist <input type="checkbox"/>		DEPARTMENT:		
Sign.: kk	Sub Contr. <input checked="" type="checkbox"/> Ship crew <input type="checkbox"/>				
Job Description CHANGE OF GATE VALVE FOR CHILLED WATER PUMP 26			TO BE INCLUDED:		
Location: Aft aux engine room, port side			GAS FREE CERTIFICATE		
Component:			LIGHT		
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:			VENTILATION		
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.			STAGING - MTRS.		
571.06 CHANGE OF GATE VALVE ON CHILLED WATER PUMP 26			CLEANING BEFORE		
Subcontractor to furnish labor and material to remove cement box and suction valve for chilled water pump no 26. Suction pipe flange is not align with flange on pump, therefore Subcontractor to cut off ND 225 mm pipe near flange and reweld in alignment with pump flange			CLEANING AFTER		
New Owner supplied ND 225 mm valve and gasket to be mounted			CRANE		
			INTERNAL TRANSPORT		
			TRANSPORT OUTSIDE YARD		
			ACCESS		
			PRESSURE TESTING		
			CORROSION PROTECTION		
			PAINTWORK		
			LAGGING/INSULATION		
			OIL COLLECTION		
			DISPOSAL		
			MATERIAL/SPARE PARTS YARD SUPPLY		
			X MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY		
			X MATERIAL/SPARE PARTS OWNER'S SUPPLY		
			MATERIAL / SPARE PARTS VESSEL SUPPLY		
			ENCLOSED:		
			DRAWING		
			PHOTO		
			SKETCH		
			INSTRUCTION BOOK		
			SAMPLE		
			THE WORK TO BE SURVEYED BY:		
			FLAGSTATE		
			CLASS		
			MARITIME AUTHORITIES		
			MANUFACTURER		
			SERVICE REPRESENTATIVE		
			SUPERINTENDENT		
			x VESSEL		
PURCHASE ORDER (S):					
ACKNOWLEDGED DELIVERY DATE:					
DATE RECEIVED ON BOARD					
REMARKS:					
PRICE FOR ABOVE WORK:					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					

NCL 0063898





## **S/S NORWAY DRYDOCK 2001**

**SPEC ITEM: 571.16**

**JOB LOCATION: GREAT OUTDOOR RESTAURANT**

---

**JOB DESCRIPTION: RENEWAL OF EXHAUST DUCT FOR DISHWASHER**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

- 1. 12 MTR 30x 15cm S/S 304 DUCT**
- 2. 6 MTR 1" X 1" S/S 304 ANGLE BAR**

**MATERIAL COST: \$ 1,500.00**

**INSTALLATION COST: \$ 4,200.00**


**NCL 0063899**

**US REPRESENTATIVE SHIP OR LAND OPERATIONS AGENCY INC.**

469 N.E. 189TH STREET MIAMI, FL 33179

PHONE: (305) 655-0515/655-1318 FAX: (305) 655-0644

Star Cruises SS Norway <b>SPECIFICATION OF REPAIR</b>		SPEC NO. AMOS NO. YARD NO.		Page: 571.16	OF
Date: 10.01.01	To be performed by :		<b>DEPARTMENT:</b>		
Sign.: kk	Yard <input type="checkbox"/>	Specialist <input type="checkbox"/>			
	Sub Contr. <input checked="" type="checkbox"/>	Ship crew <input type="checkbox"/>	Engine	Deck	
Job Description <b>RENEWAL OF EXHAUST DUCT FOR G.O.R</b>			Electr.	Hotel	
Location: Graet outdoor restaurang			HVAC/R	X	Club
Component:			<b>TO BE INCLUDED:</b>		
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:				GAS FREE CERTIFICATE	
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.				LIGHT	
571.16	RENEWAL OF EXHAUST DUCT FOR DISHWASHER		X	VENTILATION	
Furnish labor and material to renew section of exhaust duct from dish washing machine for GOR				STAGING - MTRS.	
Approx 30 x 15 cm, length 12 meter, all stainless steel				CLEANING BEFORE	
Wooden roof to be taken down and put back up again				CLEANING AFTER	
				CRANE	
				INTERNAL TRANSPORT	
				TRANSPORT OUTSIDE YARD	
			X	ACCESS	
				PRESSURE TESTING	
				CORROSION PROTECTION	
				PAINTWORK	
				LAGGING/INSULATION	
				OIL COLLECTION	
				DISPOSAL	
				MATERIAL/SPARE PARTS YARD SUPPLY	
			X	MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY	
				MATERIAL/SPARE PARTS OWNER'S SUPPLY	
				MATERIAL / SPARE PARTS VESSEL SUPPLY	
<b>ENCLOSED:</b>					
DRAWING					
PHOTO					
SKETCH					
INSTRUCTION BOOK					
SAMPLE					
<b>THE WORK TO BE SURVEYED BY:</b>					
FLAGSTATE					
CLASS					
MARITIME AUTHORITIES					
MANUFACTURER					
SERVICE REPRESENTATIVE					
SUPERINTENDENT					
x	VESSEL				
PURCHASE ORDER (S):					
ACKNOWLEDGED DELIVERY DATE:					
DATE RECEIVED ON BOARD					
REMARKS:					
PRICE FOR ABOVE WORK:					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					

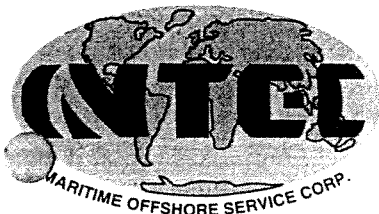

## S/S NORWAY DRYDOCK 2001

**SPEC ITEM: 571.17**

**JOB LOCATION: AFT FUNNEL AREA**

**JOB DESCRIPTION: RENEWAL OF DEMISTOR IN AIR INTAKE P/S**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

1. 24 MTR 2" x 2 x 1/4" ALUMINUM ANGLE BAR
2. 6 MTR 3" GLV PIPE SCH 40
3. 8 MTR 2" GLV PIPE SCH 40
4. 1 PC 3" C/S 90 DEG ELB
5. 1 MTR 1 1/2" GLV PIPE
6. 5 PCS 14" C/S PIPE CLAMPS

**MATERIAL COST: \$ 425.00**

**INSTALLATION COST: \$ 5,200.00**

**NCL 0063901**

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 571.17	OF
Date: 20.01.01	To be performed by : Yard <input type="checkbox"/> Specialist <input type="checkbox"/>		DEPARTMENT:		
Sign.: kk	Sub Contr. <input checked="" type="checkbox"/> Ship crew <input type="checkbox"/>				
Job Description RENEWAL OF DEMISTOR IN AIR INTAKE FOR AFT ENG ROOM PORT			TO BE INCLUDED:		
Location: Aft funnel area			<input type="checkbox"/> GAS FREE CERTIFICATE		
Component:			<input type="checkbox"/> LIGHT		
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:			<input type="checkbox"/> VENTILATION		
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.			<input type="checkbox"/> STAGING - MTRS.		
571.17 RENEWAL OF DEMISTOR IN AIR INTAKE PORT SIDE			<input type="checkbox"/> CLEANING BEFORE		
Subcontractor to furnish labor and material to remove and renew demistor for air intake for aft engine room port side.			<input type="checkbox"/> CLEANING AFTER		
Access to be made by removing gratings and cutting off 5 aluminum beams, height approx. 60 mm. To be re-welded.			<input type="checkbox"/> CRANE		
Demistor is approx. 135 x 20 x 800 cm and have 8 supporters, 10 x 40 x 200 cm. All to be removed and scrapped.			<input type="checkbox"/> INTERNAL TRANSPORT		
Subcontractor to fabricate and mount new frame of angle iron, 135 x 800 cm, and adjust size to fit Owner's supplied demistor, and fit those into frame.			<input type="checkbox"/> TRANSPORT OUTSIDE YARD		
In same area, Subcontractor to remove and renew three pipes, Using galvanize steel sch 40.			<input checked="" type="checkbox"/> ACCESS		
1 off; 3 meter long ND 3" with one short ND 1,5" branch with one bend			<input type="checkbox"/> PRESSURE TESTING		
1 off 3 meter long ND 3" with one bend			<input type="checkbox"/> CORROSION PROTECTION		
1 off 8 meter long ND 2" straight pipe			<input type="checkbox"/> PAINTWORK		
Additional in same area, 5 pcs pipe clamps for ND 14" pipe to be fabricated and installed. Pipe is insulated, therefor clamp to made of flat iron			<input checked="" type="checkbox"/> LAGGING/INSULATION		
PURCHASE ORDER (S):			<input type="checkbox"/> OIL COLLECTION		
ACKNOWLEDGED DELIVERY DATE:			<input checked="" type="checkbox"/> DISPOSAL		
DATE RECEIVED ON BOARD			<input type="checkbox"/> MATERIAL/SPARE PARTS YARD SUPPLY		
REMARKS:			<input checked="" type="checkbox"/> MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY		
PRICE FOR ABOVE WORK:			<input checked="" type="checkbox"/> MATERIAL/SPARE PARTS OWNER'S SUPPLY		
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia			<input type="checkbox"/> MATERIAL / SPARE PARTS VESSEL SUPPLY		
Tel: +603 301 1333, Fax: +603 301 1399/1488			ENCLOSED:		
			<input type="checkbox"/> DRAWING		
			<input type="checkbox"/> PHOTO		
			<input type="checkbox"/> SKETCH		
			<input type="checkbox"/> INSTRUCTION BOOK		
			<input type="checkbox"/> SAMPLE		
			THE WORK TO BE SURVEYED BY:		
			<input type="checkbox"/> FLAGSTATE		
			<input type="checkbox"/> CLASS		
			<input type="checkbox"/> MARITIME AUTHORITIES		
			<input type="checkbox"/> MANUFACTURER		
			<input type="checkbox"/> SERVICE REPRESENTATIVE		
			<input type="checkbox"/> SUPERINTENDENT		
			<input checked="" type="checkbox"/> VESSEL		



## S/S NORWAY DRYDOCK 2001

**SPEC ITEM: 571.18**

**JOB LOCATION: AFT FUNNEL AREA**

---

**JOB DESCRIPTION: RENEWAL OF DEMISTOR IN AIR INTAKE STB/S**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

- 1. 24 MTR 2" X 2" X 1/4" ALUMINUM ANGLE BAR**
- 2. 10 PCS 3" C/S BLIND FLANGES**

**MATERIAL COST: \$ 300.00**

**INSTALLATION COST: \$ 4,200.00**

US REPRESENTATIVE SHIP OR LAND OPERATIONS AGENCY INC.

469 N.E. 189TH STREET MIAMI, FL 33179  
PHONE: (305) 655-0515/655-1318 FAX: (305) 655-0644

NCL 0063903

<b>Star Cruises</b> <b>SS Norway</b> <b>SPECIFICATION OF REPAIR</b>		SPEC NO. AMOS NO. YARD NO.	<b>Page:</b> 571.18	<b>OF</b> 	
<b>Date:</b> 21.01.01	<b>To be performed by :</b> Yard <input type="checkbox"/> Specialist <input type="checkbox"/> Sub Contr. <input checked="" type="checkbox"/> Ship crew <input type="checkbox"/>	<b>DEPARTMENT:</b>	<b>Engine</b> <b>Electr.</b> <b>HVAC/R</b>	<b>Deck</b> <b>Hotel</b> <b>Club</b>	
<b>Job Description</b> RENEWAL OF DEMISTOR IN AIR INTAKE FOR AFT ENG ROOM PORT			<b>TO BE INCLUDED:</b>		
<b>Location:</b> Aft funnel area			<input type="checkbox"/> GAS FREE CERTIFICATE		
<b>Component:</b>			<input type="checkbox"/> LIGHT		
<b>Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:</b>			<input type="checkbox"/> VENTILATION		
<b>Detailed Specification:</b> Including: Size, Amount, Dimension, Material, Etc.			<input type="checkbox"/> STAGING - MTRS.		
571.18        RENEWAL OF DEMISTOR IN AIR INTAKE STB. SIDE			<input type="checkbox"/> CLEANING BEFORE		
Subcontractor to furnish labor and material to remove and renew demistor for air intake for aft engine room port side.			<input type="checkbox"/> CLEANING AFTER		
Access to be made by removing gratings and cutting off 5 aluminum beams, height approx. 60 mm. To be re-welded.			<input type="checkbox"/> CRANE		
Demistor is approx. 135 x 20 x 800 cm and have 8 supporters, 10 x 40 x 200 cm. All to be removed and scrapped.			<input type="checkbox"/> INTERNAL TRANSPORT		
Subcontractor to fabricate and mount new frame of angle iron, and adjust size to fit Owner supplied demistors into frame.			<input type="checkbox"/> TRANSPORT OUTSIDE YARD		
In same area, Subcontractor to scrap 5 pcs of old pipes, approx ND 3" and total length of 30 meter. All ends to be blanked off., total 10 pcs of blind-flanges			<input checked="" type="checkbox"/> ACCESS		
			<input type="checkbox"/> PRESSURE TESTING		
			<input type="checkbox"/> CORROSION PROTECTION		
			<input type="checkbox"/> PAINTWORK		
			<input checked="" type="checkbox"/> LAGGING/INSULATION		
			<input type="checkbox"/> OIL COLLECTION		
			<input checked="" type="checkbox"/> DISPOSAL		
			<input type="checkbox"/> MATERIAL/SPARE PARTS YARD SUPPLY		
			<input checked="" type="checkbox"/> MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY		
			<input checked="" type="checkbox"/> MATERIAL/SPARE PARTS OWNER'S SUPPLY		
			<input type="checkbox"/> MATERIAL / SPARE PARTS VESSEL SUPPLY		
			<b>ENCLOSED:</b>		
			<input type="checkbox"/> DRAWING		
			<input type="checkbox"/> PHOTO		
			<input type="checkbox"/> SKETCH		
			<input type="checkbox"/> INSTRUCTION BOOK		
			<input type="checkbox"/> SAMPLE		
			<b>THE WORK TO BE SURVEYED BY:</b>		
			<input type="checkbox"/> FLAGSTATE		
			<input type="checkbox"/> CLASS		
			<input type="checkbox"/> MARITIME AUTHORITIES		
			<input type="checkbox"/> MANUFACTURER		
			<input type="checkbox"/> SERVICE REPRESENTATIVE		
			<input type="checkbox"/> SUPERINTENDENT		
			<input checked="" type="checkbox"/> VESSEL		
<b>PURCHASE ORDER (S):</b>					
<b>ACKNOWLEDGED DELIVERY DATE:</b>					
<b>DATE RECEIVED ON BOARD</b>					
<b>REMARKS:</b>					
<b>PRICE FOR ABOVE WORK:</b>					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					



## S/S NORWAY DRYDOCK 2001

**SPEC ITEM:** 571.19

**JOB LOCATION:** AFT STAB ROOM STB SIDE

**JOB DESCRIPTION:** RENEWAL OF INSULATION

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

1. 70 MTR DN 50 x 1/2" ARMAFLEX INSULATION
2. 70 MTR DN 80 x 1/2" ARMAFLEX INSULATION
3. 20 PCS 2" x 1/8" ARMAFLEX TAPE
4. 2 GAL ADHESIVE
5. 4 PCS 1" BRUSHES

**MATERIAL COST:** \$ 1,400.00

**INSTALLATION COST:** \$ 8,200.00

NCL 0063905

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 571.19	OF
Dat 18.12.00	To be performed by :		DEPARTMENT:		
Sign.: kk	Yard <input type="checkbox"/>	Specialist <input type="checkbox"/>			
	Sub Contr. <input type="checkbox"/>	Ship crew <input type="checkbox"/>	Engine	Deck	
			Electr.	Hotel	
			HVAC/R	Club	
Job Description RENEWAL OF INSULATION			TO BE INCLUDED:		
Location: Aft Stab. Room, stb side				GAS FREE CERTIFICATE	
Component:				LIGHT	
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:			X	VENTILATION	
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.				STAGING - MTRS.	
571.19 RENEWAL OF INSULATION				CLEANING BEFORE	
Subcontractor to furnish labor and material to strip off old insulation on brine pipes in aft stabilizer room stb. side using "Armaflex" with 1 " thickness. Or similar material and quality				CLEANING AFTER	
Total 65 meter ND 50.mm				CRANE	
Some staging necessary, and some narrow access over settling tank				INTERNAL TRANSPORT	
				TRANSPORT OUTSIDE YARD	
				ACCESS	
				PRESSURE TESTING	
				CORROSION PROTECTION	
				PAINTWORK	
				LAGGING/INSULATION	
				OIL COLLECTION	
			X	DISPOSAL	
				MATERIAL/SPARE PARTS YARD SUPPLY	
			X	MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY	
				MATERIAL/SPARE PARTS OWNER'S SUPPLY	
				MATERIAL / SPARE PARTS VESSEL SUPPLY	
			ENCLOSED:		
				DRAWING	
				PHOTO	
				SKETCH	
				INSTRUCTION BOOK	
				SAMPLE	
			THE WORK TO BE SURVEYED BY:		
				FLAGSTATE	
				CLASS	
				MARITIME AUTHORITIES	
				MANUFACTURER	
				SERVICE REPRESENTATIVE	
				SUPERINTENDENT	
			x	VESSEL	
PURCHASE ORDER (S):					
ACKNOWLEDGED DELIVERY DATE:					
DATE RECEIVED ON BOARD					
REMARKS:					
PRICE FOR ABOVE WORK:					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					

NCL 0063906





## **S/S NORWAY DRYDOCK 2001**

**SPEC ITEM: 571.20**

**JOB LOCATION: D-DECK MID SHIP PROVISION HANDLING AREA**

---

**JOB DESCRIPTION: RENEWAL OF INSULATION**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

- 1. NOT SPECIFIED ANY SIZE OF PIPES  
WILL CONFIRM MATERIAL & SCOPE OF WORK NEEDED WHEN  
SHEET METAL HAS BEEN REMOVED**

**MATERIAL COST:**

**\$**

**INSTALLATION COST:**

**\$**

**SAME AS MTRL**

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 571.20	OF
Date: 18.12.00	To be performed by :		DEPARTMENT:		
Sign.: kk	Yard <input type="checkbox"/>	Specialist <input type="checkbox"/>			
	Sub Contr. <input checked="" type="checkbox"/>	Ship crew <input type="checkbox"/>			
Job Description RENEWAL OF INSULATION			TO BE INCLUDED:		
Location: D-deck midship provision handling space			<input type="checkbox"/> GAS FREE CERTIFICATE		
Component:			<input type="checkbox"/> LIGHT		
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:			<input type="checkbox"/> VENTILATION		
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.			<input type="checkbox"/> STAGING - MTRS.		
571.20 RENEWAL OF INSULATION			<input type="checkbox"/> CLEANING BEFORE		
Several pipes is insulated together in a box shaped form, 40 x 40 x 500 cm, located under the sealing.			<input checked="" type="checkbox"/> CLEANING AFTER		
Subcontractor to furnish labor and material to strip off old insulation and replace with new heat resistant insulation material, Subcontractor's supply			<input type="checkbox"/> CRANE		
Sealing to be put back again			<input type="checkbox"/> INTERNAL TRANSPORT		
			<input type="checkbox"/> TRANSPORT OUTSIDE YARD		
			<input type="checkbox"/> ACCESS		
			<input type="checkbox"/> PRESSURE TESTING		
			<input type="checkbox"/> CORROSION PROTECTION		
			<input type="checkbox"/> PAINTWORK		
			<input checked="" type="checkbox"/> LAGGING/INSULATION		
			<input type="checkbox"/> OIL COLLECTION		
			<input checked="" type="checkbox"/> DISPOSAL		
			<input type="checkbox"/> MATERIAL/SPARE PARTS YARD SUPPLY		
			<input checked="" type="checkbox"/> MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY		
			<input type="checkbox"/> MATERIAL/SPARE PARTS OWNER'S SUPPLY		
			<input type="checkbox"/> MATERIAL / SPARE PARTS VESSEL SUPPLY		
<b>ENCLOSED:</b>					
<input type="checkbox"/> DRAWING					
<input type="checkbox"/> PHOTO					
<input type="checkbox"/> SKETCH					
<input type="checkbox"/> INSTRUCTION BOOK					
<input type="checkbox"/> SAMPLE					
<b>THE WORK TO BE SURVEYED BY:</b>					
<input type="checkbox"/> FLAGSTATE					
<input type="checkbox"/> CLASS					
<input type="checkbox"/> MARITIME AUTHORITIES					
<input type="checkbox"/> MANUFACTURER					
<input type="checkbox"/> SERVICE REPRESENTATIVE					
<input type="checkbox"/> SUPERINTENDENT					
<input checked="" type="checkbox"/> VESSEL					
PURCHASE ORDER (S):					
ACKNOWLEDGED DELIVERY DATE:					
DATE RECEIVED ON BOARD					
REMARKS:					
PRICE FOR ABOVE WORK:					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					

NCL 0063908



## **S/S NORWAY DRYDOCK 2001**

**SPEC ITEM: 571.21**

**JOB LOCATION: AFT STAB ROOM STB/SIDE**

---

**JOB DESCRIPTION: RENEWAL OF INSULATION FOR BRINE PIPES**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

- 1. NOT SPECIFIED ANY SIZE OF PIPES  
WILL CONFIRM MATERIAL & SCOPE OF WORK NEEDED WHEN  
SHEET METAL HAS BEEN REMOVED**

**MATERIAL COST:**

**\$**

**INSTALLATION COST:**

**\$**

**SAME AS MTRL**

**NCL 0063909**

**US REPRESENTATIVE SHIP OR LAND OPERATIONS AGENCY INC.**

469 N.E. 189TH STREET MIAMI, FL 33179

PHONE: (305) 655-0515/655-1318 FAX: (305) 655-0644

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 571.21	OF
Date: 19.12.00	To be performed by :		DEPARTMENT:	Engine	Deck
Sign.: kk	Yard <input type="checkbox"/>	Specialist <input type="checkbox"/>		Electr.	Hotel
	Sub Contr. <input checked="" type="checkbox"/>	Ship crew <input type="checkbox"/>		HVAC/R	X Club
Job Description RENEWAL OF INSULATION FOR BRINE PIPE				TO BE INCLUDED:	
Location: Aft stab. Room stb. side				<input type="checkbox"/>	GAS FREE CERTIFICATE
Component:				<input type="checkbox"/>	LIGHT
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:				<input type="checkbox"/>	VENTILATION
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.				<input type="checkbox"/>	STAGING - MTRS.
571.21 RENEWAL OF INSULATION FOR BRINE PIPES				<input checked="" type="checkbox"/>	CLEANING BEFORE
Furnish labor and material to remove and renew insulation for several brine pipes over brine pumps in aft stabilizer room, stb. side				<input checked="" type="checkbox"/>	CLEANING AFTER
Insulation is covered in sheet metal and is box - shaped, approximately 1,5 x 1,0 x 3,0 meter. Subcontractor to use heat resistant insulation to build up insulation similar to existing.				<input type="checkbox"/>	CRANE
				<input type="checkbox"/>	INTERNAL TRANSPORT
				<input type="checkbox"/>	TRANSPORT OUTSIDE YARD
				<input type="checkbox"/>	ACCESS
				<input type="checkbox"/>	PRESSURE TESTING
				<input type="checkbox"/>	CORROSION PROTECTION
				<input type="checkbox"/>	PAINTWORK
				<input checked="" type="checkbox"/>	LAGGING/INSULATION
				<input type="checkbox"/>	OIL COLLECTION
				<input checked="" type="checkbox"/>	DISPOSAL
				<input type="checkbox"/>	MATERIAL/SPARE PARTS YARD SUPPLY
				<input checked="" type="checkbox"/>	MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY
				<input type="checkbox"/>	MATERIAL/SPARE PARTS OWNER'S SUPPLY
				<input type="checkbox"/>	MATERIAL / SPARE PARTS VESSEL SUPPLY
				ENCLOSED:	
				<input type="checkbox"/>	DRAWING
				<input type="checkbox"/>	PHOTO
				<input type="checkbox"/>	SKETCH
				<input type="checkbox"/>	INSTRUCTION BOOK
				<input type="checkbox"/>	SAMPLE
				THE WORK TO BE SURVEYED BY:	
				<input type="checkbox"/>	FLAGSTATE
				<input type="checkbox"/>	CLASS
				<input type="checkbox"/>	MARITIME AUTHORITIES
				<input type="checkbox"/>	MANUFACTURER
				<input type="checkbox"/>	SERVICE REPRESENTATIVE
				<input type="checkbox"/>	SUPERINTENDENT
				<input checked="" type="checkbox"/>	VESSEL
PURCHASE ORDER (S):					
ACKNOWLEDGED DELIVERY DATE:					
DATE RECEIVED ON BOARD					
REMARKS:					
PRICE FOR ABOVE WORK:					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					



## **S/S NORWAY DRYDOCK 2001**

**SPEC ITEM: 571.22**

**JOB LOCATION: AFT AUX ENG ROOM P/S**

---

**JOB DESCRIPTION OVERHAUL CHILLED WATER PUMP VALVES**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

- 1. 1 ROLL OF SHOP ROLL**

**ANY NEEDED BOLTS OR SPARE PARTS TO BE SUPPLIED BY OWNER**

**THIS INCLUDES CLEANING OF SEAT, SPINDLE, AND NEW OWNER SUPPLIED GLAND PACKING**

**MATERIAL COST: \$ 15,00**

**INSTALLATION COST: \$ 4,200.00**

**NCL 0063911**

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 571.22	OF
Date: 18.12.00	To be performed by :		DEPARTMENT:		
Sign.: kk	Yard <input type="checkbox"/>	Specialist <input type="checkbox"/>	Engine	Deck	
	Sub Contr. <input checked="" type="checkbox"/>	Ship crew <input type="checkbox"/>	Electr.	Hotel	
Job Description OVERHAUL OF CHILLED WATER PUMP VALVES			HVAC/R	X	Club
Location: Aft aux engine room, port side			TO BE INCLUDED:		
Component:			GAS FREE CERTIFICATE		
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:			LIGHT		
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.			VENTILATION		
571.22 OVERHAUL OF CHILLED WATER PUMP VALVES			STAGING - MTRS.		
Subcontractor to furnish labor to overhaul seven (7) pcs of inlet and outlet gate valves for chilled water pumps.			CLEANING BEFORE		
All valve sizes is ND 225			CLEANING AFTER		
			CRANE		
			INTERNAL TRANSPORT		
			TRANSPORT OUTSIDE YARD		
			ACCESS		
			PRESSURE TESTING		
			CORROSION PROTECTION		
			PAINTWORK		
			LAGGING/INSULATION		
			OIL COLLECTION		
			DISPOSAL		
			MATERIAL/SPARE PARTS YARD SUPPLY		
			MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY		
			MATERIAL/SPARE PARTS OWNER'S SUPPLY		
			x MATERIAL / SPARE PARTS VESSEL SUPPLY		
			ENCLOSED:		
			DRAWING		
			PHOTO		
			SKETCH		
			INSTRUCTION BOOK		
			SAMPLE		
			THE WORK TO BE SURVEYED BY:		
			FLAGSTATE		
			CLASS		
			MARITIME AUTHORITIES		
			MANUFACTURER		
			SERVICE REPRESENTATIVE		
			SUPERINTENDENT		
			x VESSEL		
PURCHASE ORDER (S):					
ACKNOWLEDGED DELIVERY DATE:					
DATE RECEIVED ON BOARD					
REMARKS:					
PRICE FOR ABOVE WORK:					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					

NCL 0063912



## **S/S NORWAY DRYDOCK 2001**

**SPEC ITEM: 571.23**

**JOB LOCATION: FWD AUX ENG ROOM**

**JOB DESCRIPTION OVERHAUL CHILLWATER PUMP VALVES**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

- 1. 1 ROLL OF SHOP ROLL**

**ANY NEEDED BOLTS OR SPARE PARTS TO BE SUPPLIED BY OWNER**

**THIS INCLUDES CLEANING OF SEAT, SPINDLE, AND NEW OWNER SUPPLIED GLAND PACKING**

**MATERIAL COST: \$ 15,00**

**INSTALLATION COST: \$ 5,400.00**

**NCL 0063913**

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 571.23	OF
Date: 18.12.00	To be performed by :				
	Yard	<input type="checkbox"/>	Specialist	<input type="checkbox"/>	
Sign.: kk	Sub Contr.	<input checked="" type="checkbox"/>	Ship crew	<input type="checkbox"/>	
Job Description			DEPARTMENT:		
OVERHAUL OF CHILLWATER PUMP VALVES			Engine	X	Deck
Location: Fwd aux engine room			Electr.		Hotel
Component:			HVAC/R		Club
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:			TO BE INCLUDED:		
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.			GAS FREE CERTIFICATE		
571.23 OVERHAUL OF CHILLWATER PUMP VALVES			LIGHT		
Subcontractor to furnish labor to overhaul total of nine (9) inlet and outlet gate valve for chill water pumps			VENTILATION		
Sizes all valves is ND 225			STAGING - MTRS.		
			CLEANING BEFORE		
			CLEANING AFTER		
			CRANE		
			INTERNAL TRANSPORT		
			TRANSPORT OUTSIDE YARD		
			ACCESS		
			PRESSURE TESTING		
			CORROSION PROTECTION		
			PAINTWORK		
			LAGGING/INSULATION		
			OIL COLLECTION		
			DISPOSAL		
			MATERIAL/SPARE PARTS YARD SUPPLY		
			MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY		
			MATERIAL/SPARE PARTS OWNER'S SUPPLY		
			x MATERIAL / SPARE PARTS VESSEL SUPPLY		
			ENCLOSED:		
			DRAWING		
			PHOTO		
			SKETCH		
			INSTRUCTION BOOK		
			SAMPLE		
			THE WORK TO BE SURVEYED BY:		
			FLAGSTATE		
			CLASS		
			MARITIME AUTHORITIES		
			MANUFACTURER		
			SERVICE REPRESENTATIVE		
			SUPERINTENDENT		
			x VESSEL		
PURCHASE ORDER (S):					
ACKNOWLEDGED DELIVERY DATE:					
DATE RECEIVED ON BOARD					
REMARKS:					
PRICE FOR ABOVE WORK:					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					

NCL 0063914





## S/S NORWAY DRYDOCK 2001

**SPEC ITEM: 574.01**

**JOB LOCATION: FWD FUNNEL NEAR TOP**

**JOB DESCRIPTION: FABRICATION OF EXHAUST DUCT**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

1. 4 MTR 500 x 400mm 1/4" STEEL DUCT
2. 1 PC 500 x 400mm STEEL FLANGE
3. 1 PCS 1/4" 48" x 96" STEEL PLATE
4. 12 MTR 1/4" x 1 1/2" C/S ANGLE BAR

**MATERIAL COST: \$ 1,575.00**

**INSTALLATION COST: \$ 3,600.00**

**NCL 0063915**

US REPRESENTATIVE SHIP OR LAND OPERATIONS AGENCY INC.  
469 N.E. 189TH STREET MIAMI, FL 33179  
PHONE: (305) 655-0515/655-1318 FAX: (305) 655-0644

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 574.01	OF
Date: 12.11.00	To be performed by :		DEPARTMENT:		
Sign.: kk	Yard <input type="checkbox"/>	Specialist <input type="checkbox"/>			
	Sub Contr. <input checked="" type="checkbox"/>	Ship crew <input type="checkbox"/>	Engine	Deck	
			Electr.	Hotel	
			HVAC/R	X	Club
Job Description			TO BE INCLUDED:		
Location: Fwd funnel, near top			<input type="checkbox"/> GAS FREE CERTIFICATE		
Component:			<input type="checkbox"/> LIGHT		
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:			<input checked="" type="checkbox"/> VENTILATION		
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.			<input checked="" type="checkbox"/> STAGING - MTRS.		
574.01 FABRICATION OF EXHAUST DUCT			<input type="checkbox"/> CLEANING BEFORE		
Exhaust duct from separator room ends approx. 4 meter from top of fwd funnel, fire damper level. Subcontractor to furnish labor and material to fabricate remaining of exhaust duct to above fire damper level.			<input type="checkbox"/> CLEANING AFTER		
*Subcontractor to cut end and weld in flange			<input type="checkbox"/> CRANE		
*Fabricate new duct 500 x 400 mm x approx. 4 meter through existing lid/cover, - duct will be nearly straight			<input type="checkbox"/> INTERNAL TRANSPORT		
*Install Owner's supplied bellow between new and old ducting			<input type="checkbox"/> TRANSPORT OUTSIDE YARD		
*Close off excess opening between duct and removed lid/cover			<input type="checkbox"/> ACCESS		
*Fabricate supports as necessary			<input type="checkbox"/> PRESSURE TESTING		
Staging necessary			<input type="checkbox"/> CORROSION PROTECTION		
			<input type="checkbox"/> PAINTWORK		
			<input type="checkbox"/> LAGGING/INSULATION		
			<input type="checkbox"/> OIL COLLECTION		
			<input type="checkbox"/> DISPOSAL		
			<input type="checkbox"/> MATERIAL/SPARE PARTS YARD SUPPLY		
			<input checked="" type="checkbox"/> MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY		
			<input type="checkbox"/> MATERIAL/SPARE PARTS OWNER'S SUPPLY		
			<input type="checkbox"/> MATERIAL / SPARE PARTS VESSEL SUPPLY		
			ENCLOSED:		
			<input type="checkbox"/> DRAWING		
			<input type="checkbox"/> PHOTO		
			<input type="checkbox"/> SKETCH		
			<input type="checkbox"/> INSTRUCTION BOOK		
			<input type="checkbox"/> SAMPLE		
			THE WORK TO BE SURVEYED BY:		
			<input type="checkbox"/> FLAGSTATE		
			<input type="checkbox"/> CLASS		
			<input type="checkbox"/> MARITIME AUTHORITIES		
			<input type="checkbox"/> MANUFACTURER		
			<input type="checkbox"/> SERVICE REPRESENTATIVE		
			<input type="checkbox"/> SUPERINTENDENT		
			<input checked="" type="checkbox"/> VESSEL		
PURCHASE ORDER (S):					
ACKNOWLEDGED DELIVERY DATE:					
DATE RECEIVED ON BOARD					
REMARKS:					
PRICE FOR ABOVE WORK:					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					



## **S/S NORWAY DRYDOCK 2001**

**SPEC ITEM: 721.12**

**JOB LOCATION: FWD ENG ROOM FRAME 194 P/S**

---

**JOB DESCRIPTION OVERHAUL SEAWATER VALVES FOR CENTRAL COOLER**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

**1 ROLL OF SHOP CLOTH**

**MATERIAL COST: \$ 15.00**

**INSTALLATION COST: \$ 450.00**

US REPRESENTATIVE SHIP OR LAND OPERATIONS AGENCY INC.  
469 N.E. 189TH STREET MIAMI, FL 33179  
PHONE: (305) 655-0515/655-1318 FAX: (305) 655-0644

**NCL 0063917**

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 721.12	OF
Date: 10.01.01	To be performed by : Yard <input type="checkbox"/> Specialist <input type="checkbox"/>		DEPARTMENT:	Engine	X Deck
Sign.: kk	Sub Contr. <input checked="" type="checkbox"/> Ship crew <input type="checkbox"/>			Electr.	Hotel
Job Description OVERHAUL OF SEAWATER VALVES			TO BE INCLUDED:		
Location: Fwd engine room, port side, frame 194			GAS FREE CERTIFICATE		
Component:			LIGHT		
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:			VENTILATION		
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.			STAGING - MTRS.		
721.12 OVERHAUL OF SEAWATER VALVES			CLEANING BEFORE		
Furnish labor to overhaul gear operated butterfly valves for seawater pump to central cooler			CLEANING AFTER		
One (1) 8 inch			CRANE		
One (1) 12 inch			INTERNAL TRANSPORT		
			TRANSPORT OUTSIDE YARD		
			ACCESS		
			PRESSURE TESTING		
			CORROSION PROTECTION		
			PAINTWORK		
			LAGGING/INSULATION		
			OIL COLLECTION		
			DISPOSAL		
			MATERIAL/SPARE PARTS YARD SUPPLY		
			MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY		
			MATERIAL/SPARE PARTS OWNER'S SUPPLY		
			x MATERIAL / SPARE PARTS VESSEL SUPPLY		
			ENCLOSED:		
			DRAWING		
			PHOTO		
			SKETCH		
			INSTRUCTION BOOK		
			SAMPLE		
			THE WORK TO BE SURVEYED BY:		
			FLAGSTATE		
			CLASS		
			MARITIME AUTHORITIES		
			MANUFACTURER		
			SERVICE REPRESENTATIVE		
			SUPERINTENDENT		
			x VESSEL		
PURCHASE ORDER (S):					
ACKNOWLEDGED DELIVERY DATE:					
DATE RECEIVED ON BOARD					
REMARKS:					
PRICE FOR ABOVE WORK:					
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488					

NCL 0063918



## S/S NORWAY DRYDOCK 2001

**SPEC ITEM: 721.13**

**JOB LOCATION: FWD BOILER ROOM FRAME 201 P/S**

---

**JOB DESCRIPTION OVERHAUL SEAWATER VALVES FOR CENTRAL COOLER**

**CARPENTER NEEDED:**

**MATERIAL REQUIRED:**

**1 ROLL OF SHOP CLOTH**

**MATERIAL COST: \$ 15.00**

**INSTALLATION COST: \$ 450.00**

**NCL 0063919**

Star Cruises SS Norway SPECIFICATION OF REPAIR		SPEC NO. AMOS NO. YARD NO.		Page: 721.13	OF		
Date: 10.02.01	To be performed by : Yard <input type="checkbox"/> Specialist <input type="checkbox"/>		DEPARTMENT:	Engine	X	Deck	
Sign.: kk	Sub Contr. <input checked="" type="checkbox"/> Ship crew <input type="checkbox"/>			Electr.		Hotel	
Job Description OVERHAUL OF SEAWATER VALVES			TO BE INCLUDED:				
Location: Fwd Boiler room, frame 201, port side			GAS FREE CERTIFICATE				
Component:			LIGHT				
Maker, Type, Serial No, Effect, Weight, Volume, RPM, Volt, Etc.:			VENTILATION				
Detailed Specification: Including: Size, Amount, Dimension, Material, Etc.			STAGING - MTRS.				
721.13 OVERHAUL SEAWATER VALVES FOR CENTRAL COOLER			CLEANING BEFORE				
Furnish labor and material to overhaul two (2) gear operated butterfly valves for central cooler , both 8-inches			CLEANING AFTER				
			CRANE				
			INTERNAL TRANSPORT				
			TRANSPORT OUTSIDE YARD				
			ACCESS				
			PRESSURE TESTING				
			CORROSION PROTECTION				
			PAINTWORK				
			LAGGING/INSULATION				
			OIL COLLECTION				
			DISPOSAL				
			MATERIAL/SPARE PARTS YARD SUPPLY				
			MATERIAL/SPARE PARTS SUB-CONTRACTOR SUPPLY				
			MATERIAL/SPARE PARTS OWNER'S SUPPLY				
			x MATERIAL / SPARE PARTS VESSEL SUPPLY				
			ENCLOSED:				
			DRAWING				
			PHOTO				
			SKETCH				
			INSTRUCTION BOOK				
			SAMPLE				
			THE WORK TO BE SURVEYED BY:				
			FLAGSTATE				
			CLASS				
			MARITIME AUTHORITIES				
			MANUFACTURER				
			SERVICE REPRESENTATIVE				
			SUPERINTENDENT				
			x VESSEL				
PURCHASE ORDER (S):							
ACKNOWLEDGED DELIVERY DATE:							
DATE RECEIVED ON BOARD							
REMARKS:							
PRICE FOR ABOVE WORK:							
Star Cruises, Palau Indah, P.O. Box 288, 42009 Pelabuhan Klang, Selangor DE, Malaysia Tel: +603 301 1333, Fax: +603 301 1399/1488							

NCL 0063920



## GENERAL NOTES

ALL INTERFERENCE SUCH AS CABLE AND PIPE PENETRATION ,  
REROUTING OF PIPES ETC. WHICH ARE NOT POINTED OUT IN THE  
SPECIFICATION ARE TO BE BILLED SEPARATELY

NO ELECTRICAL INTERFERENCE OR OTHER ELECTRICAL WORK ARE  
INCLUDED IN OUR SPECIFICATION.

ALL DESCRIPTIONS AND COST ARE BASED ON SPECIFICATION MADE BY  
NCL

---

ANY OTHER WORK NOT INCLUDED IN SPECIFICATION WILL BE CHARGED  
AND BILLED AT A RATE OF \$25.00 / HOUR PER MAN FOR REGULAR  
WORKERS AND AT \$30.00 / HOUR PER MAN FOR SUPERVISORS

ANY AND ALL EXTRA MATERIAL NOT INCLUDED IN THE SPECIFICATION  
WILL BE BILLED UPON RECEIVED DELIVERY TICKET.

SHIP TO SUPPLY:

NECESSARY FIREWATCH. ALL GASES SUCH AS OXYGEN, ACETYLENE,  
ARGON WILL BE SUPPLIED BY THE SHIP  
ACCOMMODATIONS, FOOD AND LAUNDRY SERVICE FOR COVERALLS

ANY OTHER COST RELATED TO THE TRANSPORTATION SUCH AS TAXI  
HOTEL, ETC. WILL BE BILLED UPON RECEIPT SEPARATELY.

ALL FREIGHT TO BE BILLED SEPARATELY UPON RECEIPT.

TRAVEL TIME TO BE BILLED SEPARATELY AT \$ 18.00/H/MEN NOT TO  
EXCEED 15.00 HOUR ONE WAY.

DELIVERY TIME 1-4 WEEKS AS OF TODAY FOB MIAMI & GERMANY

NOT INCLUDED IN THE QUOTE IS CLEANING OR GAS FREEING OF TANKS  
OR TANK TOPS DONE BY OTHERS.

---

NCL 0063921

US REPRESENTATIVE SHIP OR LAND OPERATIONS AGENCY INC.

469 N.E. 189TH STREET MIAMI, FL 33179  
PHONE: (305) 655-0515/655-1318 FAX: (305) 655-0644



## S/S NORWAY COST SHEET FOR ADDITIONAL WORK

223.01	\$ 160.00	\$ 1,400.00
226.02	\$ 220.00	\$ 4,200.00
226.03	\$ 120.00	\$ 3,800.00
252.01	\$ 5,400.00	\$ 19,800.00
252.03	\$ 500.00	\$ 4,400.00
252.04	\$ 120.00	\$ 1,400.00
252.05	\$ 160.00	\$ 1,800.00
252.06	\$ 120.00	\$ 1,400.00
<hr/>		
285.02	\$ 470.00	\$ 6,000.00
285.03	\$ 470.00	\$ 6,000.00
287.06	\$ 460.00	\$ 4,800.00
431.02	\$ 180.00	\$ 2,000.00
554.02	\$ 4,750.00	\$ 12,000.00
555.02	\$ 2,500.00	\$ 19,800.00
555.04	TM	TM
571.03	\$ 350.00	\$ 1,400.00
571.04	\$ 100.00	\$ 4,800.00
571.06	OWS	\$ 1,800.00
571.16	\$ 1,500.00	\$ 4,200.00
571.17	\$ 425.00	\$ 5,200.00
571.18	\$ 300.00	\$ 4,200.00
571.19	\$ 1,400.00	\$ 8,200.00
571.20	NQ	NQ
571.21	NQ	NQ
571.22	\$ 15.00	\$ 4,200.00
571.23	\$ 15.00	\$ 5,400.00
574.01	\$ 1,575.00	\$ 3,600.00
721.12	\$ 15.00	\$ 450.00
721.13	\$ 15.00	\$ 450.00
CONSUMPTION	\$ 3,250.00	
TOTAL	\$ 24,590.00	\$ 132,700.00





## PAYMENT TERMS

30 % OF DRY-DOCK COST  
UPON ACCEPTANCE OF ORDER

---

40 % UPON COMPLETION OF CONTRACT WORK

30 % NET 30 DAYS ACCORDING TO INVOICE

---

EMAIL : [INTECST@BELLSOUTH.NET](mailto:INTECST@BELLSOUTH.NET)  
US REPRESENTATIVE SHIP OR LAND OPERATIONS AGENCY INC.  
469 N.E. 189TH STREET MIAMI, FL 33179  
PHONE: (305) 655-0515/655-1318 FAX: (305) 655-0644

NCL 0063923